

June 28, 2019 File No. 262018.063

Ms. Corina Forson Chief Hazards Geologist State of Washington Department of Natural Resources Washington Geological Survey 111 Washington Street SE Olympia, Washington 98504 Mr. Scott Black
Program Development Manager
State of Washington
Office of Superintendent of Public Instruction
600 Washington Street
Olympia, Washington 98504

Subject: Department of Natural Resources Washington Geological Survey,

School Seismic Safety Assessment Project, Contract No. AE 410 - Seismic Evaluation for **White Salmon Valley School District**

Dear Ms. Forson and Mr. Black:

Reid Middleton and our consultant team, under the direction of The Department of Natural Resources (DNR) Washington Geological Survey (WGS) School Seismic Safety Project, have conducted seismic evaluations of 222 school buildings and 5 fire stations throughout Washington State. This letter is transmitting the results of these seismic assessments for each school district that graciously participated in this statewide study. We understand that you will be forwarding this letter and the accompanying seismic screening reports to each school district for their reference and use.

Many disparate studies on improving the seismic safety of our public school buildings have been performed over the last several decades. Experts in building safety, geologic hazards, emergency management, education, and even the news media have been asserting for decades that seismic risks in older public school buildings represent a risk to our communities. The time to act is now, before we have a damaging earthquake and/or tsunami that could be catastrophic. This statewide school seismic safety assessment project provides a unique opportunity to draw attention to the need for statewide seismic safety policies and funding on behalf of all school districts that will help enable school districts to increase the seismic safety of their older buildings to make them safer for students, teachers, staff, parents, and the community.

It is not the intent of this study to create an unfunded mandate for school districts to seismically upgrade their schools without associated funding or statewide seismic safety policy support. The overall goal of this study was to screen and evaluate the current levels of seismic vulnerabilities of a statewide selection of our older public school buildings and to use the data and information to help quantify funding and policy needs to improve the seismic safety of our public schools. In this process, we are using the information to inform not only the Governor

EVERETT
728 134th Street SW
Suite 200
Everett, WA 98204
425 741-3800

and the Legislature of the policy and funding needs for seismically safe schools but also the school districts that participated in the study.

School Buildings Evaluated in the White Salmon Valley School District

We appreciate White Salmon Valley School District's participation and invaluable assistance in this statewide project. The following school district buildings were included as part of this study:

- 1. Columbia High School, C Court Gym
- 2. Columbia High School, Library
- 3. Columbia High School, Metal/Wood Shop
- 4. Hulan L. Whitson Elementary School, Main Building Concrete
- 5. Hulan L. Whitson Elementary School, Main Building Masonry
- 6. Wayne M. Henkle Middle School, Middle School

The seismic screening of these buildings was performed using the American Society of Civil Engineers' Standard 41-17, *Seismic Evaluation and Retrofit of Existing Buildings* (ASCE 41-17), national standard Tier 1 structural and nonstructural seismic screening checklists specific to each building's structure type.

The WGS also conducted seismic site class assessments to measure the shear wave velocity and determine the soil site class at each campus. Site class is an approximation of how much soils at a site will amplify earthquake-induced ground motions and is a critical parameter used in seismic design. Reid Middleton subsequently used this information in their seismic screening analyses.

The following table is a list of available seismic assessment information used in our study:

School Building	Year Constructed	FEMA Building Classification	Structural Drawings Available for Review
Columbia High School, C Court – Gym	1970	Tilt-Up Concrete Shear Walls with Rigid Diaphragm	Yes
Columbia High School, Library	1970	Tilt-Up Concrete Shear Walls	Yes
Columbia High School, Metal/Wood Shop	1970	Tilt-Up Concrete Shear Walls	Yes
Hulan L. Whitson Elementary School, Main Building – Concrete	1956	Concrete Shear Walls with Bearing Walls	Yes
Hulan L. Whitson Elementary School, Main Building – Masonry	1956	Unreinforced Masonry Bearing Walls	Yes
Wayne M. Henkle Middle School, Middle School	1960	Reinforced Masonry Walls with Flexible Diaphragms	Yes



Department of Natural Resources Washington Geological Survey School Seismic Safety Project – White Salmon Valley School District June 28, 2019 File No. 262018.063 Page 3

Detailed descriptions of the seismic screening evaluations of these buildings can be found in the individual building reports and the ASCE 41-17 Tier 1 screening checklist documents enclosed with this letter. This information will also be available for download on the WGS website: https://www.dnr.wa.gov/programs-and-services/geology/geologic-hazards/earthquakes-and-faults/school-seismic-safety.

These Tier 1 seismic screening checklists are often the first step employed by structural engineers when trying to determine the seismic vulnerabilities of existing buildings and to begin a process of mitigating these seismic vulnerabilities. School district facilities management personnel and their design consultants should be able to take advantage of this information to help inform and address seismic risks in existing or future renovation, repair, or modernization projects.

It is important to note that information used for these school seismic screenings was limited to available construction drawings and limited site observations by our team of licensed structural engineers to observe the general conditions and configuration of each building being seismically screened. In many cases, construction drawings were not available for review as noted in the table above. Due to the limited scope of the study, our team of engineers were not able to perform more-detailed investigations above ceilings, behind wall finishes, in confined spaces, or in other areas obstructed from view. Where building component seismic adequacy was unknown due to lack of available information, the unknown conditions were indicated as such on the ASCE 41-17 Tier 1 checklists. Additional field investigations are recommended for the "unknown" seismic evaluation checklist items if more-definitive determinations of seismic safety compliance and further development of seismic mitigation strategies are desired.

Nonstructural Seismic Screening

The enclosed ASCE 41-17 Tier 1 Nonstructural Seismic Screening checklists can provide immediate guidance on seismic deficiencies in nonstructural elements. Mitigating the risk of earthquake impacts from these nonstructural elements should be addressed as soon as practical by school districts. Some nonstructural elements may be easily mitigated by installing seismic bracing of tall cabinets, moving heavy contents to the bottom of shelving, and adding seismic strapping or bracing to water tanks and overhead elements (light fixtures, mechanical units, piping, fire protection systems, etc.).

It is often most economical to mitigate nonstructural seismic hazards when the building is already undergoing mechanical, electrical, plumbing, or architectural upgrades or modernizations. Enclosed with these nonstructural seismic screening checklists are excerpts from the Federal Emergency Management Agency (FEMA) publication E-74 entitled, *Reducing the Risks of Nonstructural Earthquake Damage* (FEMA E-74). We have included these FEMA publication excerpts to help illustrate typical seismic mitigation measures that can potentially be implemented by district facilities and maintenance personnel.



Department of Natural Resources Washington Geological Survey School Seismic Safety Project – White Salmon Valley School District June 28, 2019 File No. 262018.063 Page 4

Structural Seismic Screening

The enclosed ASCE 41-17 Tier 1 Structural Seismic Screening checklists have evaluation statements that are reviewed for specific building elements and systems to determine if these items are seismically compliant, noncompliant, not applicable, or unknown. These evaluation statements provide guidance on which structural systems and elements have identified seismic deficiencies and should be investigated further. Further seismic evaluations beyond these seismic screening checklists typically consist of more-detailed seismic structural analyses to better define the seismic vulnerabilities and risks. This information is then used to determine cost-effective ways to seismically improve these buildings with stand-alone seismic upgrade projects or incrementally as part of other ongoing building maintenance, repair, or modernization projects. Consequently, implementing seismic structural mitigation strategies typically requires that they be developed as a part of longer-term capital improvements and modernization programs developed by the school district and their design consultants.

Next Steps

Due to the screening nature of the ASCE 41-17 Tier 1 procedures, an in-depth seismic evaluation and analysis of these buildings may be needed before detailed seismic upgrades or improvements, conceptual designs, and probable construction cost estimates are developed.

If you have any questions or comments regarding the engineering reports or would like to discuss this further, please contact us.

Sincerely,

David B. Swanson, P.E., S.E. Principal, LEED AP, F.SEI















Limitations

The professional services described in this document were performed based on available information and limited visual observation of the structures. No other warranty is made as to the professional advice included in this document. This document has been prepared for the exclusive use of the Department of Natural Resources, the Office of the Superintendent of Public Instruction, and this school district and is not intended for use by other parties, as it may not contain sufficient information for other parties' purposes or their uses.



1. White Salmon Valley, Columbia High School, C Court - Gym

1.1 Building Description

Building Name: C Court - Gym

Facility Name: Columbia High School

District Name: White Salmon Valley

ICOS Latitude: 45.742 ICOS Longitude: -121.494

ICOS

County/District ID: 20405

ICOS Building ID: 22348
ASCE 41 Bldg Type: PC1a
Enrollment: 387
Gross Sq. Ft.: 33,246
Year Built: 1970

Number of Stories: 1

S_{XS BSE-2E:} 0.466

S_{X1 BSE-2E}: 0.292

ASCE 41 Level of

Seismicity:


Site Class: C

V_{S30}(m/s): 380

Liquefaction Very Low

Tsunami Risk: None Structural Drawings Available: Yes

Evaluating Firm: WRK Engineers

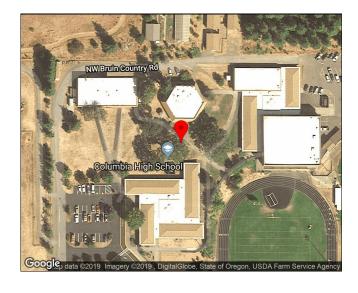



The Columbia High School gymnasium building is a one-story concrete tilt-up structure with four buildings under one roof system. There is a lower basement level beneath the gym building that is below grade on one side. The 1970 building is constructed on sloping ground and is located in White Salmon, Washington. The complete structure is rectangular in plan, 181 feet by 116 feet, with a maximum roof height of around 30 feet at the gym. Building construction consists of precast concrete tilt-up walls. The upper roof system at the gym building is composed of Tectum panels over glulam framing. The lower roof system is a flexible diaphragm composed of a mixture of T&G decking and plywood sheathing. The floor system over the gymnasium basement is composed of a concrete slab over concrete beams and joists. The building shares the site with three other buildings that compose Columbia High School.

1.1.1 Building Use

The gymnasium building includes the gymnasium, classrooms, and a cafeteria. There is a central courtyard in the middle of the structure. The school has over 380 student occupants.

1.1.2 Structural System

Table 1.1-1. Structural System Description of Columbia High School

Structural System	Description				
	The upper roof system is composed of Tectum roof panels over glulam framing.				
Structural Roof	The lower roof system is a mixture of T&G decking and plywood sheathing over				
	wood framing.				
Structural Elecu(a)	The ground floor is a concrete slab-on-grade. The floor system over the				
Structural Floor(s)	basement is a concrete slab over concrete beams and joists.				
Foundations	The walls are supported by continuous wall footings.				
Cuarrity Systam	The gravity system consists of glulam beam framing supported by concrete				
Gravity System	pilasters and the concrete tilt-up walls.				
Lataral Systam	Concrete tilt-up shear walls resist the forces in the longitudinal and transverse				
Lateral System	directions.				

1.1.3 Structural System Visual Condition

 Table 1.1-2. Structural System Condition Description of Columbia High School

Structural System	Description
Structural Roof	No visible signs of corrosion, damage, or deterioration.
Structural Floor(s)	No visible signs of corrosion, damage, or deterioration.
Foundations	Unknown.
Gravity System	No visible signs of corrosion, damage, or deterioration.
Lateral System	No visible signs of corrosion, damage, or deterioration.

1.2 Seismic Evaluation Findings

1.2.1 Structural Seismic Deficiencies

The structural seismic deficiencies identified during the Tier 1 evaluation are summarized below. Commentary for each deficiency is also provided based on this evaluation.

Table 1-3. Identified Structural Seismic Deficiencies for White Salmon Valley Columbia High School C Court - Gym

Deficiency	Description
Load Path	No out-of-plane resistance. No connection between tilt-up panels between floors. Roof diaphragms inadequate. Post-installed out-of-plane connections, the addition of a new diaphragm, and panel base connection
	strengthening may be appropriate.
	The basement level has more than a 30% net change in horizontal dimension of structural-force-resisting
Geometry	system from the main level. Further investigation is required to determine geometric irregularity effects on the lateral system. The addition of new shear walls may be appropriate to resist geometric irregularity effects.
Torsion	Building has eccentric stiffness. Further investigation is required to determine torsional effects on the lateral system. The addition of new shear walls may be appropriate to resist torsional irregularity effects and to mitigate seismic risk.
Wall Anchorage	Out-of-plane wall anchorage is not present. Tension ties, blocking, strapping, and diaphragm nailing are required along precast concrete wall.
Spans	Wood diaphragms do not consist of wood structural panels or diagonal sheathing at gymnasium roof diaphragm. Installation of wood structural panels may be appropriate to mitigate seismic risk.
Other Diaphragms	Diaphragm consists of Tectum roof deck at gymnasium. Installation of plywood sheathing may be appropriate to mitigate seismic risk.

1.2.2 Structural Checklist Items Marked as 'U'nknown

Where building structural component seismic adequacy was unknown due to lack of available information or limited observation, the structural checklist items were marked as "unknown". These items require further investigation if definitive determination of compliance or noncompliance is desired. The unknown structural checklist items identified during the Tier 1 evaluation are summarized below. Commentary for each unknown item is also provided based on the evaluation.

Table 1-4. Identified Structural Checklist Items Marked as Unknown for White Salmon Valley Columbia High School C Court - Gym

Unknown Item	Description
-	The liquefaction potential of site soils is unknown at this time given available information. Very low
Liquefaction	liquefaction potential is identified per ICOS based on state geologic mapping. Requires further investigation by
	a licensed geotechnical engineer to determine liquefaction potential.
Slope Failure	Requires further investigation by a licensed geotechnical engineer to determine susceptibility to slope failure.
Surface Fault	Requires further investigation by a licensed geotechnical engineer to determine whether site is near locations of
Rupture	expected surface fault ruptures.

1.3.1 Nonstructural Seismic Deficiencies

The nonstructural seismic deficiencies identified during the Tier 1 evaluation are summarized below. Commentary for each deficiency is also provided based on this evaluation. Some nonstructural deficiencies may be able to be mitigated by school district staff. Other nonstructural components that require more substantial mitigation may be more appropriately included in a long-term mitigation strategy. Some typical conceptual details for the seismic upgrade of nonstructural components can be found in the FEMA E-74 Excerpts appendix.

Table 1-5. Identified Nonstructural Seismic Deficiencies for White Salmon Valley Columbia High School C Court - Gym

Deficiency	Description					
CF-2 Tall Narrow Contents.	Anchorage is required for tall narrow contents more than six feet high to provide overturning					
HR-not required; LS-H; PR-MH.	restraint.					
CF-3 Fall-Prone Contents.	Anchorage is required for fall-prone contents weighting more than 20 pounds.					
HR-not required; LS-H; PR-H.	Panenorage is required for fair-profit contents weighting more than 20 pounds.					
ME-2 In-Line Equipment. HR-	Independent vertical support and lateral bracing is required for in-line equipment.					
not required; LS-H; PR-H.	independent vertical support and lateral bracing is required for in-line equipment.					

1.3.2 Nonstructural Checklist Items Marked as 'U'nknown

Where building nonstructural component seismic adequacy was unknown due to lack of available information or limited observation, the nonstructural checklist items were marked as "unknown". These items require further investigation if definitive determination of compliance or noncompliance is desired. The unknown nonstructural checklist items identified during the Tier 1 evaluation are summarized below. Commentary for each unknown item is also provided based on the evaluation.

Some nonstructural deficiencies may be able to be mitigated by school district staff. Other nonstructural components that require more substantial mitigation may be more appropriately included in a long-term mitigation strategy. Some typical conceptual details for the seismic upgrade of nonstructural components can be found in the FEMA E-74 Excerpts appendix.

Table 1-6. Identified Nonstructural Checklist Items Marked as Unknown for White Salmon Valley Columbia High School C Court - Gym

Unknown Item	Description
LSS-3 Emergency Power. HR- not required; LS-LMH; PR- LMH.	Further investigation is required to review the life-safety system anchorage and bracing. All life-safety equipment should be braced or anchored.
P-3 Drift. HR-not required; LS-MH; PR-MH.	Further investigation is required to verify detailing of rigid cementitious partitions for drift.
LF-1 Independent Support. HR-not required; LS-MH; PR-MH.	Further investigation is required to review the support system for light fixtures. All light fixtures in grid ceiling system should have seismic bracing.
CG-8 Overhead Glazing. HR-not required; LS-MH; PR-MH.	Further investigation is required to verify detailing of glazing panes.
PCOA-4 Appendages. HR-MH; LS-MH; PR-LMH.	Wood parapets. Further investigation is required to verify reinforcing/anchorage of appendages extending above the main structural building system.
S-2 Stair Details. HR-not required; LS-LMH; PR-LMH.	No details at stairs provided. Further investigation is required to verify stair connections.



Figure 1-1. Columbia High School Gym - South Exterior



Figure 1-2. Columbia High School Gym - West Exterior



Figure 1-3. Northwest Classroom with Glulam Beam Roof Framing and Fall-Prone Contents



Figure 1-4. Typical Classroom with Moveable Partition

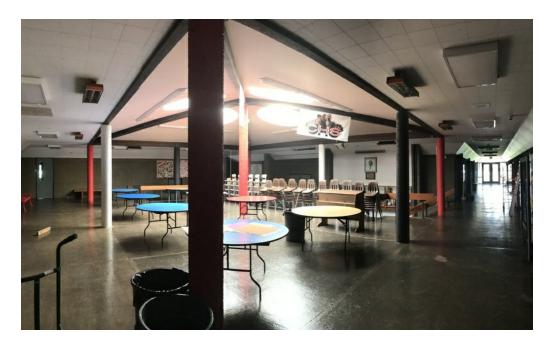


Figure 1-5. Central Commons



Figure 1-6. Gymnasium with Glulam Arches and Tectum Roof Panels

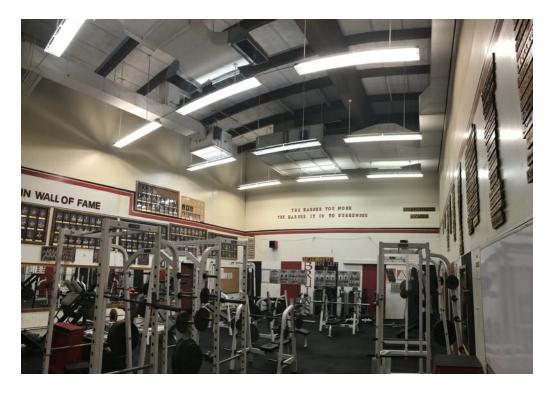


Figure 1-7. Weight Room at Lower Level with Suspended Mechanical Equipment



Figure 1-8. West Hallway

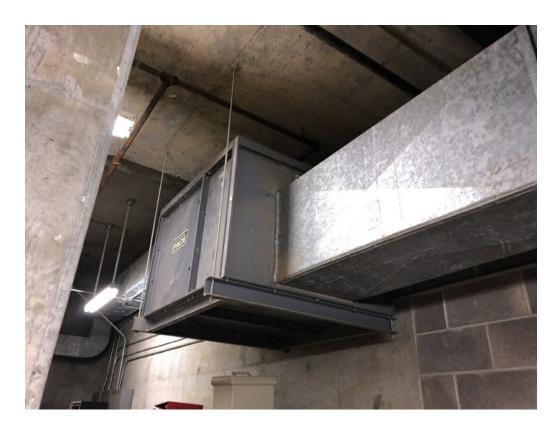


Figure 1-9. Suspended Mechanical Equipment at Lower Level



Figure 1-10. Unbraced Nonstructural Components, Typical Throughout

White Salmon Valley, Columbia High School, C Court - Gym

17-2 Collapse Prevention Basic Configuration Checklist

Building record drawings have been reviewed, when available, and a non-destructive field investigation has been performed for the subject building. Each of the required checklist items are marked Compliant (C), Noncompliant (NC), Not Applicable (N/A), or Unknown (U). Items marked Compliant indicate conditions that satisfy the performance objective, whereas items marked Noncompliant or Unknown indicate conditions that do not. Certain statements might not apply to the building being evaluated.

Low Seismicity

Building System - General

EVALUATION ITEM	EVALUATION STATEMENT	С	NC	N/A	U	COMMENT
Load Path	The structure contains a complete, well-defined load path, including structural elements and connections, that serves to transfer the inertial forces associated with the mass of all elements of the building to the foundation. (Tier 2: Sec. 5.4.1.1; Commentary: Sec. A.2.1.10)		Х			No out-of-plane resistance. No connection between tilt- up panels between floors. Roof diaphragms inadequate. Post-installed out-of-plane connections, the addition of a new diaphragm, and panel base connection strengthening may be appropriate.
Adjacent Buildings	The clear distance between the building being evaluated and any adjacent building is greater than 0.25% of the height of the shorter building in low seismicity, 0.5% in moderate seismicity, and 1.5% in high seismicity. (Tier 2: Sec. 5.4.1.2; Commentary: Sec. A.2.1.2)	X				
Mezzanines	Interior mezzanine levels are braced independently from the main structure or are anchored to the seismic-force-resisting elements of the main structure. (Tier 2: Sec. 5.4.1.3; Commentary: Sec. A.2.1.3)			X		

Building System - Building Configuration

EVALUATION ITEM	EVALUATION STATEMENT	С	NC	N/A	U	COMMENT
Weak Story	The sum of the shear strengths of the seismic- force-resisting system in any story in each direction is not less than 80% of the strength in the adjacent story above. (Tier 2: Sec. 5.4.2.1; Commentary: Sec. A.2.2.2)	X				
Soft Story	The stiffness of the seismic-force-resisting system in any story is not less than 70% of the seismic-force-resisting system stiffness in an adjacent story above or less than 80% of the average seismic-force-resisting system stiffness of the three stories above. (Tier 2: Sec. 5.4.2.2; Commentary: Sec. A.2.2.3)	X				

Vertical Irregularities	All vertical elements in the seismic-forceresisting system are continuous to the foundation. (Tier 2: Sec. 5.4.2.3; Commentary: Sec. A.2.2.4)	X		
Geometry	There are no changes in the net horizontal dimension of the seismic-force-resisting system of more than 30% in a story relative to adjacent stories, excluding one-story penthouses and mezzanines. (Tier 2: Sec. 5.4.2.4; Commentary: Sec. A.2.2.5)		Х	The basement level has more than a 30% net change in horizontal dimension of structural-force-resisting system from the main level. Further investigation is required to determine geometric irregularity effects on the lateral system. The addition of new shear walls may be appropriate to resist geometric irregularity effects.
Mass	There is no change in effective mass of more than 50% from one story to the next. Light roofs, penthouses, and mezzanines need not be considered. (Tier 2: Sec. 5.4.2.5; Commentary: Sec. A.2.2.6)	X		
Torsion	The estimated distance between the story center of mass and the story center of rigidity is less than 20% of the building width in either plan dimension. (Tier 2: Sec. 5.4.2.6; Commentary: Sec. A.2.2.7)		X	Building has eccentric stiffness. Further investigation is required to determine torsional effects on the lateral system. The addition of new shear walls may be appropriate to resist torsional irregularity effects and to mitigate seismic risk.

Moderate Seismicity (Complete the Following Items in Addition to the Items for Low Seismicity)

Geologic Site Hazards

EVALUATION ITEM	EVALUATION STATEMENT	С	NC	N/A	U	COMMENT
Liquefaction	Liquefaction-susceptible, saturated, loose granular soils that could jeopardize the building's seismic performance do not exist in the foundation soils at depths within 50 ft (15.2 m) under the building. (Tier 2: Sec. 5.4.3.1; Commentary: Sec. A.6.1.1)				х	The liquefaction potential of site soils is unknown at this time given available information. Very low liquefaction potential is identified per ICOS based on state geologic mapping. Requires further investigation by a licensed geotechnical engineer to determine liquefaction potential.

Slope Failure	The building site is located away from potential earthquake-induced slope failures or rockfalls so that it is unaffected by such failures or is capable of accommodating any predicted movements without failure. (Tier 2: Sec. 5.4.3.1; Commentary: Sec. A.6.1.2)		X	Requires further investigation by a licensed geotechnical engineer to determine susceptibility to slope failure.
Surface Fault Rupture	Surface fault rupture and surface displacement at the building site are not anticipated. (Tier 2: Sec. 5.4.3.1; Commentary: Sec. A.6.1.3)		X	Requires further investigation by a licensed geotechnical engineer to determine whether site is near locations of expected surface fault ruptures.

High Seismicity (Complete the Following Items in Addition to the Items for Low and Moderate Seismicity)

Foundation Configuration

EVALUATION ITEM	EVALUATION STATEMENT	С	NC	N/A	U	COMMENT
Overturning	The ratio of the least horizontal dimension of the seismic-force-resisting system at the foundation level to the building height (base/height) is greater than 0.6Sa. (Tier 2: Sec. 5.4.3.3; Commentary: Sec. A.6.2.1)	X				
Ties Between Foundation Elements	The foundation has ties adequate to resist seismic forces where footings, piles, and piers are not restrained by beams, slabs, or soils classified as Site Class A, B, or C. (Tier 2: Sec. 5.4.3.4; Commentary: Sec. A.6.2.2)			X		

17-28 Collapse Prevention Structural Checklist for Building Types PC1 and PC1a

Building record drawings have been reviewed, when available, and a non-destructive field investigation has been performed for the subject building. Each of the required checklist items are marked Compliant (C), Noncompliant (NC), Not Applicable (N/A), or Unknown (U). Items marked Compliant indicate conditions that satisfy the performance objective, whereas items marked Noncompliant or Unknown indicate conditions that do not. Certain statements might not apply to the building being evaluated.

Low Seismicity

Connections

EVALUATION ITEM	EVALUATION STATEMENT	С	NC	N/A	U	COMMENT
Wall Anchorage	Exterior concrete or masonry walls that are dependent on the diaphragm for lateral support are anchored for out-of-plane forces at each diaphragm level with steel anchors, reinforcing dowels, or straps that are developed into the diaphragm. Connections have strength to resist the connection force calculated in the Quick Check procedure of Section 4.4.3.7. (Tier 2: Sec. 5.7.1.1; Commentary: Sec. A.5.1.1)		X			Out-of-plane wall anchorage is not present. Tension ties, blocking, strapping, and diaphragm nailing are required along precast concrete wall.

Moderate Seismicity (Complete the Following Items in Addition to the Items for Low Seimicity)

Seismic-Force-Resisting System

EVALUATION ITEM	EVALUATION STATEMENT	С	NC	N/A	U	COMMENT
Redundancy	The number of lines of shear walls in each principal direction is greater than or equal to 2. (Tier 2: Sec. 5.5.1.1; Commentary: Sec. A.3.2.1.1)	X				
Wall Shear Stress Check	The shear stress in the precast panels, calculated using the Quick Check procedure of Section 4.4.3.3, is less than the greater of 100 lb/in.2 (0.69 MPa) or 2√f c. (Tier 2: Sec. 5.5.3.1.1; Commentary: Sec. A.3.2.3.1)	X				
Reinforcing Steel	The ratio of reinforcing steel area to gross concrete area is not less than 0.0012 in the vertical direction and 0.0020 in the horizontal direction. (Tier 2: Sec. 5.5.3.1.3; Commentary: Sec. A.3.2.3.2)	X				
Wall Thickness	Thicknesses of bearing walls are not less than 1/40 the unsupported height or length, whichever is shorter, nor less than 4 in. (101 mm). (Tier 2: Sec. 5.5.3.1.2; Commentary: Sec. A.3.2.3.5)	X				

Diaphragms

EXALTIA TION LITTERA		370 37	r/ A T 3	COLO CENTE
EVALUATION ITEM		I NC IN	I/AI U	COMMENT
L VILLOITION TILIN	EVILENTIONSTITIENENT	110 11	711	COMMINICATI

	Precast concrete diaphragm elements are				
	interconnected by a continuous reinforced				
Topping Slab	concrete topping slab with a minimum thickness		X		
	of 2 in. (51 mm). (Tier 2: Sec. 5.6.4;				
	Commentary: Sec. A.4.5.1)				

Connections

EVALUATION ITEM	EVALUATION STATEMENT	С	NC	N/A	U	COMMENT
Wood Ledgers	The connection between the wall panels and the diaphragm does not induce cross-grain bending or tension in the wood ledgers. (Tier 2: Sec. 5.7.1.3; Commentary: Sec. A.5.1.2)	X				
Transfer to Shear Walls	Diaphragms are connected for transfer of seismic forces to the shear walls. (Tier 2: Sec. 5.7.2; Commentary: Sec. A.5.2.1)	X				
Topping Slab to Walls or Frames	Reinforced concrete topping slabs that interconnect the precast concrete diaphragm elements are doweled for transfer of forces into the shear wall or frame elements. (Tier 2: Sec. 5.7.2; Commentary: Sec. A.5.2.3)			X		
Girder-Column Conncection	There is a positive connection using plates, connection hardware, or straps between the girder and the column support. (Tier 2: Sec. 5.7.4.1; Commentary: Sec. A.5.4.1)	X				

High Seismicity (Complete the Following Items in Addition to the Items for Low and Moderate Seismicity)

Seismic-Force-Resisting System

EVALUATION ITEM	EVALUATION STATEMENT	С	NC	N/A	U	COMMENT
Compatibility for Rigid	Secondary components have the shear capacity to develop the flexural strength of the components. (Tier 2: Sec. 5.5.2.5.2; Commentary: Sec. A.3.1.6.2)	X				
Wall Openings	The total width of openings along any perimeter wall line constitutes less than 75% of the length of any perimeter wall when the wall piers have aspect ratios of less than 2-to-1. (Tier 2: Sec. 5.5.3.3.1; Commentary: Sec. A.3.2.3.3)	X				

Diaphragms

EVALUATION ITEM	EVALUATION STATEMENT	С	NC	N/A	U	COMMENT
Cross Ties in Flexible Diaphragms	There are continuous cross ties between diaphragm chords. (Tier 2: Sec. 5.6.1.2; Commentary: Sec. A.4.1.2)	X				
Straight Sheathing	All straight-sheathed diaphragms have aspect ratios less than 2-to-1 in the direction being considered. (Tier 2: Sec. 5.6.2; Commentary: Sec. A.4.2.1)			X		

Spans	All wood diaphragms with spans greater than 24 ft (7.3 m) consist of wood structural panels or diagonal sheathing. (Tier 2: Sec. 5.6.2; Commentary: Sec. A.4.2.2)	X		Wood diaphragms do not consist of wood structural panels or diagonal sheathing at gymnasium roof diaphragm. Installation of wood structural panels may be appropriate to mitigate seismic risk.
Diagonally Sheathed and Unblocked Diaphragms	All diagonally sheathed or unblocked wood structural panel diaphragms have horizontal spans less than 40 ft (12.2 m) and aspect ratios less than or equal to 4 to-1. (Tier 2: Sec. 5.6.2; Commentary: Sec. A.4.2.3)		X	
Other Diaphragms	Diaphragms do not consist of a system other than wood, metal deck, concrete, or horizontal bracing. (Tier 2: Sec. 5.6.5; Commentary: Sec. A.4.7.1)	X		Diaphragm consists of Tectum roof deck at gymnasium. Installation of plywood sheathing may be appropriate to mitigate seismic risk.

Connections

EVALUATION ITEM	EVALUATION STATEMENT	С	NC	N/A	U	COMMENT
Minimum Number of Wall Anchors Per Panel	There are at least two anchors connecting each precast wall panel to the diaphragm elements. (Tier 2: Sec. 5.7.1.4; Commentary: Sec. A.5.1.3)	X				
Precast Wall Panels	Precast wall panels are connected to the foundation. (Tier 2: Sec. 5.7.3.4; Commentary: Sec. A.5.3.6)	X				
Uplift at Pile Caps	Pile caps have top reinforcement, and piles are anchored to the pile caps. (Tier 2: Sec. 5.7.3.5; Commentary: Sec. A.5.3.8)			X		
Girders	Girders supported by walls or pilasters have at least two ties securing the anchor bolts unless provided with independent stiff wall anchors with strength to resist the connection force calculated in the Quick Check procedure of Section 4.4.3.7. (Tier 2: Sec. 5.7.4.2; Commentary: Sec. A.5.4.2)	X				

White Salmon Valley, Columbia High School, C Court - $\operatorname{\mathsf{Gym}}$

17-38 Nonstructural Checklist

Notes:

C = Compliant, NC = Noncompliant, N/A = Not Applicable, and U = Unknown.

Performance Level: HR = Hazards Reduced, LS = Life Safety, and PR = Position Retention.

Level of Seismicity: L = Low, M = Moderate, and H = High

Life Safety Systems

EVALUATION ITEM	EVALUATION STATEMENT	С	NC	N/A	U	COMMENT
LSS-1 Fire Suppression Piping. HR-not required; LS-LMH; PR-LMH.	Fire suppression piping is anchored and braced in accordance with NFPA-13. (Tier 2: Sec. 13.7.4; Commentary: Sec. A.7.13.1)			X		No fire sprinklers
LSS-2 Flexible Couplings. HR-not required; LS-LMH; PR- LMH.	Fire suppression piping has flexible couplings in accordance with NFPA-13. (Tier 2: Sec. 13.7.4; Commentary: Sec. A.7.13.2)			X		
LSS-3 Emergency Power. HR-not required; LS-LMH; PR-LMH.	Equipment used to power or control Life Safety systems is anchored or braced. (Tier 2: Sec. 13.7.7; Commentary: Sec. A.7.12.1)				X	Further investigation is required to review the life-safety system anchorage and bracing. All life-safety equipment should be braced or anchored.
LSS-4 Stair and Smoke Ducts. HR-not required; LS-LMH; PR-LMH.	Stair pressurization and smoke control ducts are braced and have flexible connections at seismic joints. (Tier 2: Sec. 13.7.6; Commentary: Sec. A.7.14.1)			X		
LSS-5 Sprinkler Ceiling Clearance. HR-not required; LS-MH; PR- MH.	Penetrations through panelized ceilings for fire suppression devices provide clearances in accordance with NFPA-13. (Tier 2: Sec. 13.7.4; Commentary: Sec. A.7.13.3)			X		
LSS-6 Emergency Lighting. HR-not required; LS-not required; PR-LMH	Emergency and egress lighting equipment is anchored or braced. (Tier 2: Sec. 13.7.9; Commentary: Sec. A.7.3.1)			X		Non-applicable due to ASCE 41 Performance Level: "Life Safety (LS)"

Hazardous Materials

EVALUATION ITEM	EVALUATION STATEMENT	С	NC	N/A	U	COMMENT
HM-1 Hazardous Material Equipment. HR- LMH; LS-LMH; PR- LMH.	Equipment mounted on vibration isolators and containing hazardous material is equipped with restraints or snubbers. (Tier 2: Sec. 13.7.1; Commentary: Sec. A.7.12.2)			X		
HM-2 Hazardous Material Storage. HR- LMH; LS-LMH; PR- LMH.	Breakable containers that hold hazardous material, including gas cylinders, are restrained by latched doors, shelf lips, wires, or other methods. (Tier 2: Sec. 13.8.3; Commentary: Sec. A.7.15.1)			X		

HM-3 Hazardous Material Distribution. HR-MH; LS-MH; PR- MH.	Piping or ductwork conveying hazardous materials is braced or otherwise protected from damage that would allow hazardous material release. (Tier 2: Sec. 13.7.3, 13.7.5; Commentary: Sec. A.7.13.4)		X		
HM-4 Shutoff Valves. HR-MH; LS-MH; PR- MH.	Piping containing hazardous material, including natural gas, has shutoff valves or other devices to limit spills or leaks. (Tier 2: Sec. 13.7.3, 13.7.5; Commentary: Sec. A.7.13.3)		X		
HM-5 Flexible Couplings. HR-LMH; LS-LMH; PR-LMH.	Hazardous material ductwork and piping, including natural gas piping, have flexible couplings. (Tier 2: Sec. 13.7.3, 13.7.5; Commentary: Sec. A.7.15.4)		X		
HM-6 Piping or Ducts Crossing Seismic Joints. HR-MH; LS-MH; PR- MH.	Piping or ductwork carrying hazardous material that either crosses seismic joints or isolation planes or is connected to independent structures has couplings or other details to accommodate the relative seismic displacements. (Tier 2: Sec. 13.7.3, 13.7.5, 13.7.6; Commentary: Sec. A.7.13.6)		X		

Partitions

EVALUATIONITEM	EVALUATION CTATEMENT		NG	N T/A	T T	COMMENT
EVALUATION ITEM	EVALUATION STATEMENT	С	NC	N/A	U	COMMENT
P-1 Unreinforced Masonry. HR-LMH; LS- LMH; PR-LMH.	Unreinforced masonry or hollow-clay tile partitions are braced at a spacing of at most 10 ft (3.0 m) in Low or Moderate Seismicity, or at most 6 ft (1.8 m) in High Seismicity. (Tier 2: Sec. 13.6.2; Commentary: Sec. A.7.1.1)			X		
P-2 Heavy Partitions Supported by Ceilings. HR-LMH; LS-LMH; PR- LMH.	The tops of masonry or hollow-clay tile partitions are not laterally supported by an integrated ceiling system. (Tier 2: Sec. 13.6.2; Commentary: Sec. A.7.2.1)			X		
P-3 Drift. HR-not required; LS-MH; PR- MH.	Rigid cementitious partitions are detailed to accommodate the following drift ratios: in steel moment frame, concrete moment frame, and wood frame buildings, 0.02; in other buildings, 0.005. (Tier 2: Sec. 13.6.2; Commentary: Sec. A.7.1.2)				X	Further investigation is required to verify detailing of rigid cementitious partitions for drift.
P-4 Light Partitions Supported by Ceilings. HR-not required; LS-not required; PR-MH.	The tops of gypsum board partitions are not laterally supported by an integrated ceiling system. (Tier 2: Sec. 13.6.2; Commentary: Sec. A.7.2.1)			X		Non-applicable due to ASCE 41 Performance Level: "Life Safety (LS)"
P-5 Structural Separations. HR-not required; LS-not required; PR-MH.	Partitions that cross structural separations have seismic or control joints. (Tier 2: Sec. 13.6.2; Commentary: Sec. A.7.1.3)			X		Non-applicable due to ASCE 41 Performance Level: "Life Safety (LS)"
P-6 Tops. HR-not required; LS-not required; PR-MH.	The tops of ceiling-high framed or panelized partitions have lateral bracing to the structure at a spacing equal to or less than 6 ft (1.8 m). (Tier 2: Sec. 13.6.2; Commentary: Sec. A.7.1.4)			X		Non-applicable due to ASCE 41 Performance Level: "Life Safety (LS)"

Ceilings

EVALUATION ITEM	EVALUATION STATEMENT	С	NC	N/A	U	COMMENT
C-1 Suspended Lath and Plaster. HR-H; LS-MH; PR-LMH.	Suspended lath and plaster ceilings have attachments that resist seismic forces for every 12 ft2 (1.1 m2) of area. (Tier 2: Sec. 13.6.4; Commentary: Sec. A.7.2.3)			X		
C-2 Suspended Gypsum Board. HR-not required; LS-MH; PR-LMH.	Suspended gypsum board ceilings have attachments that resist seismic forces for every 12 ft2 (1.1 m2) of area. (Tier 2: Sec. 13.6.4; Commentary: Sec. A.7.2.3)			X		
C-3 Integrated Ceilings. HR-not required; LS-not required; PR-MH.	Integrated suspended ceilings with continuous areas greater than 144 ft2 (13.4 m2) and ceilings of smaller areas that are not surrounded by restraining partitions are laterally restrained at a spacing no greater than 12 ft (3.6 m) with members attached to the structure above. Each restraint location has a minimum of four diagonal wires and compression struts, or diagonal members capable of resisting compression. (Tier 2: Sec. 13.6.4; Commentary: Sec. A.7.2.2)			X		Non-applicable due to ASCE 41 Performance Level: "Life Safety (LS)"
C-4 Edge Clearance. HR- not required; LS-not required; PR-MH.	The free edges of integrated suspended ceilings with continuous areas greater than 144 ft2 (13.4 m2) have clearances from the enclosing wall or partition of at least the following: in Moderate Seismicity, 1/2 in. (13 mm); in High Seismicity, 3/4 in. (19 mm). (Tier 2: Sec. 13.6.4; Commentary: Sec. A.7.2.4)			X		Non-applicable due to ASCE 41 Performance Level: "Life Safety (LS)"
C-5 Continuity Across Structure Joints. HR-not required; LS-not required; PR-MH.	The ceiling system does not cross any seismic joint and is not attached to multiple independent structures. (Tier 2: Sec. 13.6.4; Commentary: Sec. A.7.2.5)			X		Non-applicable due to ASCE 41 Performance Level: "Life Safety (LS)"
C-6 Edge Support. HR- not required; LS-not required; PR-H.	The free edges of integrated suspended ceilings with continuous areas greater than 144 ft2 (13.4 m2) are supported by closure angles or channels not less than 2 in. (51 mm) wide. (Tier 2: Sec. 13.6.4; Commentary: Sec. A.7.2.6)			X		Non-applicable due to ASCE 41 Performance Level: "Life Safety (LS)"
C-7 Seismic Joints. HR- not required; LS-not required; PR-H.	Acoustical tile or lay-in panel ceilings have seismic separation joints such that each continuous portion of the ceiling is no more than 2,500 ft2 (232.3 m2) and has a ratio of long-to-short dimension no more than 4-to-1. (Tier 2: Sec. 13.6.4; Commentary: Sec. A.7.2.7)			X		Non-applicable due to ASCE 41 Performance Level: "Life Safety (LS)"

Light Fixtures

EVALUATION ITEM	EVALUATION STATEMENT	С	NC	N/A	U	COMMENT
LF-1 Independent Support. HR-not required; LS-MH; PR- MH.	Light fixtures that weigh more per square foot than the ceiling they penetrate are supported independent of the grid ceiling suspension system by a minimum of two wires at diagonally opposite corners of each fixture. (Tier 2: Sec. 13.6.4, 13.7.9; Commentary: Sec. A.7.3.2)				X	Further investigation is required to review the support system for light fixtures. All light fixtures in grid ceiling system should have seismic bracing.
LF-2 Pendant Supports. HR-not required; LS-not required; PR-H.	Light fixtures on pendant supports are attached at a spacing equal to or less than 6 ft. Unbraced suspended fixtures are free to allow a 360-degree range of motion at an angle not less than 45 degrees from horizontal without contacting adjacent components. Alternatively, if rigidly supported and/or braced, they are free to move with the structure to which they are attached without damaging adjoining components. Additionally, the connection to the structure is capable of accommodating the movement without failure. (Tier 2: Sec. 13.7.9; Commentary: Sec. A.7.3.3)			X		Non-applicable due to ASCE 41 Performance Level: "Life Safety (LS)"
LF-3 Lens Covers. HR- not required; LS-not required; PR-H.	Lens covers on light fixtures are attached with safety devices. (Tier 2: Sec. 13.7.9; Commentary: Sec. A.7.3.4)			X		Non-applicable due to ASCE 41 Performance Level: "Life Safety (LS)"

Cladding and Glazing

EVALUATION ITEM	EVALUATION STATEMENT	С	NC	N/A	U	COMMENT
CG-1 Cladding Anchors. HR-MH; LS-MH; PR- MH.	Cladding components weighing more than 10 lb/ft2 (0.48 kN/m2) are mechanically anchored to the structure at a spacing equal to or less than the following: for Life Safety in Moderate Seismicity, 6 ft (1.8 m); for Life Safety in High Seismicity and for Position Retention in any seismicity, 4 ft (1.2 m) (Tier 2: Sec. 13.6.1; Commentary: Sec. A.7.4.1)			X		
CG-2 Cladding Isolation. HR-not required; LS- MH; PR-MH.	For steel or concrete moment-frame buildings, panel connections are detailed to accommodate a story drift ratio by the use of rods attached to framing with oversize holes or slotted holes of at least the following: for Life Safety in Moderate Seismicity, 0.01; for Life Safety in High Seismicity and for Position Retention in any seismicity, 0.02, and the rods have a length-to-diameter ratio of 4.0 or less. (Tier 2: Sec. 13.6.1; Commentary: Sec. A.7.4.3)			X		

CG-3 Multi-Story Panels. HR-MH; LS-MH; PR- MH.	For multi-story panels attached at more than one floor level, panel connections are detailed to accommodate a story drift ratio by the use of rods attached to framing with oversize holes or slotted holes of at least the following: for Life Safety in Moderate Seismicity, 0.01; for Life Safety in High Seismicity and for Position Retention in any seismicity, 0.02, and the rods have a length-to-diameter ratio of 4.0 or less. (Tier 2: Sec. 13.6.1; Commentary: Sec. A.7.4.4)		X		
CG-4 Threaded Rods. HR-not required; LS- MH; PR-MH.	Threaded rods for panel connections detailed to accommodate drift by bending of the rod have a length-to-diameter ratio greater than 0.06 times the story height in inches for Life Safety in Moderate Seismicity and 0.12 times the story height in inches for Life Safety in High Seismicity and Position Retention in any seismicity. (Tier 2: Sec. 13.6.1; Commentary: Sec. A.7.4.9)		X		
CG-5 Panel Connections. HR-MH; LS-MH; PR- MH.	Cladding panels are anchored out of plane with a minimum number of connections for each wall panel, as follows: for Life Safety in Moderate Seismicity, 2 connections; for Life Safety in High Seismicity and for Position Retention in any seismicity, 4 connections. (Tier 2: Sec. 13.6.1.4; Commentary: Sec. A.7.4.5)		X		
CG-6 Bearing Connections. HR-MH; LS-MH; PR-MH.	Where bearing connections are used, there is a minimum of two bearing connections for each cladding panel. (Tier 2: Sec. 13.6.1.4; Commentary: Sec. A.7.4.6)		X		
CG-7 Inserts. HR-MH; LS-MH; PR-MH.	Where concrete cladding components use inserts, the inserts have positive anchorage or are anchored to reinforcing steel. (Tier 2: Sec. 13.6.1.4; Commentary: Sec. A.7.4.7)		X		
CG-8 Overhead Glazing. HR-not required; LS- MH; PR-MH.	Glazing panes of any size in curtain walls and individual interior or exterior panes more than 16 ft2 (1.5 m2) in area are laminated annealed or laminated heat-strengthened glass and are detailed to remain in the frame when cracked. (Tier 2: Sec. 13.6.1.5; Commentary: Sec. A.7.4.8)			X	Further investigation is required to verify detailing of glazing panes.

Masonry Veneer

EVALUATION ITEM	EVALUATION STATEMENT	С	NC	N/A	U	COMMENT
M-1 Ties. HR-not required; LS-LMH; PR- LMH.	Masonry veneer is connected to the backup with corrosion-resistant ties. There is a minimum of one tie for every 2-2/3 ft2 (0.25 m2), and the ties have spacing no greater than the following: for Life Safety in Low or Moderate Seismicity, 36 in. (914 mm); for Life Safety in High Seismicity and for Position Retention in any seismicity, 24 in. (610 mm). (Tier 2: Sec. 13.6.1.2; Commentary: Sec. A.7.5.1)			X		No masonry veneer
M-2 Shelf Angles. HR- not required; LS-LMH; PR-LMH.	Masonry veneer is supported by shelf angles or other elements at each floor above the ground floor. (Tier 2: Sec. 13.6.1.2; Commentary: Sec. A.7.5.2)			X		No masonry veneer
M-3 Weakened Planes. HR-not required; LS- LMH; PR-LMH.	Masonry veneer is anchored to the backup adjacent to weakened planes, such as at the locations of flashing. (Tier 2: Sec. 13.6.1.2; Commentary: Sec. A.7.5.3)			X		No masonry veneer
M-4 Unreinforced Masonry Backup. HR- LMH; LS-LMH; PR- LMH.	There is no unreinforced masonry backup. (Tier 2: Sec. 13.6.1.1, 13.6.1.2; Commentary: Sec. A.7.7.2)			X		No masonry veneer
M-5 Stud Tracks. HR-not required; LS-MH; PR- MH.	For veneer with coldformed steel stud backup, stud tracks are fastened to the structure at a spacing equal to or less than 24 in. (610 mm) on center. (Tier 2: Sec. 13.6.1.1, 13.6.1.2; Commentary: Sec. A.7.6.)			X		No masonry veneer
M-6 Anchorage. HR-not required; LS-MH; PR- MH.	For veneer with concrete block or masonry backup, the backup is positively anchored to the structure at a horizontal spacing equal to or less than 4 ft along the floors and roof. (Tier 2: Sec. 13.6.1.1, 13.6.1.2; Commentary: Sec. A.7.7.1)			X		No masonry veneer
M-7 Weep Holes. HR-not required; LS-not required; PR-MH.	In veneer anchored to stud walls, the veneer has functioning weep holes and base flashing. (Tier 2: Sec. 13.6.1.2; Commentary: Sec. A.7.5.6)			X		No masonry veneer
M-8 Openings. HR-not required; LS-not required; PR-MH.	For veneer with cold-formed-steel stud backup, steel studs frame window and door openings. (Tier 2: Sec. 13.6.1.1, 13.6.1.2; Commentary: Sec. A.7.6.2)			X		No masonry veneer

Parapets, Cornices, Ornamentation, and Appendages

EVALUATION ITEM	EVALUATION STATEMENT	С	NC	N/A	U	COMMENT
PCOA-1 URM Parapets or Cornices. HR-LMH; LS-LMH; PR-LMH.	Laterally unsupported unreinforced masonry parapets or cornices have height-tothickness ratios no greater than the following: for Life Safety in Low or Moderate Seismicity, 2.5; for Life Safety in High Seismicity and for Position Retention in any seismicity, 1.5. (Tier 2: Sec. 13.6.5; Commentary: Sec. A.7.8.1)			X		

PCOA-2 Canopies. HR-not required; LS-LMH; PR-LMH.	Canopies at building exits are anchored to the structure at a spacing no greater than the following: for Life Safety in Low or Moderate Seismicity, 10 ft (3.0 m); for Life Safety in High Seismicity and for Position Retention in any seismicity, 6 ft (1.8 m). (Tier 2: Sec. 13.6.6; Commentary: Sec. A.7.8.2)		X		
PCOA-3 Concrete Parapets. HR-H; LS-MH; PR-LMH.	Concrete parapets with height-to-thickness ratios greater than 2.5 have vertical reinforcement. (Tier 2: Sec. 13.6.5; Commentary: Sec. A.7.8.3)		X		
PCOA-4 Appendages. HR-MH; LS-MH; PR- LMH.	Cornices, parapets, signs, and other ornamentation or appendages that extend above the highest point of anchorage to the structure or cantilever from components are reinforced and anchored to the structural system at a spacing equal to or less than 6 ft (1.8 m). This evaluation statement item does not apply to parapets or cornices covered by other evaluation statements. (Tier 2: Sec. 13.6.6; Commentary: Sec. A.7.8.4)			X	Wood parapets. Further investigation is required to verify reinforcing/anchorage of appendages extending above the main structural building system.

Masonry Chimneys

EVALUATION ITEM	EVALUATION STATEMENT	С	NC	N/A	U	COMMENT
MC-1 URM Chimneys. HR-LMH; LS-LMH; PR- LMH.	Unreinforced masonry chimneys extend above the roof surface no more than the following: for Life Safety in Low or Moderate Seismicity, 3 times the least dimension of the chimney; for Life Safety in High Seismicity and for Position Retention in any seismicity, 2 times the least dimension of the chimney. (Tier 2: Sec. 13.6.7; Commentary: Sec. A.7.9.1)			X		
MC-2 Anchorage. HR- LMH; LS-LMH; PR- LMH.	Masonry chimneys are anchored at each floor level, at the topmost ceiling level, and at the roof. (Tier 2: Sec. 13.6.7; Commentary: Sec. A.7.9.2)			X		

Stairs

EVALUATION ITEM	EVALUATION STATEMENT	С	NC	N/A	U	COMMENT
S-1 Stair Enclosures. HR-not required; LS-LMH; PR-LMH.	EVALUATION STATEMENT Hollow-clay tile or unreinforced masonry walls around stair enclosures are restrained out of plane and have height-to-thickness ratios not greater than the following: for Life Safety in Low or Moderate Seismicity, 15-to-1; for Life Safety in High Seismicity and for Position Retention in any seismicity, 12-to-1. (Tier 2: Sec. 13.6.2, 13.6.8; Commentary: Sec.	С	NC	N/A X	U	COMMENT
	A.7.10.1)					

	The connection between the stairs and the				
	structure does not rely on post-installed anchors				
	in concrete or masonry, and the stair details are				
S-2 Stair Details. HR-not	capable of accommodating the drift calculated				No details at stairs
required; LS-LMH; PR-	using the Quick Check procedure of Section			X	provided. Further
LMH.	4.4.3.1 for moment-frame structures or 0.5 in.			Λ	investigation is required to
LIVITI.	for all other structures without including any				verify stair connections.
	lateral stiffness contribution from the stairs.				
	(Tier 2: Sec. 13.6.8; Commentary: Sec.				
	A.7.10.2)				

Contents and Furnishings

EVALUATION ITEM	EVALUATION STATEMENT	С	NC	N/A	U	COMMENT
CF-1 Industrial Storage Racks. HR-LMH; LS- MH; PR-MH.	Industrial storage racks or pallet racks more than 12 ft high meet the requirements of ANSI/RMI MH 16.1 as modified by ASCE 7, Chapter 15. (Tier 2: Sec. 13.8.1; Commentary: Sec. A.7.11.1)			X		
CF-2 Tall Narrow Contents. HR-not required; LS-H; PR-MH.	Contents more than 6 ft (1.8 m) high with a height-to-depth or height-to-width ratio greater than 3-to-1 are anchored to the structure or to each other. (Tier 2: Sec. 13.8.2; Commentary: Sec. A.7.11.2)		X			Anchorage is required for tall narrow contents more than six feet high to provide overturning restraint.
CF-3 Fall-Prone Contents. HR-not required; LS-H; PR-H.	Equipment, stored items, or other contents weighing more than 20 lb (9.1 kg) whose center of mass is more than 4 ft (1.2 m) above the adjacent floor level are braced or otherwise restrained. (Tier 2: Sec. 13.8.2; Commentary: Sec. A.7.11.3)		X			Anchorage is required for fall-prone contents weighting more than 20 pounds.
CF-4 Access Floors. HR- not required; LS-not required; PR-MH.	Access floors more than 9 in. (229 mm) high are braced. (Tier 2: Sec. 13.6.10; Commentary: Sec. A.7.11.4)			X		Non-applicable due to ASCE 41 Performance Level: "Life Safety (LS)"
CF-5 Equipment on Access Floors. HR-not required; LS-not required; PR-MH.	Equipment and other contents supported by access floor systems are anchored or braced to the structure independent of the access floor. (Tier 2: Sec. 13.7.7 13.6.10; Commentary: Sec. A.7.11.5)			X		Non-applicable due to ASCE 41 Performance Level: "Life Safety (LS)"
CF-6 Suspended Contents. HR-not required; LS-not required; PR-H.	Items suspended without lateral bracing are free to swing from or move with the structure from which they are suspended without damaging themselves or adjoining components. (Tier 2: Sec. 13.8.2; Commentary: Sec. A.7.11.6)			X		Non-applicable due to ASCE 41 Performance Level: "Life Safety (LS)"

Mechanical and Electrical Equipment

EVALUATION ITEM	EVALUATION STATEMENT	С	NC	N/A	U	COMMENT
Equipment. HR-not	Equipment weighing more than 20 lb (9.1 kg) whose center of mass is more than 4 ft (1.2 m) above the adjacent floor level, and which is not in-line equipment, is braced. (Tier 2: Sec. 13.7.1 13.7.7; Commentary: Sec. A.7.12.4)			X		No fall-prone equipment observed.

ME-2 In-Line Equipment. HR-not required; LS-H; PR-H.	Equipment installed in line with a duct or piping system, with an operating weight more than 75 lb (34.0 kg), is supported and laterally braced independent of the duct or piping system. (Tier 2: Sec. 13.7.1; Commentary: Sec. A.7.12.5)	X		Independent vertical support and lateral bracing is required for in-line equipment.
ME-3 Tall Narrow Equipment. HR-not required; LS-H; PR-MH.	Equipment more than 6 ft (1.8 m) high with a height-to-depth or height-to-width ratio greater than 3-to-1 is anchored to the floor slab or adjacent structural walls. (Tier 2: Sec. 13.7.1 13.7.7; Commentary: Sec. A.7.12.6)		X	No tall narrow equipment observed.
ME-4 Mechanical Doors. HR-not required; LS-not required; PR-MH.	Mechanically operated doors are detailed to operate at a story drift ratio of 0.01. (Tier 2: Sec. 13.6.9; Commentary: Sec. A.7.12.7)		X	Non-applicable due to ASCE 41 Performance Level: "Life Safety (LS)"
ME-5 Suspended Equipment. HR-not required; LS-not required; PR-H.	Equipment suspended without lateral bracing is free to swing from or move with the structure from which it is suspended without damaging itself or adjoining components. (Tier 2: Sec. 13.7.1, 13.7.7; Commentary: Sec. A.7.12.8)		X	Non-applicable due to ASCE 41 Performance Level: "Life Safety (LS)"
ME-6 Vibration Isolators. HR-not required; LS-not required; PR-H.	1 11		X	Non-applicable due to ASCE 41 Performance Level: "Life Safety (LS)"
ME-7 Heavy Equipment. HR-not required; LS-not required; PR-H.	Floor supported or platform-supported equipment weighing more than 400 lb (181.4 kg) is anchored to the structure. (Tier 2: Sec. 13.7.1, 13.7.7; Commentary: Sec. A.7.12.10)		X	Non-applicable due to ASCE 41 Performance Level: "Life Safety (LS)"
ME-8 Electrical Equipment. HR-not required; LS-not required; PR-H.	Electrical equipment is laterally braced to the structure. (Tier 2: Sec. 13.7.7; Commentary: Sec. A.7.12.11)		X	Non-applicable due to ASCE 41 Performance Level: "Life Safety (LS)"
ME-9 Conduit Couplings. HR-not required; LS-not required; PR-H.	Conduit greater than 2.5 in. (64 mm) trade size that is attached to panels, cabinets, or other equipment and is subject to relative seismic displacement has flexible couplings or connections. (Tier 2: Sec. 13.7.8; Commentary: Sec. A.7.12.12)		X	Non-applicable due to ASCE 41 Performance Level: "Life Safety (LS)"

Piping

EVALUATION ITEM	EVALUATION STATEMENT	С	NC	N/A	U	COMMENT
	Fluid and gas piping has flexible couplings. (Tier 2: Sec. 13.7.3, 13.7.5; Commentary: Sec. A.7.13.2)			X		Non-applicable due to ASCE 41 Performance Level: "Life Safety (LS)"
PP-2 Fluid and Gas Piping. HR-not required; LS-not required; PR-H.	Fluid and gas piping is anchored and braced to the structure to limit spills or leaks. (Tier 2: Sec. 13.7.3, 13.7.5; Commentary: Sec. A.7.13.4)			X		Non-applicable due to ASCE 41 Performance Level: "Life Safety (LS)"

PP-3 C-Clamps. HR-not required; LS-not required; PR-H.	One-sided C-clamps that support piping larger than 2.5 in. (64 mm) in diameter are restrained. (Tier 2: Sec. 13.7.3, 13.7.5; Commentary: Sec. A.7.13.5)		X	Non-applicable due to ASCE 41 Performance Level: "Life Safety (LS)"
PP-4 Piping Crossing Seismic Joints. HR-not required; LS-not required; PR-H.	Piping that crosses seismic joints or isolation planes or is connected to independent structures has couplings or other details to accommodate the relative seismic displacements. (Tier 2: Sec. 13.7.3, 13.7.5; Commentary: Sec. A.7.13.6)		X	Non-applicable due to ASCE 41 Performance Level: "Life Safety (LS)"

Ducts

EVALUATION ITEM	EVALUATION STATEMENT	С	NC	N/A	U	COMMENT
D-1 Duct Bracing. HR- not required; LS-not required; PR-H.	Rectangular ductwork larger than 6 ft2 (0.56 m2) in cross-sectional area and round ducts larger than 28 in. (711 mm) in diameter are braced. The maximum spacing of transverse bracing does not exceed 30 ft (9.2 m). The maximum spacing of longitudinal bracing does not exceed 60 ft (18.3 m). (Tier 2: Sec. 13.7.6; Commentary: Sec. A.7.14.2)			X		Non-applicable due to ASCE 41 Performance Level: "Life Safety (LS)"
D-2 Duct Support. HR- not required; LS-not required; PR-H.	Ducts are not supported by piping or electrical conduit. (Tier 2: Sec. 13.7.6; Commentary: Sec. A.7.14.3)			X		Non-applicable due to ASCE 41 Performance Level: "Life Safety (LS)"
D-3 Ducts Crossing Seismic Joints. HR-not required; LS-not required; PR-H.	Ducts that cross seismic joints or isolation planes or are connected to independent structures have couplings or other details to accommodate the relative seismic displacements. (Tier 2: Sec. 13.7.6; Commentary: Sec. A.7.14.4)			Х		Non-applicable due to ASCE 41 Performance Level: "Life Safety (LS)"

Elevators

EVALUATION ITEM	EVALUATION STATEMENT	С	NC	N/A	U	COMMENT
EL-1 Retainer Guards. HR-not required; LS-H; PR-H.	Sheaves and drums have cable retainer guards. (Tier 2: Sec. 13.7.11; Commentary: Sec. A.7.16.1)			X		No elevator
EL-2 Retainer Plate. HR- not required; LS-H; PR- H.	A retainer plate is present at the top and bottom of both car and counterweight. (Tier 2: Sec. 13.7.11; Commentary: Sec. A.7.16.2)			X		No elevator
EL-3 Elevator Equipment. HR-not required; LS-not required; PR-H.	Equipment, piping, and other components that are part of the elevator system are anchored. (Tier 2: Sec. 13.7.11; Commentary: Sec. A.7.16.3)			X		No elevator
EL-4 Seismic Switch. HR-not required; LS-not required; PR-H.	Elevators capable of operating at speeds of 150 ft/min or faster are equipped with seismic switches that meet the requirements of ASME A17.1 or have trigger levels set to 20% of the acceleration of gravity at the base of the structure and 50% of the acceleration of gravity in other locations. (Tier 2: Sec. 13.7.11; Commentary: Sec. A.7.16.4)			Х		No elevator

EL-5 Shaft Walls. HR- not required; LS-not required; PR-H.	Elevator shaft walls are anchored and reinforced to prevent toppling into the shaft during strong shaking. (Tier 2: Sec. 13.7.11; Commentary: Sec. A.7.16.5)		X	No elevator
EL-6 Counterweight Rails. HR-not required; LS-not required; PR-H.	All counterweight rails and divider beams are sized in accordance with ASME A17.1. (Tier 2: Sec. 13.7.11; Commentary: Sec. A.7.16.6)		X	No elevator
EL-7 Brackets. HR-not required; LS-not required; PR-H.	The brackets that tie the car rails and the counterweight rail to the structure are sized in accordance with ASME A17.1. (Tier 2: Sec. 13.7.11; Commentary: Sec. A.7.16.7)		X	No elevator
EL-8 Spreader Bracket. HR-not required; LS-not required; PR-H.	Spreader brackets are not used to resist seismic forces. (Tier 2: Sec. 13.7.11; Commentary: Sec. A.7.16.8)		X	No elevator
	The building has a go-slow elevator system. (Tier 2: Sec. 13.7.11; Commentary: Sec. A.7.16.9)		X	No elevator

1. White Salmon Valley, Columbia High School, Libray

1.1 Building Description

Building Name: Libray

Facility Name: Columbia High School

District Name: White Salmon Valley

ICOS Latitude: 45.742 ICOS Longitude: -121.494

ICOS

County/District ID: 20405

ICOS Building ID: 22351
ASCE 41 Bldg Type: PC1
Enrollment: 387
Gross Sq. Ft.: 5,225
Year Built: 1970

Number of Stories: 1

S_{XS BSE-2E}: 0.466

S_{X1 BSE-2E:} 0.292

ASCE 41 Level of

Seismicity: High

Site Class: C

V_{S30}(m/s): 380


Liquefaction
Potential:

Very Low

Tsunami Risk: None

Structural Drawings Available: Yes

Evaluating Firm: WRK Engineers

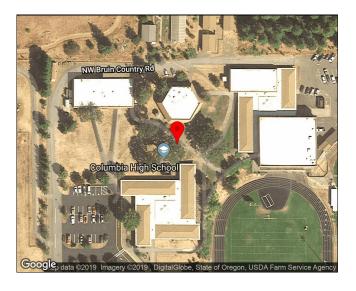



The Columbia High School library building is a one-story concrete tilt-up structure. The 1970 building is constructed on level ground and is located in White Salmon, Washington. The building is hexagonal in plan, 80 feet across, with a maximum roof height of around 22 feet. Building construction consists of precast concrete tilt-up walls. The roof system is a flexible diaphragm composed of glulam beam framing and 2x decking. The building shares the site with three other buildings that compose Columbia High School.

1.1.1 Building Use

The library building includes the library and administrative offices. The school has over 380 student occupants.

1.1.2 Structural System

Table 1.1-1. Structural System Description of Columbia High School

Structural System	Description
Structural Roof	The roof system is composed of glulam beam framing and 2x decking
Structural Floor(s)	The floor system is a concrete slab-on-grade.
Foundations	The walls are supported by continuous wall footings.
Gravity System	The gravity system consists of glulam beam framing supported by concrete pilasters and the concrete tilt-up walls.
Lateral System	The lateral system is composed of 6-inch concrete tilt-up walls.

1.1.3 Structural System Visual Condition

Table 1.1-2. Structural System Condition Description of Columbia High School

Table 111 21 Guadana Gyetem Genaniem Beeenparen et Genaniem Ingli Geneel					
Structural System	Description				
Structural Roof	No visible signs of corrosion, damage, or deterioration.				
Structural Floor(s)	No visible signs of corrosion, damage, or deterioration.				
Foundations	Unknown.				
Gravity System	No visible signs of corrosion, damage, or deterioration.				
Lateral System	No visible signs of corrosion, damage, or deterioration.				

1.2 Seismic Evaluation Findings

1.2.1 Structural Seismic Deficiencies

The structural seismic deficiencies identified during the Tier 1 evaluation are summarized below. Commentary for each deficiency is also provided based on this evaluation.

Table 1-3. Identified Structural Seismic Deficiencies for White Salmon Valley Columbia High School Libray

Deficiency	Description
Load Path	The building lacks a complete load path between the roof diaphragm and the shear walls and between the shear walls and the foundation. The addition of post-installed anchors and connections between the diaphragm and
	the shear walls, and between the shear walls and the foundation may be appropriate.
Wall Anchorage	No out-of-plane wall anchorage. Tension ties, blocking, strapping, and diaphragm nailing are required along precast concrete walls.
Wall Thickness	Six-inch wall is less than 1/40 requirement. The building likely requires wall strengthening. The addition of a steel strongback system may be appropriate. Further investigation is required.
Transfer to Shear	No structural connection between the roof diaphragm and the shear walls to transfer seismic forces. Post-
Walls	installed anchors may be appropriate to connect the roof diaphragm to the shear walls.
Precast Wall	Precast wall panels are not directly connected to the foundation. The addition of post-installed connections,
Panels	such as FRP, may be appropriate. Further investigation is required.

1.2.2 Structural Checklist Items Marked as 'U'nknown

Where building structural component seismic adequacy was unknown due to lack of available information or limited observation, the structural checklist items were marked as "unknown". These items require further investigation if definitive determination of compliance or noncompliance is desired. The unknown structural checklist items identified during the Tier 1 evaluation are summarized below. Commentary for each unknown item is also provided based on the evaluation.

Table 1-4. Identified Structural Checklist Items Marked as Unknown for White Salmon Valley Columbia High School Libray

Unknown Item	Description
	The liquefaction potential of site soils is unknown at this time given available information. Very low
Liquefaction	liquefaction potential is identified per ICOS based on state geologic mapping. Requires further investigation by
	a licensed geotechnical engineer to determine liquefaction potential.
Slope Failure	Requires further investigation by a licensed geotechnical engineer to determine susceptibility to slope failure.
Surface Fault	Requires further investigation by a licensed geotechnical engineer to determine whether site is near locations of
Rupture	expected surface fault ruptures.
Minimum	This evaluation item is unknown due to the quality and completeness of the building drawings provided and
Number of Wall	could not be visually verified. This item requires further field investigation to make a final determination on its
Anchors Per Panel	compliance and to develop a mitigation recommendation, if necessary.
	This evaluation item is unknown due to the quality and completeness of the building drawings provided and
Girders	could not be visually verified. This item requires further field investigation to make a final determination on its
	compliance and to develop a mitigation recommendation, if necessary.

1.3.1 Nonstructural Seismic Deficiencies

The nonstructural seismic deficiencies identified during the Tier 1 evaluation are summarized below. Commentary for each deficiency is also provided based on this evaluation. Some nonstructural deficiencies may be able to be mitigated by school district staff. Other nonstructural components that require more substantial mitigation may be more appropriately included in a long-term mitigation strategy. Some typical conceptual details for the seismic upgrade of nonstructural components can be found in the FEMA E-74 Excerpts appendix.

Table 1-5. Identified Nonstructural Seismic Deficiencies for White Salmon Valley Columbia High School Libray

Deficiency	Description
HR-not required; LS-H; PR-	Anchorage is required at tall narrow contents more than six feet high to provide overturning restraint.

1.3.2 Nonstructural Checklist Items Marked as 'U'nknown

Where building nonstructural component seismic adequacy was unknown due to lack of available information or limited observation, the nonstructural checklist items were marked as "unknown". These items require further investigation if definitive determination of compliance or noncompliance is desired. The unknown nonstructural checklist items identified during the Tier 1 evaluation are summarized below. Commentary for each unknown item is also provided based on the evaluation.

Some nonstructural deficiencies may be able to be mitigated by school district staff. Other nonstructural components that require more substantial mitigation may be more appropriately included in a long-term mitigation strategy. Some typical conceptual details for the seismic upgrade of nonstructural components can be found in the FEMA E-74 Excerpts appendix.

Table 1-6. Identified Nonstructural Checklist Items Marked as Unknown for White Salmon Valley Columbia High School Libray

Unknown Item	Description
LF-1 Independent Support.	
HR-not required: LS-MH: PR-	Further investigation is required to review the support system for light fixtures. All light fixtures in
MH.	grid ceiling system should have seismic bracing.
CG-8 Overhead Glazing. HR-	Eventhon investigation is negotiard to vanify detailing of alamine manage
not required; LS-MH; PR-MH.	Further investigation is required to verify detailing of glazing panes.
PCOA-4 Appendages. HR-	Wood parapets. Further investigation is required to verify reinforcing/anchorage of appendages
MH; LS-MH; PR-LMH.	extending above the main structural building system.

Photos:



Figure 1-1. Columbia High School Library - South Exterior



Figure 1-2. Columbia High School Library - North Exterior

White Salmon Valley, Columbia High School, Libray

17-2 Collapse Prevention Basic Configuration Checklist

Building record drawings have been reviewed, when available, and a non-destructive field investigation has been performed for the subject building. Each of the required checklist items are marked Compliant (C), Noncompliant (NC), Not Applicable (N/A), or Unknown (U). Items marked Compliant indicate conditions that satisfy the performance objective, whereas items marked Noncompliant or Unknown indicate conditions that do not. Certain statements might not apply to the building being evaluated.

Low Seismicity

Building System - General

EVALUATION ITEM	EVALUATION STATEMENT	С	NC	N/A	U	COMMENT
Load Path	The structure contains a complete, well-defined load path, including structural elements and connections, that serves to transfer the inertial forces associated with the mass of all elements of the building to the foundation. (Tier 2: Sec. 5.4.1.1; Commentary: Sec. A.2.1.10)		Х			The building lacks a complete load path between the roof diaphragm and the shear walls and between the shear walls and the foundation. The addition of post-installed anchors and connections between the diaphragm and the shear walls, and between the shear walls and the foundation may be appropriate.
Adjacent Buildings	The clear distance between the building being evaluated and any adjacent building is greater than 0.25% of the height of the shorter building in low seismicity, 0.5% in moderate seismicity, and 1.5% in high seismicity. (Tier 2: Sec. 5.4.1.2; Commentary: Sec. A.2.1.2)	X				
Mezzanines	Interior mezzanine levels are braced independently from the main structure or are anchored to the seismic-force-resisting elements of the main structure. (Tier 2: Sec. 5.4.1.3; Commentary: Sec. A.2.1.3)			X		

Building System - Building Configuration

EVALUATION ITEM	EVALUATION STATEMENT	С	NC	N/A	U	COMMENT
•	The sum of the shear strengths of the seismic- force-resisting system in any story in each direction is not less than 80% of the strength in the adjacent story above. (Tier 2: Sec. 5.4.2.1; Commentary: Sec. A.2.2.2)			X		

Soft Story	The stiffness of the seismic-force-resisting system in any story is not less than 70% of the seismic-force-resisting system stiffness in an adjacent story above or less than 80% of the average seismic-force-resisting system stiffness of the three stories above. (Tier 2: Sec. 5.4.2.2; Commentary: Sec. A.2.2.3)		X	
Vertical Irregularities	All vertical elements in the seismic-forceresisting system are continuous to the foundation. (Tier 2: Sec. 5.4.2.3; Commentary: Sec. A.2.2.4)	X		
Geometry	There are no changes in the net horizontal dimension of the seismic-force-resisting system of more than 30% in a story relative to adjacent stories, excluding one-story penthouses and mezzanines. (Tier 2: Sec. 5.4.2.4; Commentary: Sec. A.2.2.5)		X	
Mass	There is no change in effective mass of more than 50% from one story to the next. Light roofs, penthouses, and mezzanines need not be considered. (Tier 2: Sec. 5.4.2.5; Commentary: Sec. A.2.2.6)		X	
Torsion	The estimated distance between the story center of mass and the story center of rigidity is less than 20% of the building width in either plan dimension. (Tier 2: Sec. 5.4.2.6; Commentary: Sec. A.2.2.7)	X		

Moderate Seismicity (Complete the Following Items in Addition to the Items for Low Seismicity)

Geologic Site Hazards

EVALUATION ITEM	EVALUATION STATEMENT	С	NC	N/A	U	COMMENT
Liquefaction	Liquefaction-susceptible, saturated, loose granular soils that could jeopardize the building's seismic performance do not exist in the foundation soils at depths within 50 ft (15.2 m) under the building. (Tier 2: Sec. 5.4.3.1; Commentary: Sec. A.6.1.1)				X	The liquefaction potential of site soils is unknown at this time given available information. Very low liquefaction potential is identified per ICOS based on state geologic mapping. Requires further investigation by a licensed geotechnical engineer to determine liquefaction potential.
Slope Failure	The building site is located away from potential earthquake-induced slope failures or rockfalls so that it is unaffected by such failures or is capable of accommodating any predicted movements without failure. (Tier 2: Sec. 5.4.3.1; Commentary: Sec. A.6.1.2)				X	Requires further investigation by a licensed geotechnical engineer to determine susceptibility to slope failure.

Surface Fault Rupture	Surface fault rupture and surface displacement at the building site are not anticipated. (Tier 2: Sec. 5.4.3.1; Commentary: Sec. A.6.1.3)		X	Requires further investigation by a licensed geotechnical engineer to determine whether site is near locations of expected
				surface fault ruptures.

High Seismicity (Complete the Following Items in Addition to the Items for Low and Moderate Seismicity)

Foundation Configuration

EVALUATION ITEM	EVALUATION STATEMENT	С	NC	N/A	U	COMMENT
Overturning	The ratio of the least horizontal dimension of the seismic-force-resisting system at the foundation level to the building height (base/height) is greater than 0.6Sa. (Tier 2: Sec. 5.4.3.3; Commentary: Sec. A.6.2.1)	X				
Ties Between Foundation Elements	The foundation has ties adequate to resist seismic forces where footings, piles, and piers are not restrained by beams, slabs, or soils classified as Site Class A, B, or C. (Tier 2: Sec. 5.4.3.4; Commentary: Sec. A.6.2.2)			X		

17-28 Collapse Prevention Structural Checklist for Building Types PC1 and PC1a

Building record drawings have been reviewed, when available, and a non-destructive field investigation has been performed for the subject building. Each of the required checklist items are marked Compliant (C), Noncompliant (NC), Not Applicable (N/A), or Unknown (U). Items marked Compliant indicate conditions that satisfy the performance objective, whereas items marked Noncompliant or Unknown indicate conditions that do not. Certain statements might not apply to the building being evaluated.

Low Seismicity

Connections

EVALUATION ITEM	EVALUATION STATEMENT	С	NC	N/A	U	COMMENT
Wall Anchorage	Exterior concrete or masonry walls that are dependent on the diaphragm for lateral support are anchored for out-of-plane forces at each diaphragm level with steel anchors, reinforcing dowels, or straps that are developed into the diaphragm. Connections have strength to resist the connection force calculated in the Quick Check procedure of Section 4.4.3.7. (Tier 2: Sec. 5.7.1.1; Commentary: Sec. A.5.1.1)		X			No out-of-plane wall anchorage. Tension ties, blocking, strapping, and diaphragm nailing are required along precast concrete walls.

Moderate Seismicity (Complete the Following Items in Addition to the Items for Low Seimicity)

Seismic-Force-Resisting System

EVALUATION ITEM	EVALUATION STATEMENT	С	NC	N/A	U	COMMENT
Redundancy	The number of lines of shear walls in each principal direction is greater than or equal to 2. (Tier 2: Sec. 5.5.1.1; Commentary: Sec. A.3.2.1.1)	X				
Wall Shear Stress Check	The shear stress in the precast panels, calculated using the Quick Check procedure of Section 4.4.3.3, is less than the greater of 100 lb/in.2 (0.69 MPa) or 2√f c. (Tier 2: Sec. 5.5.3.1.1; Commentary: Sec. A.3.2.3.1)	X				
Reinforcing Steel	The ratio of reinforcing steel area to gross concrete area is not less than 0.0012 in the vertical direction and 0.0020 in the horizontal direction. (Tier 2: Sec. 5.5.3.1.3; Commentary: Sec. A.3.2.3.2)	X				
Wall Thickness	Thicknesses of bearing walls are not less than 1/40 the unsupported height or length, whichever is shorter, nor less than 4 in. (101 mm). (Tier 2: Sec. 5.5.3.1.2; Commentary: Sec. A.3.2.3.5)		X			Six-inch wall is less than 1/40 requirement. The building likely requires wall strengthening. The addition of a steel strongback system may be appropriate. Further investigation is required.

Diaphragms

EVALUATION ITEM	EVALUATION STATEMENT	С	NC	N/A	U	COMMENT

	Precast concrete diaphragm elements are				
	interconnected by a continuous reinforced				
Topping Slab	concrete topping slab with a minimum thickness		X		
	of 2 in. (51 mm). (Tier 2: Sec. 5.6.4;				
	Commentary: Sec. A.4.5.1)				

Connections

EVALUATION ITEM	EVALUATION STATEMENT	С	NC	N/A	U	COMMENT
Wood Ledgers	The connection between the wall panels and the diaphragm does not induce cross-grain bending or tension in the wood ledgers. (Tier 2: Sec. 5.7.1.3; Commentary: Sec. A.5.1.2)	X				
Transfer to Shear Walls	Diaphragms are connected for transfer of seismic forces to the shear walls. (Tier 2: Sec. 5.7.2; Commentary: Sec. A.5.2.1)		X			No structural connection between the roof diaphragm and the shear walls to transfer seismic forces. Post- installed anchors may be appropriate to connect the roof diaphragm to the shear walls.
Topping Slab to Walls or Frames	Reinforced concrete topping slabs that interconnect the precast concrete diaphragm elements are doweled for transfer of forces into the shear wall or frame elements. (Tier 2: Sec. 5.7.2; Commentary: Sec. A.5.2.3)			X		
Girder-Column Conncection	There is a positive connection using plates, connection hardware, or straps between the girder and the column support. (Tier 2: Sec. 5.7.4.1; Commentary: Sec. A.5.4.1)	X				

High Seismicity (Complete the Following Items in Addition to the Items for Low and Moderate Seismicity)

Seismic-Force-Resisting System

EVALUATION ITEM	EVALUATION STATEMENT	С	NC	N/A	U	COMMENT
Compatibility for Rigid	Secondary components have the shear capacity to develop the flexural strength of the components. (Tier 2: Sec. 5.5.2.5.2; Commentary: Sec. A.3.1.6.2)			X		
Wall Openings	The total width of openings along any perimeter wall line constitutes less than 75% of the length of any perimeter wall when the wall piers have aspect ratios of less than 2-to-1. (Tier 2: Sec. 5.5.3.3.1; Commentary: Sec. A.3.2.3.3)	X				

Diaphragms

EVALUATION ITEM	EVALUATION STATEMENT	C	NC	N/A	U	COMMENT
Cross Ties in Flexible	There are continuous cross ties between diaphragm chords. (Tier 2: Sec. 5.6.1.2; Commentary: Sec. A.4.1.2)	X				

Straight Sheathing	All straight-sheathed diaphragms have aspect ratios less than 2-to-1 in the direction being considered. (Tier 2: Sec. 5.6.2; Commentary: Sec. A.4.2.1)		X	
Spans	All wood diaphragms with spans greater than 24 ft (7.3 m) consist of wood structural panels or diagonal sheathing. (Tier 2: Sec. 5.6.2; Commentary: Sec. A.4.2.2)	X		
Diagonally Sheathed and Unblocked Diaphragms	All diagonally sheathed or unblocked wood structural panel diaphragms have horizontal spans less than 40 ft (12.2 m) and aspect ratios less than or equal to 4 to-1. (Tier 2: Sec. 5.6.2; Commentary: Sec. A.4.2.3)		X	
Other Diaphragms	Diaphragms do not consist of a system other than wood, metal deck, concrete, or horizontal bracing. (Tier 2: Sec. 5.6.5; Commentary: Sec. A.4.7.1)	X		

Connections

EVALUATION ITEM	EVALUATION STATEMENT	С	NC	N/A	U	COMMENT
Minimum Number of Wall Anchors Per Panel	There are at least two anchors connecting each precast wall panel to the diaphragm elements. (Tier 2: Sec. 5.7.1.4; Commentary: Sec. A.5.1.3)				X	This evaluation item is unknown due to the quality and completeness of the building drawings provided and could not be visually verified. This item requires further field investigation to make a final determination on its compliance and to develop a mitigation recommendation, if necessary.
Precast Wall Panels	Precast wall panels are connected to the foundation. (Tier 2: Sec. 5.7.3.4; Commentary: Sec. A.5.3.6)		X			Precast wall panels are not directly connected to the foundation. The addition of post-installed connections, such as FRP, may be appropriate. Further investigation is required.
Uplift at Pile Caps	Pile caps have top reinforcement, and piles are anchored to the pile caps. (Tier 2: Sec. 5.7.3.5; Commentary: Sec. A.5.3.8)			X		

Girders	Girders supported by walls or pilasters have at least two ties securing the anchor bolts unless provided with independent stiff wall anchors with strength to resist the connection force calculated in the Quick Check procedure of Section 4.4.3.7. (Tier 2: Sec. 5.7.4.2; Commentary: Sec. A.5.4.2)			X	This evaluation item is unknown due to the quality and completeness of the building drawings provided and could not be visually verified. This item requires further field investigation to make a final determination on its compliance and to develop a mitigation recommendation, if necessary.
---------	--	--	--	---	--

White Salmon Valley, Columbia High School, Libray

17-38 Nonstructural Checklist

Notes:

C = Compliant, NC = Noncompliant, N/A = Not Applicable, and U = Unknown.

Performance Level: HR = Hazards Reduced, LS = Life Safety, and PR = Position Retention.

Level of Seismicity: L = Low, M = Moderate, and H = High

Life Safety Systems

EVALUATION ITEM	EVALUATION STATEMENT	С	NC	N/A	U	COMMENT
LSS-1 Fire Suppression Piping. HR-not required; LS-LMH; PR-LMH.	Fire suppression piping is anchored and braced in accordance with NFPA-13. (Tier 2: Sec. 13.7.4; Commentary: Sec. A.7.13.1)			X		No fire sprinklers
LSS-2 Flexible Couplings. HR-not required; LS-LMH; PR- LMH.	Fire suppression piping has flexible couplings in accordance with NFPA-13. (Tier 2: Sec. 13.7.4; Commentary: Sec. A.7.13.2)			X		
LSS-3 Emergency Power. HR-not required; LS-LMH; PR-LMH.	Equipment used to power or control Life Safety systems is anchored or braced. (Tier 2: Sec. 13.7.7; Commentary: Sec. A.7.12.1)			X		No emergency power observed
LSS-4 Stair and Smoke Ducts. HR-not required; LS-LMH; PR-LMH.	Stair pressurization and smoke control ducts are braced and have flexible connections at seismic joints. (Tier 2: Sec. 13.7.6; Commentary: Sec. A.7.14.1)			X		No stairs
LSS-5 Sprinkler Ceiling Clearance. HR-not required; LS-MH; PR- MH.	Penetrations through panelized ceilings for fire suppression devices provide clearances in accordance with NFPA-13. (Tier 2: Sec. 13.7.4; Commentary: Sec. A.7.13.3)			X		
LSS-6 Emergency Lighting. HR-not required; LS-not required; PR-LMH	Emergency and egress lighting equipment is anchored or braced. (Tier 2: Sec. 13.7.9; Commentary: Sec. A.7.3.1)			X		Non-applicable due to ASCE 41 Performance Level: "Life Safety (LS)"

Hazardous Materials

EVALUATION ITEM	EVALUATION STATEMENT	С	NC	N/A	U	COMMENT
HM-1 Hazardous Material Equipment. HR- LMH; LS-LMH; PR- LMH.	Equipment mounted on vibration isolators and containing hazardous material is equipped with restraints or snubbers. (Tier 2: Sec. 13.7.1; Commentary: Sec. A.7.12.2)			X		
HM-2 Hazardous Material Storage. HR- LMH; LS-LMH; PR- LMH.	Breakable containers that hold hazardous material, including gas cylinders, are restrained by latched doors, shelf lips, wires, or other methods. (Tier 2: Sec. 13.8.3; Commentary: Sec. A.7.15.1)			X		
HM-3 Hazardous Material Distribution. HR-MH; LS-MH; PR- MH.	Piping or ductwork conveying hazardous materials is braced or otherwise protected from damage that would allow hazardous material release. (Tier 2: Sec. 13.7.3, 13.7.5; Commentary: Sec. A.7.13.4)			X		None observed

HM-4 Shutoff Valves. HR-MH; LS-MH; PR- MH.	Piping containing hazardous material, including natural gas, has shutoff valves or other devices to limit spills or leaks. (Tier 2: Sec. 13.7.3, 13.7.5; Commentary: Sec. A.7.13.3)		X		
HM-5 Flexible Couplings. HR-LMH; LS-LMH; PR-LMH.	Hazardous material ductwork and piping, including natural gas piping, have flexible couplings. (Tier 2: Sec. 13.7.3, 13.7.5; Commentary: Sec. A.7.15.4)		X		
HM-6 Piping or Ducts Crossing Seismic Joints. HR-MH; LS-MH; PR- MH.	Piping or ductwork carrying hazardous material that either crosses seismic joints or isolation planes or is connected to independent structures has couplings or other details to accommodate the relative seismic displacements. (Tier 2: Sec. 13.7.3, 13.7.5, 13.7.6; Commentary: Sec. A.7.13.6)		X		

Partitions

EVALUATION ITEM	EVALUATION STATEMENT	С	NC	N/A	U	COMMENT
P-1 Unreinforced Masonry. HR-LMH; LS- LMH; PR-LMH.	Unreinforced masonry or hollow-clay tile partitions are braced at a spacing of at most 10 ft (3.0 m) in Low or Moderate Seismicity, or at most 6 ft (1.8 m) in High Seismicity. (Tier 2: Sec. 13.6.2; Commentary: Sec. A.7.1.1)			X		
P-2 Heavy Partitions Supported by Ceilings. HR-LMH; LS-LMH; PR- LMH.	The tops of masonry or hollow-clay tile partitions are not laterally supported by an integrated ceiling system. (Tier 2: Sec. 13.6.2; Commentary: Sec. A.7.2.1)			X		
P-3 Drift. HR-not required; LS-MH; PR- MH.	Rigid cementitious partitions are detailed to accommodate the following drift ratios: in steel moment frame, concrete moment frame, and wood frame buildings, 0.02; in other buildings, 0.005. (Tier 2: Sec. 13.6.2; Commentary: Sec. A.7.1.2)			X		
P-4 Light Partitions Supported by Ceilings. HR-not required; LS-not required; PR-MH.	The tops of gypsum board partitions are not laterally supported by an integrated ceiling system. (Tier 2: Sec. 13.6.2; Commentary: Sec. A.7.2.1)			X		Non-applicable due to ASCE 41 Performance Level: "Life Safety (LS)"
P-5 Structural Separations. HR-not required; LS-not required; PR-MH.	Partitions that cross structural separations have seismic or control joints. (Tier 2: Sec. 13.6.2; Commentary: Sec. A.7.1.3)			X		Non-applicable due to ASCE 41 Performance Level: "Life Safety (LS)"
P-6 Tops. HR-not required; LS-not required; PR-MH.	The tops of ceiling-high framed or panelized partitions have lateral bracing to the structure at a spacing equal to or less than 6 ft (1.8 m). (Tier 2: Sec. 13.6.2; Commentary: Sec. A.7.1.4)			X		Non-applicable due to ASCE 41 Performance Level: "Life Safety (LS)"

Ceilings

EVALUATION ITEM	EVALUATION STATEMENT	С	NC	N/A	U	COMMENT
C-1 Suspended Lath and Plaster. HR-H; LS-MH; PR-LMH.	Suspended lath and plaster ceilings have attachments that resist seismic forces for every 12 ft2 (1.1 m2) of area. (Tier 2: Sec. 13.6.4; Commentary: Sec. A.7.2.3)			X		
C-2 Suspended Gypsum Board. HR-not required; LS-MH; PR-LMH.	Suspended gypsum board ceilings have attachments that resist seismic forces for every 12 ft2 (1.1 m2) of area. (Tier 2: Sec. 13.6.4; Commentary: Sec. A.7.2.3)			X		
C-3 Integrated Ceilings. HR-not required; LS-not required; PR-MH.	Integrated suspended ceilings with continuous areas greater than 144 ft2 (13.4 m2) and ceilings of smaller areas that are not surrounded by restraining partitions are laterally restrained at a spacing no greater than 12 ft (3.6 m) with members attached to the structure above. Each restraint location has a minimum of four diagonal wires and compression struts, or diagonal members capable of resisting compression. (Tier 2: Sec. 13.6.4; Commentary: Sec. A.7.2.2)			X		Non-applicable due to ASCE 41 Performance Level: "Life Safety (LS)"
C-4 Edge Clearance. HR- not required; LS-not required; PR-MH.	The free edges of integrated suspended ceilings with continuous areas greater than 144 ft2 (13.4 m2) have clearances from the enclosing wall or partition of at least the following: in Moderate Seismicity, 1/2 in. (13 mm); in High Seismicity, 3/4 in. (19 mm). (Tier 2: Sec. 13.6.4; Commentary: Sec. A.7.2.4)			X		Non-applicable due to ASCE 41 Performance Level: "Life Safety (LS)"
C-5 Continuity Across Structure Joints. HR-not required; LS-not required; PR-MH.	The ceiling system does not cross any seismic joint and is not attached to multiple independent structures. (Tier 2: Sec. 13.6.4; Commentary: Sec. A.7.2.5)			X		Non-applicable due to ASCE 41 Performance Level: "Life Safety (LS)"
C-6 Edge Support. HR- not required; LS-not required; PR-H.	The free edges of integrated suspended ceilings with continuous areas greater than 144 ft2 (13.4 m2) are supported by closure angles or channels not less than 2 in. (51 mm) wide. (Tier 2: Sec. 13.6.4; Commentary: Sec. A.7.2.6)			X		Non-applicable due to ASCE 41 Performance Level: "Life Safety (LS)"
C-7 Seismic Joints. HR- not required; LS-not required; PR-H.	Acoustical tile or lay-in panel ceilings have seismic separation joints such that each continuous portion of the ceiling is no more than 2,500 ft2 (232.3 m2) and has a ratio of long-to-short dimension no more than 4-to-1. (Tier 2: Sec. 13.6.4; Commentary: Sec. A.7.2.7)			X		Non-applicable due to ASCE 41 Performance Level: "Life Safety (LS)"

Light Fixtures

EVALUATION ITEM	EVALUATION STATEMENT	С	NC	N/A	U	COMMENT
LF-1 Independent Support. HR-not required; LS-MH; PR- MH.	Light fixtures that weigh more per square foot than the ceiling they penetrate are supported independent of the grid ceiling suspension system by a minimum of two wires at diagonally opposite corners of each fixture. (Tier 2: Sec. 13.6.4, 13.7.9; Commentary: Sec. A.7.3.2)				X	Further investigation is required to review the support system for light fixtures. All light fixtures in grid ceiling system should have seismic bracing.
LF-2 Pendant Supports. HR-not required; LS-not required; PR-H.	Light fixtures on pendant supports are attached at a spacing equal to or less than 6 ft. Unbraced suspended fixtures are free to allow a 360-degree range of motion at an angle not less than 45 degrees from horizontal without contacting adjacent components. Alternatively, if rigidly supported and/or braced, they are free to move with the structure to which they are attached without damaging adjoining components. Additionally, the connection to the structure is capable of accommodating the movement without failure. (Tier 2: Sec. 13.7.9; Commentary: Sec. A.7.3.3)			X		Non-applicable due to ASCE 41 Performance Level: "Life Safety (LS)"
LF-3 Lens Covers. HR- not required; LS-not required; PR-H.	Lens covers on light fixtures are attached with safety devices. (Tier 2: Sec. 13.7.9; Commentary: Sec. A.7.3.4)			X		Non-applicable due to ASCE 41 Performance Level: "Life Safety (LS)"

Cladding and Glazing

EVALUATION ITEM	EVALUATION STATEMENT	С	NC	N/A	U	COMMENT
CG-1 Cladding Anchors. HR-MH; LS-MH; PR- MH.	Cladding components weighing more than 10 lb/ft2 (0.48 kN/m2) are mechanically anchored to the structure at a spacing equal to or less than the following: for Life Safety in Moderate Seismicity, 6 ft (1.8 m); for Life Safety in High Seismicity and for Position Retention in any seismicity, 4 ft (1.2 m) (Tier 2: Sec. 13.6.1; Commentary: Sec. A.7.4.1)			X		No cladding
CG-2 Cladding Isolation. HR-not required; LS- MH; PR-MH.	For steel or concrete moment-frame buildings, panel connections are detailed to accommodate a story drift ratio by the use of rods attached to framing with oversize holes or slotted holes of at least the following: for Life Safety in Moderate Seismicity, 0.01; for Life Safety in High Seismicity and for Position Retention in any seismicity, 0.02, and the rods have a length-to-diameter ratio of 4.0 or less. (Tier 2: Sec. 13.6.1; Commentary: Sec. A.7.4.3)			X		

CG-3 Multi-Story Panels. HR-MH; LS-MH; PR- MH.	For multi-story panels attached at more than one floor level, panel connections are detailed to accommodate a story drift ratio by the use of rods attached to framing with oversize holes or slotted holes of at least the following: for Life Safety in Moderate Seismicity, 0.01; for Life Safety in High Seismicity and for Position Retention in any seismicity, 0.02, and the rods have a length-to-diameter ratio of 4.0 or less. (Tier 2: Sec. 13.6.1; Commentary: Sec. A.7.4.4)		X		
CG-4 Threaded Rods. HR-not required; LS- MH; PR-MH.	Threaded rods for panel connections detailed to accommodate drift by bending of the rod have a length-to-diameter ratio greater than 0.06 times the story height in inches for Life Safety in Moderate Seismicity and 0.12 times the story height in inches for Life Safety in High Seismicity and Position Retention in any seismicity. (Tier 2: Sec. 13.6.1; Commentary: Sec. A.7.4.9)		X		
CG-5 Panel Connections. HR-MH; LS-MH; PR- MH.	Cladding panels are anchored out of plane with a minimum number of connections for each wall panel, as follows: for Life Safety in Moderate Seismicity, 2 connections; for Life Safety in High Seismicity and for Position Retention in any seismicity, 4 connections. (Tier 2: Sec. 13.6.1.4; Commentary: Sec. A.7.4.5)		X		
CG-6 Bearing Connections. HR-MH; LS-MH; PR-MH.	Where bearing connections are used, there is a minimum of two bearing connections for each cladding panel. (Tier 2: Sec. 13.6.1.4; Commentary: Sec. A.7.4.6)		X		
CG-7 Inserts. HR-MH; LS-MH; PR-MH.	Where concrete cladding components use inserts, the inserts have positive anchorage or are anchored to reinforcing steel. (Tier 2: Sec. 13.6.1.4; Commentary: Sec. A.7.4.7)		X		
CG-8 Overhead Glazing. HR-not required; LS- MH; PR-MH.	Glazing panes of any size in curtain walls and individual interior or exterior panes more than 16 ft2 (1.5 m2) in area are laminated annealed or laminated heat-strengthened glass and are detailed to remain in the frame when cracked. (Tier 2: Sec. 13.6.1.5; Commentary: Sec. A.7.4.8)			X	Further investigation is required to verify detailing of glazing panes.

Masonry Veneer

EVALUATION ITEM	EVALUATION STATEMENT	С	NC	N/A	U	COMMENT
M-1 Ties. HR-not required; LS-LMH; PR- LMH.	Masonry veneer is connected to the backup with corrosion-resistant ties. There is a minimum of one tie for every 2-2/3 ft2 (0.25 m2), and the ties have spacing no greater than the following: for Life Safety in Low or Moderate Seismicity, 36 in. (914 mm); for Life Safety in High Seismicity and for Position Retention in any seismicity, 24 in. (610 mm). (Tier 2: Sec. 13.6.1.2; Commentary: Sec. A.7.5.1)			X		No masonry veneer
M-2 Shelf Angles. HR- not required; LS-LMH; PR-LMH.	Masonry veneer is supported by shelf angles or other elements at each floor above the ground floor. (Tier 2: Sec. 13.6.1.2; Commentary: Sec. A.7.5.2)			X		No masonry veneer
M-3 Weakened Planes. HR-not required; LS- LMH; PR-LMH.	Masonry veneer is anchored to the backup adjacent to weakened planes, such as at the locations of flashing. (Tier 2: Sec. 13.6.1.2; Commentary: Sec. A.7.5.3)			X		No masonry veneer
M-4 Unreinforced Masonry Backup. HR- LMH; LS-LMH; PR- LMH.	There is no unreinforced masonry backup. (Tier 2: Sec. 13.6.1.1, 13.6.1.2; Commentary: Sec. A.7.7.2)			X		No masonry veneer
M-5 Stud Tracks. HR-not required; LS-MH; PR- MH.	For veneer with coldformed steel stud backup, stud tracks are fastened to the structure at a spacing equal to or less than 24 in. (610 mm) on center. (Tier 2: Sec. 13.6.1.1, 13.6.1.2; Commentary: Sec. A.7.6.)			X		No masonry veneer
M-6 Anchorage. HR-not required; LS-MH; PR- MH.	For veneer with concrete block or masonry backup, the backup is positively anchored to the structure at a horizontal spacing equal to or less than 4 ft along the floors and roof. (Tier 2: Sec. 13.6.1.1, 13.6.1.2; Commentary: Sec. A.7.7.1)			X		No masonry veneer
M-7 Weep Holes. HR-not required; LS-not required; PR-MH.	In veneer anchored to stud walls, the veneer has functioning weep holes and base flashing. (Tier 2: Sec. 13.6.1.2; Commentary: Sec. A.7.5.6)			X		No masonry veneer
M-8 Openings. HR-not required; LS-not required; PR-MH.	For veneer with cold-formed-steel stud backup, steel studs frame window and door openings. (Tier 2: Sec. 13.6.1.1, 13.6.1.2; Commentary: Sec. A.7.6.2)			X		No masonry veneer

Parapets, Cornices, Ornamentation, and Appendages

EVALUATION ITEM	EVALUATION STATEMENT	С	NC	N/A	U	COMMENT
PCOA-1 URM Parapets or Cornices. HR-LMH; LS-LMH; PR-LMH.	Laterally unsupported unreinforced masonry parapets or cornices have height-tothickness ratios no greater than the following: for Life Safety in Low or Moderate Seismicity, 2.5; for Life Safety in High Seismicity and for Position Retention in any seismicity, 1.5. (Tier 2: Sec. 13.6.5; Commentary: Sec. A.7.8.1)			X		

PCOA-2 Canopies. HR-not required; LS-LMH; PR-LMH.	Canopies at building exits are anchored to the structure at a spacing no greater than the following: for Life Safety in Low or Moderate Seismicity, 10 ft (3.0 m); for Life Safety in High Seismicity and for Position Retention in any seismicity, 6 ft (1.8 m). (Tier 2: Sec. 13.6.6; Commentary: Sec. A.7.8.2)		X		
PCOA-3 Concrete Parapets. HR-H; LS-MH; PR-LMH.	Concrete parapets with height-to-thickness ratios greater than 2.5 have vertical reinforcement. (Tier 2: Sec. 13.6.5; Commentary: Sec. A.7.8.3)		X		
PCOA-4 Appendages. HR-MH; LS-MH; PR- LMH.	Cornices, parapets, signs, and other ornamentation or appendages that extend above the highest point of anchorage to the structure or cantilever from components are reinforced and anchored to the structural system at a spacing equal to or less than 6 ft (1.8 m). This evaluation statement item does not apply to parapets or cornices covered by other evaluation statements. (Tier 2: Sec. 13.6.6; Commentary: Sec. A.7.8.4)			X	Wood parapets. Further investigation is required to verify reinforcing/anchorage of appendages extending above the main structural building system.

Masonry Chimneys

EVALUATION ITEM	EVALUATION STATEMENT	С	NC	N/A	U	COMMENT
MC-1 URM Chimneys. HR-LMH; LS-LMH; PR- LMH.	Unreinforced masonry chimneys extend above the roof surface no more than the following: for Life Safety in Low or Moderate Seismicity, 3 times the least dimension of the chimney; for Life Safety in High Seismicity and for Position Retention in any seismicity, 2 times the least dimension of the chimney. (Tier 2: Sec. 13.6.7; Commentary: Sec. A.7.9.1)			X		
MC-2 Anchorage. HR- LMH; LS-LMH; PR- LMH.	Masonry chimneys are anchored at each floor level, at the topmost ceiling level, and at the roof. (Tier 2: Sec. 13.6.7; Commentary: Sec. A.7.9.2)			X		

Stairs

EVALUATION ITEM	EVALUATION STATEMENT	С	NC	N/A	U	COMMENT
S-1 Stair Enclosures. HR-not required; LS- LMH; PR-LMH.	Hollow-clay tile or unreinforced masonry walls around stair enclosures are restrained out of plane and have height-to-thickness ratios not greater than the following: for Life Safety in Low or Moderate Seismicity, 15-to-1; for Life Safety in High Seismicity and for Position Retention in any seismicity, 12-to-1. (Tier 2: Sec. 13.6.2, 13.6.8; Commentary: Sec. A.7.10.1)			X		No stairs

	The connection between the stairs and the			
S-2 Stair Details. HR-not	structure does not rely on post-installed anchors in concrete or masonry, and the stair details are capable of accommodating the drift calculated		X	No stairs
	A.7.10.2)			

Contents and Furnishings

EVALUATION ITEM	EVALUATION STATEMENT	C	NC	N/A	U	COMMENT
CF-1 Industrial Storage Racks. HR-LMH; LS- MH; PR-MH.	Industrial storage racks or pallet racks more than 12 ft high meet the requirements of ANSI/RMI MH 16.1 as modified by ASCE 7, Chapter 15. (Tier 2: Sec. 13.8.1; Commentary: Sec. A.7.11.1)			X		
CF-2 Tall Narrow Contents. HR-not required; LS-H; PR-MH.	Contents more than 6 ft (1.8 m) high with a height-to-depth or height-to-width ratio greater than 3-to-1 are anchored to the structure or to each other. (Tier 2: Sec. 13.8.2; Commentary: Sec. A.7.11.2)		X			Anchorage is required at tall narrow contents more than six feet high to provide overturning restraint.
CF-3 Fall-Prone Contents. HR-not required; LS-H; PR-H.	Equipment, stored items, or other contents weighing more than 20 lb (9.1 kg) whose center of mass is more than 4 ft (1.2 m) above the adjacent floor level are braced or otherwise restrained. (Tier 2: Sec. 13.8.2; Commentary: Sec. A.7.11.3)			X		
CF-4 Access Floors. HR- not required; LS-not required; PR-MH.	Access floors more than 9 in. (229 mm) high are braced. (Tier 2: Sec. 13.6.10; Commentary: Sec. A.7.11.4)			X		Non-applicable due to ASCE 41 Performance Level: "Life Safety (LS)"
CF-5 Equipment on Access Floors. HR-not required; LS-not required; PR-MH.	Equipment and other contents supported by access floor systems are anchored or braced to the structure independent of the access floor. (Tier 2: Sec. 13.7.7 13.6.10; Commentary: Sec. A.7.11.5)			X		Non-applicable due to ASCE 41 Performance Level: "Life Safety (LS)"
CF-6 Suspended Contents. HR-not required; LS-not required; PR-H.	Items suspended without lateral bracing are free to swing from or move with the structure from which they are suspended without damaging themselves or adjoining components. (Tier 2: Sec. 13.8.2; Commentary: Sec. A.7.11.6)			X		Non-applicable due to ASCE 41 Performance Level: "Life Safety (LS)"

Mechanical and Electrical Equipment

EVALUATION ITEM	EVALUATION STATEMENT	С	NC	N/A	U	COMMENT
	Equipment weighing more than 20 lb (9.1 kg)					
ME-1 Fall-Prone	whose center of mass is more than 4 ft (1.2 m)					
Equipment. HR-not	above the adjacent floor level, and which is not			X		
required; LS-H; PR-H.	in-line equipment, is braced. (Tier 2: Sec. 13.7.1					
	13.7.7; Commentary: Sec. A.7.12.4)					

ME-2 In-Line Equipment. HR-not required; LS-H; PR-H.	Equipment installed in line with a duct or piping system, with an operating weight more than 75 lb (34.0 kg), is supported and laterally braced independent of the duct or piping system. (Tier 2: Sec. 13.7.1; Commentary: Sec. A.7.12.5)	X		
ME-3 Tall Narrow Equipment. HR-not required; LS-H; PR-MH.	Equipment more than 6 ft (1.8 m) high with a height-to-depth or height-to-width ratio greater than 3-to-1 is anchored to the floor slab or adjacent structural walls. (Tier 2: Sec. 13.7.1 13.7.7; Commentary: Sec. A.7.12.6)	X		
ME-4 Mechanical Doors. HR-not required; LS-not required; PR-MH.	, 1	X	Non-applical ASCE 41 Pe Level: "Life	rformance
ME-5 Suspended Equipment. HR-not required; LS-not required; PR-H.	Equipment suspended without lateral bracing is free to swing from or move with the structure from which it is suspended without damaging itself or adjoining components. (Tier 2: Sec. 13.7.1, 13.7.7; Commentary: Sec. A.7.12.8)	X	Non-applical ASCE 41 Pe Level: "Life	rformance
ME-6 Vibration Isolators. HR-not required; LS-not required; PR-H.	Equipment mounted on vibration isolators is equipped with horizontal restraints or snubbers and with vertical restraints to resist overturning. (Tier 2: Sec. 13.7.1; Commentary: Sec. A.7.12.9)	X	Non-applical ASCE 41 Pe Level: "Life	rformance
ME-7 Heavy Equipment. HR-not required; LS-not required; PR-H.	Floor supported or platform-supported equipment weighing more than 400 lb (181.4 kg) is anchored to the structure. (Tier 2: Sec. 13.7.1, 13.7.7; Commentary: Sec. A.7.12.10)	X	Non-applical ASCE 41 Pe Level: "Life	rformance
ME-8 Electrical Equipment. HR-not required; LS-not required; PR-H.	Electrical equipment is laterally braced to the structure. (Tier 2: Sec. 13.7.7; Commentary: Sec. A.7.12.11)	X	Non-applical ASCE 41 Pe Level: "Life	rformance
ME-9 Conduit Couplings. HR-not required; LS-not required; PR-H.	Conduit greater than 2.5 in. (64 mm) trade size that is attached to panels, cabinets, or other equipment and is subject to relative seismic displacement has flexible couplings or connections. (Tier 2: Sec. 13.7.8; Commentary: Sec. A.7.12.12)	X	Non-applical ASCE 41 Pe Level: "Life	rformance

Piping

EVALUATION ITEM	EVALUATION STATEMENT	С	NC	N/A	U	COMMENT
	Fluid and gas piping has flexible couplings. (Tier 2: Sec. 13.7.3, 13.7.5; Commentary: Sec. A.7.13.2)			X		Non-applicable due to ASCE 41 Performance Level: "Life Safety (LS)"
PP-2 Fluid and Gas Piping. HR-not required; LS-not required; PR-H.	Fluid and gas piping is anchored and braced to the structure to limit spills or leaks. (Tier 2: Sec. 13.7.3, 13.7.5; Commentary: Sec. A.7.13.4)			X		Non-applicable due to ASCE 41 Performance Level: "Life Safety (LS)"

PP-3 C-Clamps. HR-not required; LS-not required; PR-H.	One-sided C-clamps that support piping larger than 2.5 in. (64 mm) in diameter are restrained. (Tier 2: Sec. 13.7.3, 13.7.5; Commentary: Sec. A.7.13.5)		X	Non-applicable due to ASCE 41 Performance Level: "Life Safety (LS)"
PP-4 Piping Crossing Seismic Joints. HR-not required; LS-not required; PR-H.	Piping that crosses seismic joints or isolation planes or is connected to independent structures has couplings or other details to accommodate the relative seismic displacements. (Tier 2: Sec. 13.7.3, 13.7.5; Commentary: Sec. A.7.13.6)		X	Non-applicable due to ASCE 41 Performance Level: "Life Safety (LS)"

Ducts

EVALUATION ITEM	EVALUATION STATEMENT	С	NC	N/A	U	COMMENT
D-1 Duct Bracing. HR- not required; LS-not required; PR-H.	Rectangular ductwork larger than 6 ft2 (0.56 m2) in cross-sectional area and round ducts larger than 28 in. (711 mm) in diameter are braced. The maximum spacing of transverse bracing does not exceed 30 ft (9.2 m). The maximum spacing of longitudinal bracing does not exceed 60 ft (18.3 m). (Tier 2: Sec. 13.7.6; Commentary: Sec. A.7.14.2)			X		Non-applicable due to ASCE 41 Performance Level: "Life Safety (LS)"
D-2 Duct Support. HR- not required; LS-not required; PR-H.	Ducts are not supported by piping or electrical conduit. (Tier 2: Sec. 13.7.6; Commentary: Sec. A.7.14.3)			X		Non-applicable due to ASCE 41 Performance Level: "Life Safety (LS)"
D-3 Ducts Crossing Seismic Joints. HR-not required; LS-not required; PR-H.	Ducts that cross seismic joints or isolation planes or are connected to independent structures have couplings or other details to accommodate the relative seismic displacements. (Tier 2: Sec. 13.7.6; Commentary: Sec. A.7.14.4)			Х		Non-applicable due to ASCE 41 Performance Level: "Life Safety (LS)"

Elevators

EVALUATION ITEM	EVALUATION STATEMENT	С	NC	N/A	U	COMMENT
EL-1 Retainer Guards. HR-not required; LS-H; PR-H.	Sheaves and drums have cable retainer guards. (Tier 2: Sec. 13.7.11; Commentary: Sec. A.7.16.1)			X		No elevator
EL-2 Retainer Plate. HR- not required; LS-H; PR- H.	A retainer plate is present at the top and bottom of both car and counterweight. (Tier 2: Sec. 13.7.11; Commentary: Sec. A.7.16.2)			X		No elevator
EL-3 Elevator Equipment. HR-not required; LS-not required; PR-H.	Equipment, piping, and other components that are part of the elevator system are anchored. (Tier 2: Sec. 13.7.11; Commentary: Sec. A.7.16.3)			X		No elevator
EL-4 Seismic Switch. HR-not required; LS-not required; PR-H.	Elevators capable of operating at speeds of 150 ft/min or faster are equipped with seismic switches that meet the requirements of ASME A17.1 or have trigger levels set to 20% of the acceleration of gravity at the base of the structure and 50% of the acceleration of gravity in other locations. (Tier 2: Sec. 13.7.11; Commentary: Sec. A.7.16.4)			X		No elevator

EL-5 Shaft Walls. HR- not required; LS-not required; PR-H.	Elevator shaft walls are anchored and reinforced to prevent toppling into the shaft during strong shaking. (Tier 2: Sec. 13.7.11; Commentary: Sec. A.7.16.5)	X	No elevator
EL-6 Counterweight Rails. HR-not required; LS-not required; PR-H.	All counterweight rails and divider beams are sized in accordance with ASME A17.1. (Tier 2: Sec. 13.7.11; Commentary: Sec. A.7.16.6)	X	No elevator
EL-7 Brackets. HR-not required; LS-not required; PR-H.	The brackets that tie the car rails and the counterweight rail to the structure are sized in accordance with ASME A17.1. (Tier 2: Sec. 13.7.11; Commentary: Sec. A.7.16.7)	X	No elevator
EL-8 Spreader Bracket. HR-not required; LS-not required; PR-H.	Spreader brackets are not used to resist seismic forces. (Tier 2: Sec. 13.7.11; Commentary: Sec. A.7.16.8)	X	No elevator
EL-9 Go-Slow Elevators. HR-not required; LS-not required; PR-H.	The building has a go-slow elevator system. (Tier 2: Sec. 13.7.11; Commentary: Sec. A.7.16.9)	X	No elevator

1. White Salmon Valley, Columbia High School, Metal /Wood Shop

1.1 Building Description

Building Name: Metal /Wood Shop

Facility Name: Columbia High School

District Name: White Salmon Valley

ICOS Latitude: 45.742
ICOS Longitude: -121.494

ICOS

County/District ID: 20405

ICOS Building ID: 22349
ASCE 41 Bldg Type: PC1
Enrollment: 387
Gross Sq. Ft.: 7,560
Year Built: 1970

Number of Stories: 1

S_{XS BSE-2E}: 0.466

S_{X1 BSE-2E:} 0.292

ASCE 41 Level of

Seismicity: High

Site Class: C


 $V_{S30}(m/s)$: 380

Liquefaction
Potential:

Very Low

Tsunami Risk: None Structural Drawings Available: Yes

Evaluating Firm: WRK Engineers

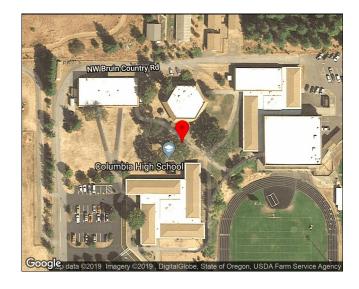



The Columbia High School shop building is a one-story concrete tilt-up structure. The 1970 building is constructed on level ground and is located in White Salmon, Washington. The building is rectangular in plan, 126 feet by 60 feet, with a maximum roof height of around 17 feet. Building construction consists of precast concrete tilt-up walls. There are reinforced masonry walls in the interior of the building. The roof system is a flexible diaphragm composed of glulam beam framing and 2x decking. The structure has an attic mezzanine above the office space. The building shares the site with three other buildings that compose Columbia High School.

1.1.1 Building Use

The shop building includes shop space, storage, and administrative offices. The school has over 380 student occupants.

1.1.2 Structural System

Table 1.1-1. Structural System Description of Columbia High School

Structural System	Description
Structural Roof	The roof system is composed of glulam beam framing and 2x decking.
Structural Floor(s)	The floor system is a concrete slab-on-grade.
Foundations	The walls are supported by continuous wall footings.
Cravity System	The gravity system consists of glulam beam framing supported by concrete
Gravity System	pilasters and the concrete tilt-up walls.
Lateral System	Concrete tilt-up shear walls resist the forces in the longitudinal and transverse
Lateral System	directions.

1.1.3 Structural System Visual Condition

Table 1.1-2. Structural System Condition Description of Columbia High School

Structural System	Description
Structural Roof	No visible signs of corrosion, damage, or deterioration.
Structural Floor(s)	No visible signs of corrosion, damage, or deterioration.
Foundations	Unknown.
Gravity System	No visible signs of corrosion, damage, or deterioration.
Lateral System	No visible signs of corrosion, damage, or deterioration.

1.2 Seismic Evaluation Findings

1.2.1 Structural Seismic Deficiencies

The structural seismic deficiencies identified during the Tier 1 evaluation are summarized below. Commentary for each deficiency is also provided based on this evaluation.

Table 1-3. Identified Structural Seismic Deficiencies for White Salmon Valley Columbia High School Metal /Wood Shop

Deficiency	Description
	Interior masonry walls are not connected to diaphragms or doweled into the foundation. Lack of out-of-plane
Load Path	anchorage. Addition of post-installed connection to the diaphragm for in-plane and out-of-plane forces and of
	connection to the foundation may be appropriate.
Mezzanines	No clear anchorage to the interior masonry walls. Post-installed anchorage of mezzanine diaphragm to masonry
Mezzannes	walls likely required.
Wall Anaharaga	No out-of-plane wall anchorage. Tension ties, blocking, strapping, and diaphragm nailing are required along
Wall Anchorage	precast concrete walls.
	Precast concrete walls are compliant. However, interior masonry walls are under-reinforced and will likely
Reinforcing Steel	need to be strengthened for in-plane and out-of-plane seismic forces. The addition of FRP and steel
Kennorchig Steel	strongbacks at existing masonry walls or the addition of new shear walls may be appropriate. Further
	investigation is required.
Straight Sheathing	Straight-sheathed diaphragm has an aspect ratio greater than 2-to-1. Installation of plywood sheathing may be
Straight Sheathing	appropriate to mitigate seismic risk.
Precast Wall	Precast wall panels are not directly connected to the foundation. The addition of post-installed connections,
Panels	such as FRP, between wall panels and the foundation may be appropriate. Further investigation is required.
Cindons	Girders supported by walls or pilasters do not have at least two ties securing the anchor bolts. Strengthening of
Girders	the connection through the addition of post-installed anchors may be appropriate to mitigate seismic risk.

1.2.2 Structural Checklist Items Marked as 'U'nknown

Where building structural component seismic adequacy was unknown due to lack of available information or limited observation, the structural checklist items were marked as "unknown". These items require further investigation if definitive determination of compliance or noncompliance is desired. The unknown structural checklist items identified during the Tier 1 evaluation are summarized below. Commentary for each unknown item is also provided based on the evaluation.

Table 1-4. Identified Structural Checklist Items Marked as Unknown for White Salmon Valley Columbia High School Metal /Wood Shop

Unknown Item	Description
	The liquefaction potential of site soils is unknown at this time given available information. Very low
Liquefaction	liquefaction potential is identified per ICOS based on state geologic mapping. Requires further investigation by
	a licensed geotechnical engineer to determine liquefaction potential.
Slope Failure	Requires further investigation by a licensed geotechnical engineer to determine susceptibility to slope failure.
Surface Fault	Requires further investigation by a licensed geotechnical engineer to determine whether site is near locations of
Rupture	expected surface fault ruptures.
	Drawings show alternate roof framing with plywood sheathing over straight sheathing. The roof framing that
Spans	was used could not be visually verified. Further investigation is required to make a final determination on
	compliance and to develop a mitigation recommendation, if necessary.
Diagonally	Drawings show alternate roof framing with plywood sheathing over straight sheathing. The roof framing that
Sheathed and	was used could not be visually verified. Further investigation is required to make a final determination on
Unblocked	compliance and to develop a mitigation recommendation, if necessary.
Diaphragms	compnance and to develop a mitigation recommendation, if necessary.

1.3.1 Nonstructural Seismic Deficiencies

The nonstructural seismic deficiencies identified during the Tier 1 evaluation are summarized below. Commentary for each deficiency is also provided based on this evaluation. Some nonstructural deficiencies may be able to be mitigated by school district staff. Other nonstructural components that require more substantial mitigation may be more appropriately included in a long-term mitigation strategy. Some typical conceptual details for the seismic upgrade of nonstructural components can be found in the FEMA E-74 Excerpts appendix.

Table 1-5. Identified Nonstructural Seismic Deficiencies for White Salmon Valley Columbia High School Metal /Wood Shop							
Deficiency	Description						

The Tier 1 nonstructural seismic evaluation performed for this school building could not confirm nonstructural seismic deficiencies due to limited access for visual observation and/or lack of existing drawings available for review. Please refer to the next page of this report for the list of nonstructural items marked as "unknown" and commentary indicating the need for further investigation or the likelihood of compliance or non-compliance based on the age of construction.

1.3.2 Nonstructural Checklist Items Marked as 'U'nknown

Where building nonstructural component seismic adequacy was unknown due to lack of available information or limited observation, the nonstructural checklist items were marked as "unknown". These items require further investigation if definitive determination of compliance or noncompliance is desired. The unknown nonstructural checklist items identified during the Tier 1 evaluation are summarized below. Commentary for each unknown item is also provided based on the evaluation.

Some nonstructural deficiencies may be able to be mitigated by school district staff. Other nonstructural components that require more substantial mitigation may be more appropriately included in a long-term mitigation strategy. Some typical conceptual details for the seismic upgrade of nonstructural components can be found in the FEMA E-74 Excerpts appendix.

Table 1-6. Identified Nonstructural Checklist Items Marked as Unknown for White Salmon Valley Columbia High School Metal /Wood Shop

Under the second the second	Description							
Unknown Item	Description							
P-3 Drift. HR-not required;	Further investigation is required to verify detailing of rigid cementitious partitions for drift.							
LS-MH; PR-MH.	runci investigation is required to verify detaining of rigid cementitious partitions for drift.							
LF-1 Independent Support.	Further investigation is required to review the support system for light fixtures. All light fixtures in							
HR-not required; LS-MH; PR-	rid ceiling system should have seismic bracing.							
MH.	grid certaing system should have seisinic bracing.							
PCOA-4 Appendages. HR-	Wood parapets. Further investigation is required to verify reinforcing/anchorage of appendages							
MH; LS-MH; PR-LMH.	extending above the main structural building system.							
CF-2 Tall Narrow Contents.	This evaluation item is likely non-compliant, but could not be visually verified. Further field							
HR-not required; LS-H; PR-	investigation is required to make a final determination on compliance. Anchorage is required for							
MH.	all tall narrow contents more than six feet high.							
CF-3 Fall-Prone Contents.	This evaluation item is likely non-compliant, but could not be visually verified. Further field							
	nvestigation is required to make a final determination on compliance. Anchorage is required for							
HR-not required; LS-H; PR-H.	fall-prone contents weighing more than 20 pounds.							
ME 1 Fell Drope Foreignment	This evaluation item is likely non-compliant, but could not be visually verified. Further field							
ME-1 Fall-Prone Equipment.	investigation is required to make a final determination on compliance. Anchorage is required for							
HR-not required; LS-H; PR-H.	fall-prone equipment weighing more than 20 pounds.							
ME-2 In-Line Equipment. HR-	This evaluation item is unknown and could not be visually verified. Further investigation is							
not required; LS-H; PR-H.	required to review vertical support and lateral bracing of equipment.							
ME-3 Tall Narrow Equipment.	This evaluation item is likely non-compliant, but could not be visually verified. Further field							
HR-not required; LS-H; PR-	investigation is required to make a final determination on compliance. Anchorage is required for							
MH.	all tall narrow equipment more than six feet high.							

Photos:



Figure 1-1. Columbia High School Shop - Northwest Exterior



Figure 1-2. Columbia High School Shop - Northeast Exterior



Figure 1-3. Columbia High School Shop - South Exterior



Figure 1-4. Columbia High School Shop - Southeast Exterior

White Salmon Valley, Columbia High School, Metal /Wood Shop 17-2 Collapse Prevention Basic Configuration Checklist

Building record drawings have been reviewed, when available, and a non-destructive field investigation has been performed for the subject building. Each of the required checklist items are marked Compliant (C), Noncompliant (NC), Not Applicable (N/A), or Unknown (U). Items marked Compliant indicate conditions that satisfy the performance objective, whereas items marked Noncompliant or Unknown indicate conditions that do not. Certain statements might not apply to the building being evaluated.

Low Seismicity

Building System - General

EVALUATION ITEM	EVALUATION STATEMENT	С	NC	N/A	U	COMMENT
Load Path	The structure contains a complete, well-defined load path, including structural elements and connections, that serves to transfer the inertial forces associated with the mass of all elements of the building to the foundation. (Tier 2: Sec. 5.4.1.1; Commentary: Sec. A.2.1.10)		X			Interior masonry walls are not connected to diaphragms or doweled into the foundation. Lack of out-of-plane anchorage. Addition of post-installed connection to the diaphragm for in-plane and out-of-plane forces and of connection to the foundation may be appropriate.
Adjacent Buildings	The clear distance between the building being evaluated and any adjacent building is greater than 0.25% of the height of the shorter building in low seismicity, 0.5% in moderate seismicity, and 1.5% in high seismicity. (Tier 2: Sec. 5.4.1.2; Commentary: Sec. A.2.1.2)	X				
Mezzanines	Interior mezzanine levels are braced independently from the main structure or are anchored to the seismic-force-resisting elements of the main structure. (Tier 2: Sec. 5.4.1.3; Commentary: Sec. A.2.1.3)		X			No clear anchorage to the interior masonry walls. Post-installed anchorage of mezzanine diaphragm to masonry walls likely required.

Building System - Building Configuration

EVALUATION ITEM	EVALUATION STATEMENT	С	NC	N/A	U	COMMENT
	The sum of the shear strengths of the seismic-					
	force-resisting system in any story in each					
Weak Story	direction is not less than 80% of the strength in			X		
	the adjacent story above. (Tier 2: Sec. 5.4.2.1;					
	Commentary: Sec. A.2.2.2)					

Soft Story	The stiffness of the seismic-force-resisting system in any story is not less than 70% of the seismic-force-resisting system stiffness in an adjacent story above or less than 80% of the average seismic-force-resisting system stiffness of the three stories above. (Tier 2: Sec. 5.4.2.2; Commentary: Sec. A.2.2.3)		X	
Vertical Irregularities	All vertical elements in the seismic-forceresisting system are continuous to the foundation. (Tier 2: Sec. 5.4.2.3; Commentary: Sec. A.2.2.4)	X		
Geometry	There are no changes in the net horizontal dimension of the seismic-force-resisting system of more than 30% in a story relative to adjacent stories, excluding one-story penthouses and mezzanines. (Tier 2: Sec. 5.4.2.4; Commentary: Sec. A.2.2.5)		X	
Mass	There is no change in effective mass of more than 50% from one story to the next. Light roofs, penthouses, and mezzanines need not be considered. (Tier 2: Sec. 5.4.2.5; Commentary: Sec. A.2.2.6)		X	
Torsion	The estimated distance between the story center of mass and the story center of rigidity is less than 20% of the building width in either plan dimension. (Tier 2: Sec. 5.4.2.6; Commentary: Sec. A.2.2.7)	X		

Moderate Seismicity (Complete the Following Items in Addition to the Items for Low Seismicity)

Geologic Site Hazards

EVALUATION ITEM	EVALUATION STATEMENT	С	NC	N/A	U	COMMENT
Liquefaction	Liquefaction-susceptible, saturated, loose granular soils that could jeopardize the building's seismic performance do not exist in the foundation soils at depths within 50 ft (15.2 m) under the building. (Tier 2: Sec. 5.4.3.1; Commentary: Sec. A.6.1.1)				X	The liquefaction potential of site soils is unknown at this time given available information. Very low liquefaction potential is identified per ICOS based on state geologic mapping. Requires further investigation by a licensed geotechnical engineer to determine liquefaction potential.
Slope Failure	The building site is located away from potential earthquake-induced slope failures or rockfalls so that it is unaffected by such failures or is capable of accommodating any predicted movements without failure. (Tier 2: Sec. 5.4.3.1; Commentary: Sec. A.6.1.2)				X	Requires further investigation by a licensed geotechnical engineer to determine susceptibility to slope failure.

Surface Fault Rupture	Surface fault rupture and surface displacement at the building site are not anticipated. (Tier 2: Sec. 5.4.3.1; Commentary: Sec. A.6.1.3)		X	Requires further investigation by a licensed geotechnical engineer to determine whether site is near locations of expected
				surface fault ruptures.

$\label{lem:high-seismicity} High \ Seismicity \ ({\tt Complete} \ {\tt the Following} \ {\tt Items} \ {\tt in Addition} \ {\tt to} \ {\tt the Items} \ {\tt for Low} \ {\tt and Moderate} \ {\tt Seismicity})$

Foundation Configuration

EVALUATION ITEM	EVALUATION STATEMENT	С	NC	N/A	U	COMMENT
Overturning	The ratio of the least horizontal dimension of the seismic-force-resisting system at the foundation level to the building height (base/height) is greater than 0.6Sa. (Tier 2: Sec. 5.4.3.3; Commentary: Sec. A.6.2.1)	X				
Ties Between Foundation Elements	The foundation has ties adequate to resist seismic forces where footings, piles, and piers are not restrained by beams, slabs, or soils classified as Site Class A, B, or C. (Tier 2: Sec. 5.4.3.4; Commentary: Sec. A.6.2.2)			X		

17-28 Collapse Prevention Structural Checklist for Building Types PC1 and PC1a

Building record drawings have been reviewed, when available, and a non-destructive field investigation has been performed for the subject building. Each of the required checklist items are marked Compliant (C), Noncompliant (NC), Not Applicable (N/A), or Unknown (U). Items marked Compliant indicate conditions that satisfy the performance objective, whereas items marked Noncompliant or Unknown indicate conditions that do not. Certain statements might not apply to the building being evaluated.

Low Seismicity

Connections

EVALUATION ITEM	EVALUATION STATEMENT	С	NC	N/A	U	COMMENT
Wall Anchorage	Exterior concrete or masonry walls that are dependent on the diaphragm for lateral support are anchored for out-of-plane forces at each diaphragm level with steel anchors, reinforcing dowels, or straps that are developed into the diaphragm. Connections have strength to resist the connection force calculated in the Quick Check procedure of Section 4.4.3.7. (Tier 2: Sec. 5.7.1.1; Commentary: Sec. A.5.1.1)		X			No out-of-plane wall anchorage. Tension ties, blocking, strapping, and diaphragm nailing are required along precast concrete walls.

Moderate Seismicity (Complete the Following Items in Addition to the Items for Low Seimicity)

Seismic-Force-Resisting System

EVALUATION ITEM	EVALUATION STATEMENT	С	NC	N/A	U	COMMENT
Redundancy	The number of lines of shear walls in each principal direction is greater than or equal to 2. (Tier 2: Sec. 5.5.1.1; Commentary: Sec. A.3.2.1.1)	X				
Wall Shear Stress Check	The shear stress in the precast panels, calculated using the Quick Check procedure of Section 4.4.3.3, is less than the greater of 100 lb/in.2 (0.69 MPa) or 2√f c. (Tier 2: Sec. 5.5.3.1.1; Commentary: Sec. A.3.2.3.1)	X				
Reinforcing Steel	The ratio of reinforcing steel area to gross concrete area is not less than 0.0012 in the vertical direction and 0.0020 in the horizontal direction. (Tier 2: Sec. 5.5.3.1.3; Commentary: Sec. A.3.2.3.2)		Х			Precast concrete walls are compliant. However, interior masonry walls are underreinforced and will likely need to be strengthened for in-plane and out-of-plane seismic forces. The addition of FRP and steel strongbacks at existing masonry walls or the addition of new shear walls may be appropriate. Further investigation is required.

Wall Thickness	Thicknesses of bearing walls are not less than			
	1/40 the unsupported height or length, whichever	v		
wan inickness	is shorter, nor less than 4 in. (101 mm). (Tier 2:	Λ		
	Sec. 5.5.3.1.2; Commentary: Sec. A.3.2.3.5)			

Diaphragms

EVALUATION ITEM	EVALUATION STATEMENT	С	NC	N/A	U	COMMENT
Topping Slab	Precast concrete diaphragm elements are interconnected by a continuous reinforced concrete topping slab with a minimum thickness of 2 in. (51 mm). (Tier 2: Sec. 5.6.4; Commentary: Sec. A.4.5.1)			X		

Connections

EVALUATION ITEM	EVALUATION STATEMENT	С	NC	N/A	U	COMMENT
Wood Ledgers	The connection between the wall panels and the diaphragm does not induce cross-grain bending or tension in the wood ledgers. (Tier 2: Sec. 5.7.1.3; Commentary: Sec. A.5.1.2)			X		
Transfer to Shear Walls	Diaphragms are connected for transfer of seismic forces to the shear walls. (Tier 2: Sec. 5.7.2; Commentary: Sec. A.5.2.1)	X				
Topping Slab to Walls or Frames	Reinforced concrete topping slabs that interconnect the precast concrete diaphragm elements are doweled for transfer of forces into the shear wall or frame elements. (Tier 2: Sec. 5.7.2; Commentary: Sec. A.5.2.3)			X		
Girder-Column Conncection	There is a positive connection using plates, connection hardware, or straps between the girder and the column support. (Tier 2: Sec. 5.7.4.1; Commentary: Sec. A.5.4.1)	X				

High Seismicity (Complete the Following Items in Addition to the Items for Low and Moderate Seismicity)

Seismic-Force-Resisting System

EVALUATION ITEM	EVALUATION STATEMENT	С	NC	N/A	U	COMMENT
Deflection Compatibility for Rigid Diaphragms	Secondary components have the shear capacity to develop the flexural strength of the components. (Tier 2: Sec. 5.5.2.5.2; Commentary: Sec. A.3.1.6.2)	X				
Wall Openings	The total width of openings along any perimeter wall line constitutes less than 75% of the length of any perimeter wall when the wall piers have aspect ratios of less than 2-to-1. (Tier 2: Sec. 5.5.3.3.1; Commentary: Sec. A.3.2.3.3)	X				

Diaphragms

EVALUATION ITEM	EVALUATION STATEMENT	С	NC	N/A	U	COMMENT
Cross Ties in Flexible Diaphragms	There are continuous cross ties between diaphragm chords. (Tier 2: Sec. 5.6.1.2; Commentary: Sec. A.4.1.2)	X				

Straight Sheathing	All straight-sheathed diaphragms have aspect ratios less than 2-to-1 in the direction being considered. (Tier 2: Sec. 5.6.2; Commentary: Sec. A.4.2.1)		X		Straight-sheathed diaphragm has an aspect ratio greater than 2-to-1. Installation of plywood sheathing may be appropriate to mitigate seismic risk.
Spans	All wood diaphragms with spans greater than 24 ft (7.3 m) consist of wood structural panels or diagonal sheathing. (Tier 2: Sec. 5.6.2; Commentary: Sec. A.4.2.2)			X	Drawings show alternate roof framing with plywood sheathing over straight sheathing. The roof framing that was used could not be visually verified. Further investigation is required to make a final determination on compliance and to develop a mitigation recommendation, if necessary.
Diagonally Sheathed and Unblocked Diaphragms	All diagonally sheathed or unblocked wood structural panel diaphragms have horizontal spans less than 40 ft (12.2 m) and aspect ratios less than or equal to 4 to-1. (Tier 2: Sec. 5.6.2; Commentary: Sec. A.4.2.3)			X	Drawings show alternate roof framing with plywood sheathing over straight sheathing. The roof framing that was used could not be visually verified. Further investigation is required to make a final determination on compliance and to develop a mitigation recommendation, if necessary.
Other Diaphragms	Diaphragms do not consist of a system other than wood, metal deck, concrete, or horizontal bracing. (Tier 2: Sec. 5.6.5; Commentary: Sec. A.4.7.1)	X			

Connections

EVALUATION ITEM	EVALUATION STATEMENT	С	NC	N/A	U	COMMENT
Minimum Number of Wall Anchors Per Panel	There are at least two anchors connecting each precast wall panel to the diaphragm elements. (Tier 2: Sec. 5.7.1.4; Commentary: Sec. A.5.1.3)	X				
Precast Wall Panels	Precast wall panels are connected to the foundation. (Tier 2: Sec. 5.7.3.4; Commentary: Sec. A.5.3.6)		X			Precast wall panels are not directly connected to the foundation. The addition of post-installed connections, such as FRP, between wall panels and the foundation may be appropriate. Further investigation is required.

Uplift at Pile Caps	Pile caps have top reinforcement, and piles are anchored to the pile caps. (Tier 2: Sec. 5.7.3.5; Commentary: Sec. A.5.3.8)		X	
Girders	Girders supported by walls or pilasters have at least two ties securing the anchor bolts unless provided with independent stiff wall anchors with strength to resist the connection force calculated in the Quick Check procedure of Section 4.4.3.7. (Tier 2: Sec. 5.7.4.2; Commentary: Sec. A.5.4.2)	X		Girders supported by walls or pilasters do not have at least two ties securing the anchor bolts. Strengthening of the connection through the addition of post-installed anchors may be appropriate to mitigate seismic risk.

White Salmon Valley, Columbia High School, Metal /Wood Shop 17-38 Nonstructural Checklist

Notes:

C = Compliant, NC = Noncompliant, N/A = Not Applicable, and U = Unknown.

Performance Level: HR = Hazards Reduced, LS = Life Safety, and PR = Position Retention.

Level of Seismicity: L = Low, M = Moderate, and H = High

Life Safety Systems

EVALUATION ITEM	EVALUATION STATEMENT	С	NC	N/A	U	COMMENT
LSS-1 Fire Suppression Piping. HR-not required; LS-LMH; PR-LMH.	Fire suppression piping is anchored and braced in accordance with NFPA-13. (Tier 2: Sec. 13.7.4; Commentary: Sec. A.7.13.1)			X		No fire sprinklers
LSS-2 Flexible Couplings. HR-not required; LS-LMH; PR- LMH.	Fire suppression piping has flexible couplings in accordance with NFPA-13. (Tier 2: Sec. 13.7.4; Commentary: Sec. A.7.13.2)			X		
LSS-3 Emergency Power. HR-not required; LS-LMH; PR-LMH.	Equipment used to power or control Life Safety systems is anchored or braced. (Tier 2: Sec. 13.7.7; Commentary: Sec. A.7.12.1)			X		
LSS-4 Stair and Smoke Ducts. HR-not required; LS-LMH; PR-LMH.	Stair pressurization and smoke control ducts are braced and have flexible connections at seismic joints. (Tier 2: Sec. 13.7.6; Commentary: Sec. A.7.14.1)			X		
LSS-5 Sprinkler Ceiling Clearance. HR-not required; LS-MH; PR- MH.	Penetrations through panelized ceilings for fire suppression devices provide clearances in accordance with NFPA-13. (Tier 2: Sec. 13.7.4; Commentary: Sec. A.7.13.3)			X		
LSS-6 Emergency Lighting. HR-not required; LS-not required; PR-LMH	Emergency and egress lighting equipment is anchored or braced. (Tier 2: Sec. 13.7.9; Commentary: Sec. A.7.3.1)			X		Non-applicable due to ASCE 41 Performance Level: "Life Safety (LS)"

Hazardous Materials

EVALUATION ITEM	EVALUATION STATEMENT	С	NC	N/A	U	COMMENT
HM-1 Hazardous Material Equipment. HR- LMH; LS-LMH; PR- LMH.	Equipment mounted on vibration isolators and containing hazardous material is equipped with restraints or snubbers. (Tier 2: Sec. 13.7.1; Commentary: Sec. A.7.12.2)			X		
HM-2 Hazardous Material Storage. HR- LMH; LS-LMH; PR- LMH.	Breakable containers that hold hazardous material, including gas cylinders, are restrained by latched doors, shelf lips, wires, or other methods. (Tier 2: Sec. 13.8.3; Commentary: Sec. A.7.15.1)			X		
HM-3 Hazardous Material Distribution. HR-MH; LS-MH; PR- MH.	Piping or ductwork conveying hazardous materials is braced or otherwise protected from damage that would allow hazardous material release. (Tier 2: Sec. 13.7.3, 13.7.5; Commentary: Sec. A.7.13.4)			X		

HM-4 Shutoff Valves. HR-MH; LS-MH; PR- MH.	Piping containing hazardous material, including natural gas, has shutoff valves or other devices to limit spills or leaks. (Tier 2: Sec. 13.7.3, 13.7.5; Commentary: Sec. A.7.13.3)		X		
HM-5 Flexible Couplings. HR-LMH; LS-LMH; PR-LMH.	Hazardous material ductwork and piping, including natural gas piping, have flexible couplings. (Tier 2: Sec. 13.7.3, 13.7.5; Commentary: Sec. A.7.15.4)		X		
HM-6 Piping or Ducts Crossing Seismic Joints. HR-MH; LS-MH; PR- MH.	Piping or ductwork carrying hazardous material that either crosses seismic joints or isolation planes or is connected to independent structures has couplings or other details to accommodate the relative seismic displacements. (Tier 2: Sec. 13.7.3, 13.7.5, 13.7.6; Commentary: Sec. A.7.13.6)		X		

Partitions

rartitions						
EVALUATION ITEM	EVALUATION STATEMENT	C	NC	N/A	U	COMMENT
P-1 Unreinforced Masonry. HR-LMH; LS- LMH; PR-LMH.	Unreinforced masonry or hollow-clay tile partitions are braced at a spacing of at most 10 ft (3.0 m) in Low or Moderate Seismicity, or at most 6 ft (1.8 m) in High Seismicity. (Tier 2: Sec. 13.6.2; Commentary: Sec. A.7.1.1)			X		
P-2 Heavy Partitions Supported by Ceilings. HR-LMH; LS-LMH; PR- LMH.	The tops of masonry or hollow-clay tile partitions are not laterally supported by an integrated ceiling system. (Tier 2: Sec. 13.6.2; Commentary: Sec. A.7.2.1)	X				
P-3 Drift. HR-not required; LS-MH; PR- MH.	Rigid cementitious partitions are detailed to accommodate the following drift ratios: in steel moment frame, concrete moment frame, and wood frame buildings, 0.02; in other buildings, 0.005. (Tier 2: Sec. 13.6.2; Commentary: Sec. A.7.1.2)				X	Further investigation is required to verify detailing of rigid cementitious partitions for drift.
P-4 Light Partitions Supported by Ceilings. HR-not required; LS-not required; PR-MH.	The tops of gypsum board partitions are not laterally supported by an integrated ceiling system. (Tier 2: Sec. 13.6.2; Commentary: Sec. A.7.2.1)			X		Non-applicable due to ASCE 41 Performance Level: "Life Safety (LS)"
P-5 Structural Separations. HR-not required; LS-not required; PR-MH.	Partitions that cross structural separations have seismic or control joints. (Tier 2: Sec. 13.6.2; Commentary: Sec. A.7.1.3)			X		Non-applicable due to ASCE 41 Performance Level: "Life Safety (LS)"
P-6 Tops. HR-not required; LS-not required; PR-MH.	The tops of ceiling-high framed or panelized partitions have lateral bracing to the structure at a spacing equal to or less than 6 ft (1.8 m). (Tier 2: Sec. 13.6.2; Commentary: Sec. A.7.1.4)			X		Non-applicable due to ASCE 41 Performance Level: "Life Safety (LS)"

Ceilings

EVALUATION ITEM	EVALUATION STATEMENT	С	NC	N/A	U	COMMENT
C-1 Suspended Lath and Plaster. HR-H; LS-MH; PR-LMH.	Suspended lath and plaster ceilings have attachments that resist seismic forces for every 12 ft2 (1.1 m2) of area. (Tier 2: Sec. 13.6.4; Commentary: Sec. A.7.2.3)			X		
C-2 Suspended Gypsum Board. HR-not required; LS-MH; PR-LMH.	Suspended gypsum board ceilings have attachments that resist seismic forces for every 12 ft2 (1.1 m2) of area. (Tier 2: Sec. 13.6.4; Commentary: Sec. A.7.2.3)			X		
C-3 Integrated Ceilings. HR-not required; LS-not required; PR-MH.	Integrated suspended ceilings with continuous areas greater than 144 ft2 (13.4 m2) and ceilings of smaller areas that are not surrounded by restraining partitions are laterally restrained at a spacing no greater than 12 ft (3.6 m) with members attached to the structure above. Each restraint location has a minimum of four diagonal wires and compression struts, or diagonal members capable of resisting compression. (Tier 2: Sec. 13.6.4; Commentary: Sec. A.7.2.2)			X		Non-applicable due to ASCE 41 Performance Level: "Life Safety (LS)"
C-4 Edge Clearance. HR- not required; LS-not required; PR-MH.	The free edges of integrated suspended ceilings with continuous areas greater than 144 ft2 (13.4 m2) have clearances from the enclosing wall or partition of at least the following: in Moderate Seismicity, 1/2 in. (13 mm); in High Seismicity, 3/4 in. (19 mm). (Tier 2: Sec. 13.6.4; Commentary: Sec. A.7.2.4)			X		Non-applicable due to ASCE 41 Performance Level: "Life Safety (LS)"
C-5 Continuity Across Structure Joints. HR-not required; LS-not required; PR-MH.	The ceiling system does not cross any seismic joint and is not attached to multiple independent structures. (Tier 2: Sec. 13.6.4; Commentary: Sec. A.7.2.5)			X		Non-applicable due to ASCE 41 Performance Level: "Life Safety (LS)"
C-6 Edge Support. HR- not required; LS-not required; PR-H.	The free edges of integrated suspended ceilings with continuous areas greater than 144 ft2 (13.4 m2) are supported by closure angles or channels not less than 2 in. (51 mm) wide. (Tier 2: Sec. 13.6.4; Commentary: Sec. A.7.2.6)			X		Non-applicable due to ASCE 41 Performance Level: "Life Safety (LS)"
C-7 Seismic Joints. HR- not required; LS-not required; PR-H.	Acoustical tile or lay-in panel ceilings have seismic separation joints such that each continuous portion of the ceiling is no more than 2,500 ft2 (232.3 m2) and has a ratio of long-to-short dimension no more than 4-to-1. (Tier 2: Sec. 13.6.4; Commentary: Sec. A.7.2.7)			X		Non-applicable due to ASCE 41 Performance Level: "Life Safety (LS)"

Light Fixtures

EVALUATION ITEM	EVALUATION STATEMENT	С	NC	N/A	U	COMMENT
LF-1 Independent Support. HR-not required; LS-MH; PR- MH.	Light fixtures that weigh more per square foot than the ceiling they penetrate are supported independent of the grid ceiling suspension system by a minimum of two wires at diagonally opposite corners of each fixture. (Tier 2: Sec. 13.6.4, 13.7.9; Commentary: Sec. A.7.3.2)				X	Further investigation is required to review the support system for light fixtures. All light fixtures in grid ceiling system should have seismic bracing.
LF-2 Pendant Supports. HR-not required; LS-not required; PR-H.	Light fixtures on pendant supports are attached at a spacing equal to or less than 6 ft. Unbraced suspended fixtures are free to allow a 360-degree range of motion at an angle not less than 45 degrees from horizontal without contacting adjacent components. Alternatively, if rigidly supported and/or braced, they are free to move with the structure to which they are attached without damaging adjoining components. Additionally, the connection to the structure is capable of accommodating the movement without failure. (Tier 2: Sec. 13.7.9; Commentary: Sec. A.7.3.3)			X		Non-applicable due to ASCE 41 Performance Level: "Life Safety (LS)"
LF-3 Lens Covers. HR- not required; LS-not required; PR-H.	Lens covers on light fixtures are attached with safety devices. (Tier 2: Sec. 13.7.9; Commentary: Sec. A.7.3.4)			X		Non-applicable due to ASCE 41 Performance Level: "Life Safety (LS)"

Cladding and Glazing

EVALUATION ITEM	EVALUATION STATEMENT	С	NC	N/A	U	COMMENT
CG-1 Cladding Anchors. HR-MH; LS-MH; PR- MH.	Cladding components weighing more than 10 lb/ft2 (0.48 kN/m2) are mechanically anchored to the structure at a spacing equal to or less than the following: for Life Safety in Moderate Seismicity, 6 ft (1.8 m); for Life Safety in High Seismicity and for Position Retention in any seismicity, 4 ft (1.2 m) (Tier 2: Sec. 13.6.1; Commentary: Sec. A.7.4.1)			X		No cladding
CG-2 Cladding Isolation. HR-not required; LS- MH; PR-MH.	For steel or concrete moment-frame buildings, panel connections are detailed to accommodate a story drift ratio by the use of rods attached to framing with oversize holes or slotted holes of at least the following: for Life Safety in Moderate Seismicity, 0.01; for Life Safety in High Seismicity and for Position Retention in any seismicity, 0.02, and the rods have a length-to-diameter ratio of 4.0 or less. (Tier 2: Sec. 13.6.1; Commentary: Sec. A.7.4.3)			X		No cladding

CG-3 Multi-Story Panels. HR-MH; LS-MH; PR- MH.	For multi-story panels attached at more than one floor level, panel connections are detailed to accommodate a story drift ratio by the use of rods attached to framing with oversize holes or slotted holes of at least the following: for Life Safety in Moderate Seismicity, 0.01; for Life Safety in High Seismicity and for Position Retention in any seismicity, 0.02, and the rods have a length-to-diameter ratio of 4.0 or less. (Tier 2: Sec. 13.6.1; Commentary: Sec. A.7.4.4)		X	No cladding
CG-4 Threaded Rods. HR-not required; LS- MH; PR-MH.	Threaded rods for panel connections detailed to accommodate drift by bending of the rod have a length-to-diameter ratio greater than 0.06 times the story height in inches for Life Safety in Moderate Seismicity and 0.12 times the story height in inches for Life Safety in High Seismicity and Position Retention in any seismicity. (Tier 2: Sec. 13.6.1; Commentary: Sec. A.7.4.9)		X	No cladding
CG-5 Panel Connections. HR-MH; LS-MH; PR- MH.	Cladding panels are anchored out of plane with a minimum number of connections for each wall panel, as follows: for Life Safety in Moderate Seismicity, 2 connections; for Life Safety in High Seismicity and for Position Retention in any seismicity, 4 connections. (Tier 2: Sec. 13.6.1.4; Commentary: Sec. A.7.4.5)		X	No cladding
CG-6 Bearing Connections. HR-MH; LS-MH; PR-MH.	Where bearing connections are used, there is a minimum of two bearing connections for each cladding panel. (Tier 2: Sec. 13.6.1.4; Commentary: Sec. A.7.4.6)		X	No cladding
CG-7 Inserts. HR-MH; LS-MH; PR-MH.	Where concrete cladding components use inserts, the inserts have positive anchorage or are anchored to reinforcing steel. (Tier 2: Sec. 13.6.1.4; Commentary: Sec. A.7.4.7)		X	No cladding
CG-8 Overhead Glazing. HR-not required; LS- MH; PR-MH.	Glazing panes of any size in curtain walls and individual interior or exterior panes more than 16 ft2 (1.5 m2) in area are laminated annealed or laminated heat-strengthened glass and are detailed to remain in the frame when cracked. (Tier 2: Sec. 13.6.1.5; Commentary: Sec. A.7.4.8)		X	No cladding

Masonry Veneer

EVALUATION ITEM	EVALUATION STATEMENT	С	NC	N/A	U	COMMENT
M-1 Ties. HR-not required; LS-LMH; PR- LMH.	Masonry veneer is connected to the backup with corrosion-resistant ties. There is a minimum of one tie for every 2-2/3 ft2 (0.25 m2), and the ties have spacing no greater than the following: for Life Safety in Low or Moderate Seismicity, 36 in. (914 mm); for Life Safety in High Seismicity and for Position Retention in any seismicity, 24 in. (610 mm). (Tier 2: Sec. 13.6.1.2; Commentary: Sec. A.7.5.1)			X		No masonry veneer
M-2 Shelf Angles. HR- not required; LS-LMH; PR-LMH.	Masonry veneer is supported by shelf angles or other elements at each floor above the ground floor. (Tier 2: Sec. 13.6.1.2; Commentary: Sec. A.7.5.2)			X		No masonry veneer
M-3 Weakened Planes. HR-not required; LS- LMH; PR-LMH.	Masonry veneer is anchored to the backup adjacent to weakened planes, such as at the locations of flashing. (Tier 2: Sec. 13.6.1.2; Commentary: Sec. A.7.5.3)			X		No masonry veneer
M-4 Unreinforced Masonry Backup. HR- LMH; LS-LMH; PR- LMH.	There is no unreinforced masonry backup. (Tier 2: Sec. 13.6.1.1, 13.6.1.2; Commentary: Sec. A.7.7.2)			X		No masonry veneer
M-5 Stud Tracks. HR-not required; LS-MH; PR- MH.	For veneer with coldformed steel stud backup, stud tracks are fastened to the structure at a spacing equal to or less than 24 in. (610 mm) on center. (Tier 2: Sec. 13.6.1.1, 13.6.1.2; Commentary: Sec. A.7.6.)			X		No masonry veneer
M-6 Anchorage. HR-not required; LS-MH; PR- MH.	For veneer with concrete block or masonry backup, the backup is positively anchored to the structure at a horizontal spacing equal to or less than 4 ft along the floors and roof. (Tier 2: Sec. 13.6.1.1, 13.6.1.2; Commentary: Sec. A.7.7.1)			X		No masonry veneer
M-7 Weep Holes. HR-not required; LS-not required; PR-MH.	In veneer anchored to stud walls, the veneer has functioning weep holes and base flashing. (Tier 2: Sec. 13.6.1.2; Commentary: Sec. A.7.5.6)			X		No masonry veneer
M-8 Openings. HR-not required; LS-not required; PR-MH.	For veneer with cold-formed-steel stud backup, steel studs frame window and door openings. (Tier 2: Sec. 13.6.1.1, 13.6.1.2; Commentary: Sec. A.7.6.2)			X		No masonry veneer

Parapets, Cornices, Ornamentation, and Appendages

EVALUATION ITEM	EVALUATION STATEMENT	С	NC	N/A	U	COMMENT
PCOA-1 URM Parapets or Cornices. HR-LMH; LS-LMH; PR-LMH.	Laterally unsupported unreinforced masonry parapets or cornices have height-tothickness ratios no greater than the following: for Life Safety in Low or Moderate Seismicity, 2.5; for Life Safety in High Seismicity and for Position Retention in any seismicity, 1.5. (Tier 2: Sec. 13.6.5; Commentary: Sec. A.7.8.1)			X		

PCOA-2 Canopies. HR-not required; LS-LMH; PR-LMH.	1		X		
PCOA-3 Concrete Parapets. HR-H; LS-MH; PR-LMH.	Concrete parapets with height-to-thickness ratios greater than 2.5 have vertical reinforcement. (Tier 2: Sec. 13.6.5; Commentary: Sec. A.7.8.3)		X		
PCOA-4 Appendages. HR-MH; LS-MH; PR- LMH.	Cornices, parapets, signs, and other ornamentation or appendages that extend above the highest point of anchorage to the structure or cantilever from components are reinforced and anchored to the structural system at a spacing equal to or less than 6 ft (1.8 m). This evaluation statement item does not apply to parapets or cornices covered by other evaluation statements. (Tier 2: Sec. 13.6.6; Commentary: Sec. A.7.8.4)			X	Wood parapets. Further investigation is required to verify reinforcing/anchorage of appendages extending above the main structural building system.

Masonry Chimneys

EVALUATION ITEM	EVALUATION STATEMENT	С	NC	N/A	U	COMMENT
MC-1 URM Chimneys. HR-LMH; LS-LMH; PR- LMH.	Unreinforced masonry chimneys extend above the roof surface no more than the following: for Life Safety in Low or Moderate Seismicity, 3 times the least dimension of the chimney; for Life Safety in High Seismicity and for Position Retention in any seismicity, 2 times the least dimension of the chimney. (Tier 2: Sec. 13.6.7; Commentary: Sec. A.7.9.1)			X		
MC-2 Anchorage. HR- LMH; LS-LMH; PR- LMH.	Masonry chimneys are anchored at each floor level, at the topmost ceiling level, and at the roof. (Tier 2: Sec. 13.6.7; Commentary: Sec. A.7.9.2)			X		

Stairs

EVALUATION ITEM	EVALUATION STATEMENT	С	NC	N/A	U	COMMENT
S-1 Stair Enclosures. HR-not required; LS- LMH; PR-LMH.	Hollow-clay tile or unreinforced masonry walls around stair enclosures are restrained out of plane and have height-to-thickness ratios not greater than the following: for Life Safety in Low or Moderate Seismicity, 15-to-1; for Life Safety in High Seismicity and for Position Retention in any seismicity, 12-to-1. (Tier 2: Sec. 13.6.2, 13.6.8; Commentary: Sec. A.7.10.1)			X		No stairs

	The connection between the stairs and the			
S-2 Stair Details. HR-not required; LS-LMH; PR-LMH.	structure does not rely on post-installed anchors in concrete or masonry, and the stair details are capable of accommodating the drift calculated		X	No stairs

Contents and Furnishings

EVALUATION ITEM	EVALUATION STATEMENT	С	NC	N/A	U	COMMENT
CF-1 Industrial Storage Racks. HR-LMH; LS- MH; PR-MH.	Industrial storage racks or pallet racks more than 12 ft high meet the requirements of ANSI/RMI MH 16.1 as modified by ASCE 7, Chapter 15. (Tier 2: Sec. 13.8.1; Commentary: Sec. A.7.11.1)			X		
CF-2 Tall Narrow Contents. HR-not required; LS-H; PR-MH.	Contents more than 6 ft (1.8 m) high with a height-to-depth or height-to-width ratio greater than 3-to-1 are anchored to the structure or to each other. (Tier 2: Sec. 13.8.2; Commentary: Sec. A.7.11.2)				X	This evaluation item is likely non-compliant, but could not be visually verified. Further field investigation is required to make a final determination on compliance. Anchorage is required for all tall narrow contents more than six feet high.
CF-3 Fall-Prone Contents. HR-not required; LS-H; PR-H.	Equipment, stored items, or other contents weighing more than 20 lb (9.1 kg) whose center of mass is more than 4 ft (1.2 m) above the adjacent floor level are braced or otherwise restrained. (Tier 2: Sec. 13.8.2; Commentary: Sec. A.7.11.3)				X	This evaluation item is likely non-compliant, but could not be visually verified. Further field investigation is required to make a final determination on compliance. Anchorage is required for fall-prone contents weighing more than 20 pounds.
CF-4 Access Floors. HR- not required; LS-not required; PR-MH.	Access floors more than 9 in. (229 mm) high are braced. (Tier 2: Sec. 13.6.10; Commentary: Sec. A.7.11.4)			X		Non-applicable due to ASCE 41 Performance Level: "Life Safety (LS)"
CF-5 Equipment on Access Floors. HR-not required; LS-not required; PR-MH.	Equipment and other contents supported by access floor systems are anchored or braced to the structure independent of the access floor. (Tier 2: Sec. 13.7.7 13.6.10; Commentary: Sec. A.7.11.5)			X		Non-applicable due to ASCE 41 Performance Level: "Life Safety (LS)"

CF-6 Suspended	Items suspended without lateral bracing are free			
Contents. HR-not	to swing from or move with the structure from			Non-applicable due to
required; LS-not	which they are suspended without damaging		X	ASCE 41 Performance
required; PR-H.	themselves or adjoining components. (Tier 2:			Level: "Life Safety (LS)"
required; PK-II.	Sec. 13.8.2; Commentary: Sec. A.7.11.6)			

Mechanical and Electrical Equipment

EVALUATION ITEM	EVALUATION STATEMENT	C	NC	N/A	U	COMMENT
ME-1 Fall-Prone Equipment. HR-not required; LS-H; PR-H.	Equipment weighing more than 20 lb (9.1 kg) whose center of mass is more than 4 ft (1.2 m) above the adjacent floor level, and which is not in-line equipment, is braced. (Tier 2: Sec. 13.7.1 13.7.7; Commentary: Sec. A.7.12.4)				X	This evaluation item is likely non-compliant, but could not be visually verified. Further field investigation is required to make a final determination on compliance. Anchorage is required for fall-prone equipment weighing more than 20 pounds.
ME-2 In-Line Equipment. HR-not required; LS-H; PR-H.	Equipment installed in line with a duct or piping system, with an operating weight more than 75 lb (34.0 kg), is supported and laterally braced independent of the duct or piping system. (Tier 2: Sec. 13.7.1; Commentary: Sec. A.7.12.5)				X	This evaluation item is unknown and could not be visually verified. Further investigation is required to review vertical support and lateral bracing of equipment.
ME-3 Tall Narrow Equipment. HR-not required; LS-H; PR-MH.	Equipment more than 6 ft (1.8 m) high with a height-to-depth or height-to-width ratio greater than 3-to-1 is anchored to the floor slab or adjacent structural walls. (Tier 2: Sec. 13.7.1 13.7.7; Commentary: Sec. A.7.12.6)				X	This evaluation item is likely non-compliant, but could not be visually verified. Further field investigation is required to make a final determination on compliance. Anchorage is required for all tall narrow equipment more than six feet high.
	Mechanically operated doors are detailed to operate at a story drift ratio of 0.01. (Tier 2: Sec. 13.6.9; Commentary: Sec. A.7.12.7)			X		Non-applicable due to ASCE 41 Performance Level: "Life Safety (LS)"
ME-5 Suspended Equipment. HR-not required; LS-not required; PR-H.	Equipment suspended without lateral bracing is free to swing from or move with the structure from which it is suspended without damaging itself or adjoining components. (Tier 2: Sec. 13.7.1, 13.7.7; Commentary: Sec. A.7.12.8)			X		Non-applicable due to ASCE 41 Performance Level: "Life Safety (LS)"
	Equipment mounted on vibration isolators is equipped with horizontal restraints or snubbers and with vertical restraints to resist overturning. (Tier 2: Sec. 13.7.1; Commentary: Sec. A.7.12.9)			X		Non-applicable due to ASCE 41 Performance Level: "Life Safety (LS)"

ME-7 Heavy Equipment. HR-not required; LS-not required; PR-H.	Leguinment weighing more than $A00 \text{ lb } (181 \text{ A})$		X	Non-applicable due to ASCE 41 Performance Level: "Life Safety (LS)"
ME-8 Electrical Equipment. HR-not required; LS-not required; PR-H.	Electrical equipment is laterally braced to the structure. (Tier 2: Sec. 13.7.7; Commentary: Sec. A.7.12.11)		X	Non-applicable due to ASCE 41 Performance Level: "Life Safety (LS)"
ME-9 Conduit Couplings. HR-not required; LS-not required; PR-H.	Conduit greater than 2.5 in. (64 mm) trade size that is attached to panels, cabinets, or other equipment and is subject to relative seismic displacement has flexible couplings or connections. (Tier 2: Sec. 13.7.8; Commentary: Sec. A.7.12.12)		X	Non-applicable due to ASCE 41 Performance Level: "Life Safety (LS)"

Piping

EVALUATION ITEM	EVALUATION STATEMENT	С	NC	N/A	U	COMMENT
	Fluid and gas piping has flexible couplings. (Tier 2: Sec. 13.7.3, 13.7.5; Commentary: Sec. A.7.13.2)			X		Non-applicable due to ASCE 41 Performance Level: "Life Safety (LS)"
PP-2 Fluid and Gas Piping. HR-not required; LS-not required; PR-H.	Fluid and gas piping is anchored and braced to the structure to limit spills or leaks. (Tier 2: Sec. 13.7.3, 13.7.5; Commentary: Sec. A.7.13.4)			X		Non-applicable due to ASCE 41 Performance Level: "Life Safety (LS)"
PP-3 C-Clamps. HR-not required; LS-not required; PR-H.	One-sided C-clamps that support piping larger than 2.5 in. (64 mm) in diameter are restrained. (Tier 2: Sec. 13.7.3, 13.7.5; Commentary: Sec. A.7.13.5)			X		Non-applicable due to ASCE 41 Performance Level: "Life Safety (LS)"
PP-4 Piping Crossing Seismic Joints. HR-not required; LS-not required; PR-H.	Piping that crosses seismic joints or isolation planes or is connected to independent structures has couplings or other details to accommodate the relative seismic displacements. (Tier 2: Sec. 13.7.3, 13.7.5; Commentary: Sec. A.7.13.6)			X		Non-applicable due to ASCE 41 Performance Level: "Life Safety (LS)"

Ducts

EVALUATION ITEM	EVALUATION STATEMENT	С	NC	N/A	U	COMMENT
D-1 Duct Bracing. HR- not required; LS-not required; PR-H.	Rectangular ductwork larger than 6 ft2 (0.56 m2) in cross-sectional area and round ducts larger than 28 in. (711 mm) in diameter are braced. The maximum spacing of transverse bracing does not exceed 30 ft (9.2 m). The maximum spacing of longitudinal bracing does not exceed 60 ft (18.3 m). (Tier 2: Sec. 13.7.6; Commentary: Sec. A.7.14.2)			X		Non-applicable due to ASCE 41 Performance Level: "Life Safety (LS)"
D-2 Duct Support. HR- not required; LS-not required; PR-H.	Ducts are not supported by piping or electrical conduit. (Tier 2: Sec. 13.7.6; Commentary: Sec. A.7.14.3)			X		Non-applicable due to ASCE 41 Performance Level: "Life Safety (LS)"

	Ducts that cross seismic joints or isolation				
D-3 Ducts Crossing	planes or are connected to independent				Non-applicable due to
Seismic Joints. HR-not	structures have couplings or other details to		X		ASCE 41 Performance
required; LS-not	accommodate the relative seismic		Λ		Level: "Life Safety (LS)"
required; PR-H.	displacements. (Tier 2: Sec. 13.7.6;				
	Commentary: Sec. A.7.14.4)				

Elevators

EVALUATION ITEM	EVALUATION STATEMENT	С	NC	N/A	U	COMMENT
EL-1 Retainer Guards. HR-not required; LS-H; PR-H.	Sheaves and drums have cable retainer guards. (Tier 2: Sec. 13.7.11; Commentary: Sec. A.7.16.1)			X		No elevator
EL-2 Retainer Plate. HR- not required; LS-H; PR- H.	A retainer plate is present at the top and bottom of both car and counterweight. (Tier 2: Sec. 13.7.11; Commentary: Sec. A.7.16.2)			X		No elevator
EL-3 Elevator Equipment. HR-not required; LS-not required; PR-H.	Equipment, piping, and other components that are part of the elevator system are anchored. (Tier 2: Sec. 13.7.11; Commentary: Sec. A.7.16.3)			X		No elevator
EL-4 Seismic Switch. HR-not required; LS-not required; PR-H.	Elevators capable of operating at speeds of 150 ft/min or faster are equipped with seismic switches that meet the requirements of ASME A17.1 or have trigger levels set to 20% of the acceleration of gravity at the base of the structure and 50% of the acceleration of gravity in other locations. (Tier 2: Sec. 13.7.11; Commentary: Sec. A.7.16.4)			X		No elevator
EL-5 Shaft Walls. HR- not required; LS-not required; PR-H.	Elevator shaft walls are anchored and reinforced to prevent toppling into the shaft during strong shaking. (Tier 2: Sec. 13.7.11; Commentary: Sec. A.7.16.5)			X		No elevator
EL-6 Counterweight Rails. HR-not required; LS-not required; PR-H.	All counterweight rails and divider beams are sized in accordance with ASME A17.1. (Tier 2: Sec. 13.7.11; Commentary: Sec. A.7.16.6)			X		No elevator
EL-7 Brackets. HR-not required; LS-not required; PR-H.	The brackets that tie the car rails and the counterweight rail to the structure are sized in accordance with ASME A17.1. (Tier 2: Sec. 13.7.11; Commentary: Sec. A.7.16.7)			X		No elevator
EL-8 Spreader Bracket. HR-not required; LS-not required; PR-H.	Spreader brackets are not used to resist seismic forces. (Tier 2: Sec. 13.7.11; Commentary: Sec. A.7.16.8)			X		No elevator
EL-9 Go-Slow Elevators. HR-not required; LS-not required; PR-H.	The building has a go-slow elevator system. (Tier 2: Sec. 13.7.11; Commentary: Sec. A.7.16.9)			X		No elevator

1. White Salmon Valley, Hulan L. Whitson Elementary School, Main Building

1.1 Building Description

Building Name: Main Building

Facility Name: Hulan L. Whitson Elementary

School

District Name: White Salmon Valley

ICOS Latitude: 45.731 ICOS Longitude: -121.487

ICOS

County/District ID: 20405

ICOS Building ID: 14661 ASCE 41 Bldg Type: C2/URM

Enrollment: 427

Gross Sq. Ft.: 47,190

Year Built: 1956

Number of Stories: 2

S_{XS BSE-2E}: 0.463

S_{X1 BSE-2E}: 0.290

ASCE 41 Level of

Seismicity:

High

Site Class: C

V_{S30}(m/s): 464

Liquefaction

None

Potential:

Tsunami Risk: None

Structural Drawings

Available:

Yes

Evaluating Firm: WRK Engineers

NWAcademy Ct

NWAcademy Ct

NEColumbia St

NEIthood St

Elementary School

Google, data ©2019 Imagery ©2019. DigitalGlobe, State of Oregon, USDA Farm Service Agency



The Hulan L. Whitson Elementary School main building consists of a one-story unreinforced masonry multi-purpose room and original building, a two-story concrete addition, and a two-story wood-framed addition. The 1956 building is constructed on sloping ground and is located in White Salmon, Washington. The entire main building is L-shaped in plan. The multi-purpose room is rectangular, 60 feet by 106 feet, with a maximum roof height of 22 feet. The original section is L-shaped with a roof height of around 12 feet. The concrete addition is rectangular in plan, 130 feet by 66 feet, with a maximum roof height of 25 feet. The wood addition is rectangular in plan, 66 feet by 39 feet, with a maximum roof height of 25 feet. Building construction includes unreinforced masonry, concrete walls and slabs, and wood-framed walls. The roof system is a mix of TJI joists and dimensional lumber joists. Roof sheathing is a mixture of diagonal sheathing, T&G roof decks, and structural plywood.

1.1.1 Building Use

The Hulan L. Whitson Elementary School main building consists of classrooms, a cafeteria, a library, administrative offices, an all-purpose room, and a gymnasium. There are over 420 student occupants.

1.1.2 Structural System

Table 1.1-1. Structural System Description of Hulan L. Whitson Elementary School

Structural System	Description
	The roof system is composed of plywood sheathing and TJI joists in the wood
Structural Roof	addition, dimensional lumber joists and T&G decking in the concrete addition
Suuciurai Rooi	and the original building, and dimensional lumber joists and diagonal sheathing
	at the multi-purpose room.
	The second level structural floor in the concrete addition is composed of
Structural Floor(s)	concrete joists and a topping slab. The second level structural floor in the wood
	addition is TJI joists with T&G plywood sheathing and a concrete topping slab.
Foundations	The load bearing walls and shear walls are supported by continuous wall
Foundations	footings. Columns are supported by spread footings.
	The multi-purpose room gravity system consists of glulam beams, URM walls,
Gravity System	and reinforced pilasters. The wood addition consists of wood beams, walls, and
Gravity System	columns. The rest of the building consists of concrete beams and columns, steel
	columns, and concrete and URM walls.
Lataral Crystans	URM shear walls in the multi-purpose room and original building. Concrete
Lateral System	shear walls in the concrete addition. Wood shear walls in the wood addition.

1.1.3 Structural System Visual Condition

Table 1.1-2. Structural System Condition Description of Hulan L. Whitson Elementary School

Structural System	Description
Structural Roof	No visible signs of corrosion, damage, or deterioration.
Structural Floor(s)	No visible signs of corrosion, damage, or deterioration.
Foundations	Unknown.
Gravity System	Some deterioration observed on concrete columns.
Lateral System	Cracking observed in gymnasium masonry walls.

1.2 Seismic Evaluation Findings

1.2.1 Structural Seismic Deficiencies

The structural seismic deficiencies identified during the Tier 1 evaluation are summarized below. Commentary for each deficiency is also provided based on this evaluation.

Table 1-3. Identified Structural Seismic Deficiencies for White Salmon Valley Hulan L. Whitson Elementary School Main Building - Concrete

Deficiency	Description
Load Path	At wood addition, there is no connection of shear walls between floors. Wood post to foundation connection is unknown. The addition of strapping may be appropriate to connect shear walls between floors. Post-installed wood post base connections may be appropriate.
Vertical Irregularities	Vertical elements resisting shear wall overturning are discontinuous. Lateral system strengthening or the addition of new shear walls may be appropriate to mitigate seismic risk.
Torsion	Building has eccentric stiffness. Further investigation is is required to determine torsional effects on the lateral system. The addition of new shear walls may be appropriate to resist torsional effects.
Complete Frames	Concrete frames do not form a complete vertical-load-carrying system. The addition of secondary gravity load columns may be appropriate. Further investigation is required.
Wall Anchorage at Flexible Diaphragms	Out-of-plane wall anchorage is not present. Tension ties, blocking, strapping, and diaphragm nailing are required along concrete walls.
Transfer to Shear Walls	No connection to existing concrete wall. The addition of post-installed anchors to connect the diaphragm to the concrete shear walls may be appropriate.
Foundation Dowels	Wall reinforcement is not doweled into the foundation. A direct, structural connection, such as FRP, between walls and the foundation is required.
Cross Ties	There are no continuous cross ties between diaphragm chords. The addition of new cross ties between diaphragm chords or the addition of strap plates to connect existing framing members together may be appropriate.
Spans	Wood diaphragms do not consist of wood structural panel or diagonal sheathing. Installation of plywood sheathing may be appropriate to mitigate seismic risk.

1.2.2 Structural Checklist Items Marked as 'U'nknown

Where building structural component seismic adequacy was unknown due to lack of available information or limited observation, the structural checklist items were marked as "unknown". These items require further investigation if definitive determination of compliance or noncompliance is desired. The unknown structural checklist items identified during the Tier 1 evaluation are summarized below. Commentary for each unknown item is also provided based on the evaluation.

Table 1-4. Identified Structural Checklist Items Marked as Unknown for White Salmon Valley Hulan L. Whitson Elementary School Main Building - Concrete

Unknown Item	Description
	The liquefaction potential of site soils is unknown at this time given available information. Bedrock
Liquefaction	liquefaction potential is identified per ICOS based on state geologic mapping. Requires further investigation by
	a licensed geotechnical engineer to determine liquefaction potential.
Slope Failure	Requires further investigation by a licensed geotechnical engineer to determine susceptibility to slope failure.
Surface Fault	Requires further investigation by a licensed geotechnical engineer to determine whether site is near locations of
Rupture	expected surface fault ruptures.

1.2 Seismic Evaluation Findings

1.2.1 Structural Seismic Deficiencies

The structural seismic deficiencies identified during the Tier 1 evaluation are summarized below. Commentary for each deficiency is also provided based on this evaluation.

Table 1-3. Identified Structural Seismic Deficiencies for White Salmon Valley Hulan L. Whitson Elementary School Main Building - Masonry

Masonry	Ta
Deficiency	Description
Load Path	At wood addition, there is no connection of shear walls between floors. Wood post to foundation connection is unknown. The addition of strapping may be appropriate to connect shear walls between floors. Post-installed wood post base connections may be appropriate.
Vertical	Vertical elements resisting shear wall overturning are discontinuous. Lateral system strengthening or the
Irregularities	addition of new shear walls may be appropriate to mitigate seismic risk.
Torsion	Building has eccentric stiffness. Further investigation is required to determine torsional effects on the lateral system. The addition of new shear walls may be appropriate to resist torsional effects.
Wall Anchorage	Out-of-plane wall anchorage is not present. Tension ties, blocking, strapping, and diaphragm nailing are required along all URM walls.
Transfer to Shear Walls	There is no direct, structural connection between the diaphragm and the URM shear walls. The addition of post-installed anchors to connect the diaphragm to the URM shear walls or the addition of new shear walls may be appropriate.
Proportions	The height-to-thickness ratio of the URM shear walls is greater than thirteen (13 ft. height and 6-inch thickness). URM out-of-plane strengthening, such as a steel strongback system, is likely required. Further investigation is required.
Cross Ties	There are no continuous cross ties between diaphragm chords. The addition of new cross ties between diaphragm chords or the addition of strap plates to connect existing framing members together may be appropriate.
Spans	Wood diaphragms do not consist of wood structural panel or diagonal sheathing. Installation of plywood sheathing may be appropriate to mitigate seismic risk.
Beam	Girder, and Truss Supports,Beams, girders, and trusses supported by URM walls or pilasters do not have independent secondary columns for support of vertical loads. The addition of secondary supports is required.

1.2.2 Structural Checklist Items Marked as 'U'nknown

Where building structural component seismic adequacy was unknown due to lack of available information or limited observation, the structural checklist items were marked as "unknown". These items require further investigation if definitive determination of compliance or noncompliance is desired. The unknown structural checklist items identified during the Tier 1 evaluation are summarized below. Commentary for each unknown item is also provided based on the evaluation.

Table 1-4. Identified Structural Checklist Items Marked as Unknown for White Salmon Valley Hulan L. Whitson Elementary School Main Building - Masonry

Unknown Item	Description
	The liquefaction potential of site soils is unknown at this time given available information. Bedrock
Liquefaction	liquefaction potential is identified per ICOS based on state geologic mapping. Requires further investigation by
	a licensed geotechnical engineer to determine liquefaction potential.
Slope Failure	Requires further investigation by a licensed geotechnical engineer to determine susceptibility to slope failure.
Surface Fault	Requires further investigation by a licensed geotechnical engineer to determine whether site is near locations of
Rupture	expected surface fault ruptures.
Maganer Larne	This evaluation item is unknown and cannot be visually verified. This item requires further field investigation
Masonry Layup	to make a final determination on its compliance and to develop a mitigation recommendation, if necessary.
Stiffness of Wall	This evaluation item is unknown and could not be visually verified. This item requires further field
Anchors	investigation to make a final determination on its compliance and to develop a mitigation recommendation, if
Alichors	necessary.

1.3.1 Nonstructural Seismic Deficiencies

The nonstructural seismic deficiencies identified during the Tier 1 evaluation are summarized below. Commentary for each deficiency is also provided based on this evaluation. Some nonstructural deficiencies may be able to be mitigated by school district staff. Other nonstructural components that require more substantial mitigation may be more appropriately included in a long-term mitigation strategy. Some typical conceptual details for the seismic upgrade of nonstructural components can be found in the FEMA E-74 Excerpts appendix.

Table 1-5. Identified Nonstructural Seismic Deficiencies for White Salmon Valley Hulan L. Whitson Elementary School Main Building

Deficiency	Description
Distribution HR-MH·LS-	Piping/ductwork is not adequately protected from damage that could potentially allow release of hazardous material. All hazardous material piping should be braced.
P-1 Unreinforced Masonry. HR-LMH; LS-LMH; PR- LMH.	Inadequate bracing for URM partitions. Unreinforced masonry partition walls should be braced or demolished.
M-4 Unreinforced Masonry Backup. HR-LMH; LS-LMH; PR-LMH.	URM backup is present. Further investigation is required to determine the state of the URM backup and to develop a mitigation recommendation, if necessary.
M-6 Anchorage. HR-not required; LS-MH; PR-MH.	Inadequate anchorage of backup to the main structure. Installation of additional backup anchorage may be necessary. Further investigation is required.
CF-2 Tall Narrow Contents. HR-not required; LS-H; PR-MH.	Anchorage is required at tall narrow contents more than six feet high to provide overturning restraint.
ME-3 Tall Narrow Equipment. HR-not required; LS-H; PR-MH.	Anchorage is required at tall narrow equipment more than six feet high to provide overturning restraint.

1.3.2 Nonstructural Checklist Items Marked as 'U'nknown

Where building nonstructural component seismic adequacy was unknown due to lack of available information or limited observation, the nonstructural checklist items were marked as "unknown". These items require further investigation if definitive determination of compliance or noncompliance is desired. The unknown nonstructural checklist items identified during the Tier 1 evaluation are summarized below. Commentary for each unknown item is also provided based on the evaluation.

Some nonstructural deficiencies may be able to be mitigated by school district staff. Other nonstructural components that require more substantial mitigation may be more appropriately included in a long-term mitigation strategy. Some typical conceptual details for the seismic upgrade of nonstructural components can be found in the FEMA E-74 Excerpts appendix.

Table 1-6. Identified Nonstructural Checklist Items Marked as Unknown for White Salmon Valley Hulan L. Whitson Elementary School Main Building

Main Building	
Unknown Item	Description
HM-5 Flexible Couplings. HR-LMH; LS-LMH; PR-	Further investigation is required to locate flexible couplings on hazardous material
LMH.	ductwork/piping.
HM-6 Piping or Ducts	
Crossing Seismic Joints. HR-	
MH; LS-MH; PR-MH.	
P-3 Drift. HR-not required; LS-MH; PR-MH.	Further investigation is required to verify detailing of rigid cementitious partitions for drift.
CG-8 Overhead Glazing. HR-	Further investigation is required to review acoustical tile/panel ceilings for proper seismic joint
not required; LS-MH; PR-MH.	layout.
M-1 Ties. HR-not required;	Ties are present, but spacing is unknown. Further investigation is required to verify detailing of
LS-LMH; PR-LMH.	masonry veneer ties.
M-2 Shelf Angles. HR-not	Further investigation is required to verify method of support of masonry veneer at each floor above
required; LS-LMH; PR-LMH.	grade.
M-3 Weakened Planes. HR-	
not required; LS-LMH; PR-	Further investigation is required to verify anchorage of masonry veneer at weakened planes.
LMH.	
MC-2 Anchorage. HR-LMH;	Further investigation is required to verify masonry chimney anchorage.
LS-LMH; PR-LMH.	i urther investigation is required to verify masonly emininey anenorage.
S-2 Stair Details. HR-not	Further investigation is required to verify stair connections.
required; LS-LMH; PR-LMH.	a transfer investigation is required to verify sum connections.
ME-2 In-Line Equipment. HR-	This evaluation item could not be visually verified. Further investigation is required to review
not required; LS-H; PR-H.	vertical support and lateral bracing of equipment.
EL-1 Retainer Guards. HR-not	Further investigation is required to verify elevator sheaves and drums have cable retainer guards.
required; LS-H; PR-H.	a dialor investigation is required to verify elevator sheaves and drums have easie retainer guards.
EL-2 Retainer Plate. HR-not	Further investigation is required to verify proper installation of retainer plates.
required; LS-H; PR-H.	a distribution of recurrence in refused to verify proper installation of recurrence plates.

Photos:



Figure 1-1. Deterioration of Concrete Columns in Boiler Room



Figure 1-2. Unbraced MEP Equipment in Boiler Room



Figure 1-3. Unbraced MEP Equipment



Figure 1-4. Damaged Ceiling Tile Track

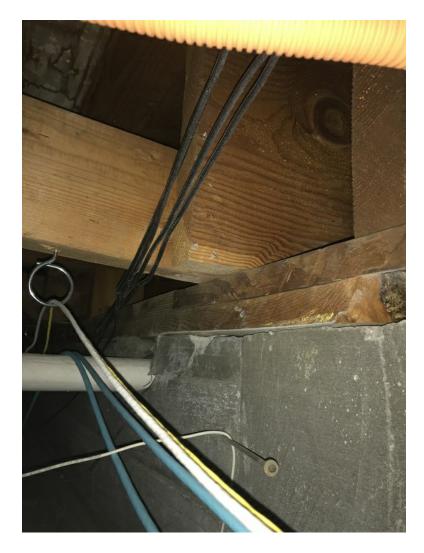


Figure 1-5. Lack of Connection Between Wood Framing and Concrete Wall



Figure 1-6. Gymnasium with Glulam Beams

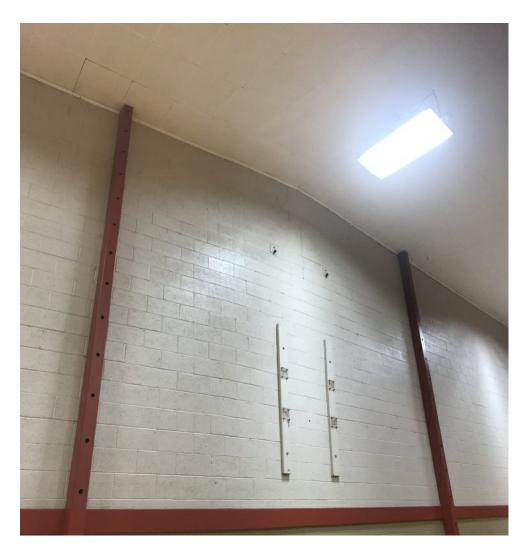


Figure 1-7. HSS Strongbacks at Gymnasium Walls



Figure 1-8. Gas Lines at Exterior



Figure 1-9. Hulan L. Whitson Elementary School - Southwest Exterior



Figure 1-10. Hulan L. Whitson Elementary School - East Exterior

White Salmon Valley, Hulan L. Whitson Elementary School, Main Building - Concrete

17-2 Collapse Prevention Basic Configuration Checklist

Building record drawings have been reviewed, when available, and a non-destructive field investigation has been performed for the subject building. Each of the required checklist items are marked Compliant (C), Noncompliant (NC), Not Applicable (N/A), or Unknown (U). Items marked Compliant indicate conditions that satisfy the performance objective, whereas items marked Noncompliant or Unknown indicate conditions that do not. Certain statements might not apply to the building being evaluated.

Low Seismicity

Building System - General

EVALUATION ITEM	EVALUATION STATEMENT	С	NC	N/A	U	COMMENT
Load Path	The structure contains a complete, well-defined load path, including structural elements and connections, that serves to transfer the inertial forces associated with the mass of all elements of the building to the foundation. (Tier 2: Sec. 5.4.1.1; Commentary: Sec. A.2.1.10)		X			At wood addition, there is no connection of shear walls between floors. Wood post to foundation connection is unknown. The addition of strapping may be appropriate to connect shear walls between floors. Postinstalled wood post base connections may be appropriate.
Adjacent Buildings	The clear distance between the building being evaluated and any adjacent building is greater than 0.25% of the height of the shorter building in low seismicity, 0.5% in moderate seismicity, and 1.5% in high seismicity. (Tier 2: Sec. 5.4.1.2; Commentary: Sec. A.2.1.2)	X				
Mezzanines	Interior mezzanine levels are braced independently from the main structure or are anchored to the seismic-force-resisting elements of the main structure. (Tier 2: Sec. 5.4.1.3; Commentary: Sec. A.2.1.3)			X		

Building System - Building Configuration

EVALUATION ITEM	EVALUATION STATEMENT	С	NC	N/A	U	COMMENT
•	The sum of the shear strengths of the seismic- force-resisting system in any story in each direction is not less than 80% of the strength in the adjacent story above. (Tier 2: Sec. 5.4.2.1; Commentary: Sec. A.2.2.2)	X				

Soft Story	The stiffness of the seismic-force-resisting system in any story is not less than 70% of the seismic-force-resisting system stiffness in an adjacent story above or less than 80% of the average seismic-force-resisting system stiffness of the three stories above. (Tier 2: Sec. 5.4.2.2; Commentary: Sec. A.2.2.3)	X			
Vertical Irregularities	All vertical elements in the seismic-forceresisting system are continuous to the foundation. (Tier 2: Sec. 5.4.2.3; Commentary: Sec. A.2.2.4)		X		Vertical elements resisting shear wall overturning are discontinuous. Lateral system strengthening or the addition of new shear walls may be appropriate to mitigate seismic risk.
Geometry	There are no changes in the net horizontal dimension of the seismic-force-resisting system of more than 30% in a story relative to adjacent stories, excluding one-story penthouses and mezzanines. (Tier 2: Sec. 5.4.2.4; Commentary: Sec. A.2.2.5)	X			
Mass	There is no change in effective mass of more than 50% from one story to the next. Light roofs, penthouses, and mezzanines need not be considered. (Tier 2: Sec. 5.4.2.5; Commentary: Sec. A.2.2.6)	X			
Torsion	The estimated distance between the story center of mass and the story center of rigidity is less than 20% of the building width in either plan dimension. (Tier 2: Sec. 5.4.2.6; Commentary: Sec. A.2.2.7)		X		Building has eccentric stiffness. Further investigation is is required to determine torsional effects on the lateral system. The addition of new shear walls may be appropriate to resist torsional effects.

${\bf Moderate\ Seismicity\ (Complete\ the\ Following\ Items\ in\ Addition\ to\ the\ Items\ for\ Low\ Seismicity)}$

Geologic Site Hazards

EVALUATION ITEM	EVALUATION STATEMENT	С	NC	N/A	U	COMMENT
Liquefaction	Liquefaction-susceptible, saturated, loose granular soils that could jeopardize the building's seismic performance do not exist in the foundation soils at depths within 50 ft (15.2 m) under the building. (Tier 2: Sec. 5.4.3.1; Commentary: Sec. A.6.1.1)				X	The liquefaction potential of site soils is unknown at this time given available information. Bedrock liquefaction potential is identified per ICOS based on state geologic mapping. Requires further investigation by a licensed geotechnical engineer to determine liquefaction potential.

Slope Failure	The building site is located away from potential earthquake-induced slope failures or rockfalls so that it is unaffected by such failures or is capable of accommodating any predicted movements without failure. (Tier 2: Sec. 5.4.3.1; Commentary: Sec. A.6.1.2)		X	Requires further investigation by a licensed geotechnical engineer to determine susceptibility to slope failure.
Surface Fault Rupture	Surface fault rupture and surface displacement at the building site are not anticipated. (Tier 2: Sec. 5.4.3.1; Commentary: Sec. A.6.1.3)		X	Requires further investigation by a licensed geotechnical engineer to determine whether site is near locations of expected surface fault ruptures.

High Seismicity (Complete the Following Items in Addition to the Items for Low and Moderate Seismicity)

Foundation Configuration

EVALUATION ITEM	EVALUATION STATEMENT	С	NC	N/A	U	COMMENT
Overturning	The ratio of the least horizontal dimension of the seismic-force-resisting system at the foundation level to the building height (base/height) is greater than 0.6Sa. (Tier 2: Sec. 5.4.3.3; Commentary: Sec. A.6.2.1)	X				
Ties Between Foundation Elements	The foundation has ties adequate to resist seismic forces where footings, piles, and piers are not restrained by beams, slabs, or soils classified as Site Class A, B, or C. (Tier 2: Sec. 5.4.3.4; Commentary: Sec. A.6.2.2)			X		

17-24 Collapse Prevention Structural Checklist for Building Types C2 and C2a

Building record drawings have been reviewed, when available, and a non-destructive field investigation has been performed for the subject building. Each of the required checklist items are marked Compliant (C), Noncompliant (NC), Not Applicable (N/A), or Unknown (U). Items marked Compliant indicate conditions that satisfy the performance objective, whereas items marked Noncompliant or Unknown indicate conditions that do not. Certain statements might not apply to the building being evaluated.

Low and Moderate Seismicity

Seismic-Force-Resisting System

EVALUATION ITEM	EVALUATION STATEMENT	С	NC	N/A	U	COMMENT
Complete Frames	Steel or concrete frames classified as secondary components form a complete vertical-load-carrying system. (Tier 2: Sec. 5.5.2.5.1; Commentary: Sec. A.3.1.6.1)		X			Concrete frames do not form a complete vertical-load- carrying system. The addition of secondary gravity load columns may be appropriate. Further investigation is required.
Redundancy	The number of lines of shear walls in each principal direction is greater than or equal to 2. (Tier 2: Sec.5.5.1.1; Commentary: Sec. A.3.2.1.1)	X				
Shear Stress Check	The shear stress in the concrete shear walls, calculated using the Quick Check procedure of Section 4.4.3.3, is less than the greater of 100 lb/in.2 (0.69 MPa) or 2√f′c. (Tier 2: Sec.5.5.3.1.1; Commentary: Sec. A.3.2.2.1)	X				
Reinforcing Steel	The ratio of reinforcing steel area to gross concrete area is not less than 0.0012 in the vertical direction and 0.0020 in the horizontal direction. (Tier 2: Sec.5.5.3.1.3; Commentary: Sec. A.3.2.2.2)	X				

Connections

EVALUATION ITEM	EVALUATION STATEMENT	С	NC	N/A	U	COMMENT
Wall Anchorage at Flexible Diaphragms	Exterior concrete or masonry walls that are dependent on flexible diaphragms for lateral support are anchored for out-of-plane forces at each diaphragm level with steel anchors, reinforcing dowels, or straps that are developed into the diaphragm. Connections have strength to resist the connection force calculated in the Quick Check procedure of Section 4.4.3.7. (Tier 2: Sec.5.7.1.1; Commentary: Sec. A.5.1.1)		X			Out-of-plane wall anchorage is not present. Tension ties, blocking, strapping, and diaphragm nailing are required along concrete walls.
Transfer to Shear Walls	Diaphragms are connected for transfer of seismic forces to the shear walls. (Tier 2: Sec.5.7.2; Commentary: Sec. A.5.2.1)		X			No connection to existing concrete wall. The addition of post-installed anchors to connect the diaphragm to the concrete shear walls may be appropriate.

High Seismicity (Complete the Following Items in Addition to the Items for Low and Moderate Seismicity)

Seismic-Force-Resisting System

EVALUATION ITEM	EVALUATION STATEMENT	С	NC	N/A	U	COMMENT
Deflection Compatibility	Secondary components have the shear capacity to develop the flexural strength of the components. (Tier 2: Sec.5.5.2.5.2; Commentary: Sec. A.3.1.6.2)	X				
Flat Slabs	Flat slabs or plates not part of the seismic-force-resisting system have continuous bottom steel through the column joints. (Tier 2: Sec.5.5.2.5.3; Commentary: Sec. A.3.1.6.3)			X		
Coupling Beams	The ends of both walls to which the coupling beam is attached are supported at each end to resist vertical loads caused by overturning. (Tier 2: Sec.5.5.3.2.1; Commentary: Sec. A.3.2.2.3)	X				

Diaphragms (Stiff or Flexible)

EVALUATION ITEM	EVALUATION STATEMENT	C	NC	N/A	U	COMMENT
Diaphragm Continuity	The diaphragms are not composed of split-level floors and do not have expansion joints. (Tier 2: Sec. 5.6.1.1; Commentary: Sec. A.4.1.1)	X				
Unenings at Shear	Diaphragm openings immediately adjacent to the shear walls are less than 25% of the wall length. (Tier 2: Sec. 5.6.1.3; Commentary: Sec. A.4.1.4)	X				

Flexible Diaphragms

EVALUATION ITEM	EVALUATION STATEMENT	С	NC	N/A	U	COMMENT
Cross Ties	There are continuous cross ties between diaphragm chords. (Tier 2: Sec. 5.6.1.2; Commentary: Sec. A.4.1.2)		X			There are no continuous cross ties between diaphragm chords. The addition of new cross ties between diaphragm chords or the addition of strap plates to connect existing framing members together may be appropriate.
Straight Sheathing	All straight-sheathed diaphragms have aspect ratios less than 2-to-1 in the direction being considered. (Tier 2: Sec. 5.6.2; Commentary: Sec. A.4.2.1)	X				

Spans	All wood diaphragms with spans greater than 24 ft (7.3 m) consist of wood structural panels or diagonal sheathing. (Tier 2: Sec. 5.6.2; Commentary: Sec. A.4.2.2)		X		Wood diaphragms do not consist of wood structural panel or diagonal sheathing. Installation of plywood sheathing may be appropriate to mitigate seismic risk.
Diagonally Sheathed and Unblocked Diaphragms	All diagonally sheathed or unblocked wood structural panel diaphragms have horizontal spans less than 40 ft (12.2 m) and aspect ratios less than or equal to 4 to-1. (Tier 2: Sec.5.6.2; Commentary: Sec. A.4.2.3)			X	
Other Diaphragms	Diaphragms do not consist of a system other than wood, metal deck, concrete, or horizontal bracing. (Tier 2: Sec.5.6.5; Commentary: Sec. A.4.7.1)	X			

Connections

EVALUATION ITEM	EVALUATION STATEMENT	С	NC	N/A	U	COMMENT
	Pile caps have top reinforcement, and piles are					
Uplift at Pile Caps	anchored to the pile caps. (Tier 2: Sec.5.7.3.5;			X		
	Commentary: Sec. A.5.3.8)					

White Salmon Valley, Hulan L. Whitson Elementary School, Main Building - Masonry

17-2 Collapse Prevention Basic Configuration Checklist

Building record drawings have been reviewed, when available, and a non-destructive field investigation has been performed for the subject building. Each of the required checklist items are marked Compliant (C), Noncompliant (NC), Not Applicable (N/A), or Unknown (U). Items marked Compliant indicate conditions that satisfy the performance objective, whereas items marked Noncompliant or Unknown indicate conditions that do not. Certain statements might not apply to the building being evaluated.

Low Seismicity

Building System - General

EVALUATION ITEM	EVALUATION STATEMENT	С	NC	N/A	U	COMMENT
Load Path	The structure contains a complete, well-defined load path, including structural elements and connections, that serves to transfer the inertial forces associated with the mass of all elements of the building to the foundation. (Tier 2: Sec. 5.4.1.1; Commentary: Sec. A.2.1.10)		X			At wood addition, there is no connection of shear walls between floors. Wood post to foundation connection is unknown. The addition of strapping may be appropriate to connect shear walls between floors. Postinstalled wood post base connections may be appropriate.
Adjacent Buildings	The clear distance between the building being evaluated and any adjacent building is greater than 0.25% of the height of the shorter building in low seismicity, 0.5% in moderate seismicity, and 1.5% in high seismicity. (Tier 2: Sec. 5.4.1.2; Commentary: Sec. A.2.1.2)	X				
Mezzanines	Interior mezzanine levels are braced independently from the main structure or are anchored to the seismic-force-resisting elements of the main structure. (Tier 2: Sec. 5.4.1.3; Commentary: Sec. A.2.1.3)			X		

Building System - Building Configuration

EVALUATION ITEM	EVALUATION STATEMENT	С	NC	N/A	U	COMMENT
	The sum of the shear strengths of the seismic- force-resisting system in any story in each direction is not less than 80% of the strength in the adjacent story above. (Tier 2: Sec. 5.4.2.1; Commentary: Sec. A.2.2.2)	X				

Soft Story	The stiffness of the seismic-force-resisting system in any story is not less than 70% of the seismic-force-resisting system stiffness in an adjacent story above or less than 80% of the average seismic-force-resisting system stiffness of the three stories above. (Tier 2: Sec. 5.4.2.2; Commentary: Sec. A.2.2.3)	X			
Vertical Irregularities	All vertical elements in the seismic-forceresisting system are continuous to the foundation. (Tier 2: Sec. 5.4.2.3; Commentary: Sec. A.2.2.4)		X		Vertical elements resisting shear wall overturning are discontinuous. Lateral system strengthening or the addition of new shear walls may be appropriate to mitigate seismic risk.
Geometry	There are no changes in the net horizontal dimension of the seismic-force-resisting system of more than 30% in a story relative to adjacent stories, excluding one-story penthouses and mezzanines. (Tier 2: Sec. 5.4.2.4; Commentary: Sec. A.2.2.5)	X			
Mass	There is no change in effective mass of more than 50% from one story to the next. Light roofs, penthouses, and mezzanines need not be considered. (Tier 2: Sec. 5.4.2.5; Commentary: Sec. A.2.2.6)	X			
Torsion	The estimated distance between the story center of mass and the story center of rigidity is less than 20% of the building width in either plan dimension. (Tier 2: Sec. 5.4.2.6; Commentary: Sec. A.2.2.7)		X		Building has eccentric stiffness. Further investigation is required to determine torsional effects on the lateral system. The addition of new shear walls may be appropriate to resist torsional effects.

${\bf Moderate\ Seismicity\ (Complete\ the\ Following\ Items\ in\ Addition\ to\ the\ Items\ for\ Low\ Seismicity)}$

Geologic Site Hazards

EVALUATION ITEM	EVALUATION STATEMENT	С	NC	N/A	U	COMMENT
Liquefaction	Liquefaction-susceptible, saturated, loose granular soils that could jeopardize the building's seismic performance do not exist in the foundation soils at depths within 50 ft (15.2 m) under the building. (Tier 2: Sec. 5.4.3.1; Commentary: Sec. A.6.1.1)				X	The liquefaction potential of site soils is unknown at this time given available information. Bedrock liquefaction potential is identified per ICOS based on state geologic mapping. Requires further investigation by a licensed geotechnical engineer to determine liquefaction potential.

Slope Failure	The building site is located away from potential earthquake-induced slope failures or rockfalls so that it is unaffected by such failures or is capable of accommodating any predicted movements without failure. (Tier 2: Sec. 5.4.3.1; Commentary: Sec. A.6.1.2)		X	Requires further investigation by a licensed geotechnical engineer to determine susceptibility to slope failure.
Surface Fault Rupture	Surface fault rupture and surface displacement at the building site are not anticipated. (Tier 2: Sec. 5.4.3.1; Commentary: Sec. A.6.1.3)		X	Requires further investigation by a licensed geotechnical engineer to determine whether site is near locations of expected surface fault ruptures.

High Seismicity (Complete the Following Items in Addition to the Items for Low and Moderate Seismicity)

Foundation Configuration

EVALUATION ITEM	EVALUATION STATEMENT	С	NC	N/A	U	COMMENT
Overturning	The ratio of the least horizontal dimension of the seismic-force-resisting system at the foundation level to the building height (base/height) is greater than 0.6Sa. (Tier 2: Sec. 5.4.3.3; Commentary: Sec. A.6.2.1)	X				
Ties Between Foundation Elements	The foundation has ties adequate to resist seismic forces where footings, piles, and piers are not restrained by beams, slabs, or soils classified as Site Class A, B, or C. (Tier 2: Sec. 5.4.3.4; Commentary: Sec. A.6.2.2)			X		

17-36 Collapse Prevention Structural Checklist for Building Types URM and URMa

Building record drawings have been reviewed, when available, and a non-destructive field investigation has been performed for the subject building. Each of the required checklist items are marked Compliant (C), Noncompliant (NC), Not Applicable (N/A), or Unknown (U). Items marked Compliant indicate conditions that satisfy the performance objective, whereas items marked Noncompliant or Unknown indicate conditions that do not. Certain statements might not apply to the building being evaluated.

Low and Moderate Seismicity

Seismic-Force-Resisting System

EVALUATION ITEM	EVALUATION STATEMENT	С	NC	N/A	U	COMMENT
Redundancy	The number of lines of shear walls in each principal direction is greater than or equal to 2. (Tier 2: Sec. 5.5.1.1; Commentary: Sec. A.3.2.1.1)	X				
Shear Stress Check	The shear stress in the unreinforced masonry shear walls, calculated using the Quick Check procedure of Section 4.4.3.3, is less than 30 lb/in.2 (0.21 MPa) for clay units and 70 lb/in.2 (0.48 MPa) for concrete units. (Tier 2: Sec. 5.5.3.1.1; Commentary: Sec. A.3.2.5.1)	X				

Connections

EVALUATION ITEM	EVALUATION STATEMENT	С	NC	N/A	U	COMMENT
Wall Anchorage	Exterior concrete or masonry walls that are dependent on the diaphragm for lateral support are anchored for out-of-plane forces at each diaphragm level with steel anchors, reinforcing dowels, or straps that are developed into the diaphragm. Connections have strength to resist the connection force calculated in the Quick Check procedure of Section 4.4.3.7. (Tier 2: Sec. 5.7.1.1; Commentary: Sec. A.5.1.1)		X			Out-of-plane wall anchorage is not present. Tension ties, blocking, strapping, and diaphragm nailing are required along all URM walls.
Wood Ledgers	The connection between the wall panels and the diaphragm does not induce cross-grain bending or tension in the wood ledgers. (Tier 2: Sec. 5.7.1.3; Commentary: Sec. A.5.1.2)			X		
Transfer to Shear Walls	Diaphragms are connected for transfer of seismic forces to the shear walls. (Tier 2: Sec. 5.7.2; Commentary: Sec. A.5.2.1)		X			There is no direct, structural connection between the diaphragm and the URM shear walls. The addition of post-installed anchors to connect the diaphragm to the URM shear walls or the addition of new shear walls may be appropriate.

	There is a positive connection using plates,			
Girder-Column	connection hardware, or straps between the	v		
Connection	girder and the column support. (Tier 2: Sec.	Λ		
	5.7.4.1; Commentary: Sec. A.5.4.1)			

High Seismicity (Complete the Following Items in Addition to the Items for Low and Moderate Seismicity)

Seismic-Force-Resisting System

EVALUATION ITEM	EVALUATION STATEMENT	С	NC	N/A	U	COMMENT
Proportions	The height-to-thickness ratio of the shear walls at each story is less than the following: Top story of multi-story building – 9; First story of multi-story building – 15; All other conditions – 13. (Tier 2: Sec. 5.5.3.1.2; Commentary: Sec. A.3.2.5.2)		X			The height-to-thickness ratio of the URM shear walls is greater than thirteen (13 ft. height and 6-inch thickness). URM out-of-plane strengthening, such as a steel strongback system, is likely required. Further investigation is required.
Masonry Layup	Filled collar joints of multi-wythe masonry walls have negligible voids. (Tier 2: Sec. 5.5.3.4.1; Commentary: Sec. A.3.2.5.3)				X	This evaluation item is unknown and cannot be visually verified. This item requires further field investigation to make a final determination on its compliance and to develop a mitigation recommendation, if necessary.

Diaphragms (Stiff or Flexible)

EVALUATION ITEM	EVALUATION STATEMENT	C	NC	N/A	U	COMMENT
Openings at Shear Walls	Diaphragm openings immediately adjacent to the shear walls are less than 25% of the wall length. (Tier 2: Sec. 5.6.1.3; Commentary: Sec. A.4.1.4)			X		
	Diaphragm openings immediately adjacent to exterior masonry shear walls are not greater than 8 ft (2.4 m) long. (Tier 2: Sec. 5.6.1.3; Commentary: Sec. A.4.1.6)			X		

Flexible Diaphragms

EVALUATION ITEM	EVALUATION STATEMENT	С	NC	N/A	U	COMMENT
Cross Ties	There are continuous cross ties between diaphragm chords. (Tier 2: Sec. 5.6.1.2; Commentary: Sec. A.4.1.2)		X			There are no continuous cross ties between diaphragm chords. The addition of new cross ties between diaphragm chords or the addition of strap plates to connect existing framing members together may be appropriate.

Straight Sheathing	All straight-sheathed diaphragms have aspect ratios less than 2-to-1 in the direction being considered. (Tier 2: Sec. 5.6.2; Commentary: Sec. A.4.2.1)	X			
Spans	All wood diaphragms with spans greater than 24 ft (7.3 m) consist of wood structural panels or diagonal sheathing. (Tier 2: Sec. 5.6.2; Commentary: Sec. A.4.2.2)		X		Wood diaphragms do not consist of wood structural panel or diagonal sheathing. Installation of plywood sheathing may be appropriate to mitigate seismic risk.
Diagonally Sheathed and Unblocked Diaphragms	All diagonally sheathed or unblocked wood structural panel diaphragms have horizontal spans less than 40 ft (12.2 m) and aspect ratios less than or equal to 4 to-1. (Tier 2: Sec. 5.6.2; Commentary: Sec. A.4.2.3)			X	
Other Diaphragms	The diaphragms do not consist of a system other than wood, metal deck, concrete, or horizontal bracing. (Tier 2: Sec. 5.6.5; Commentary: Sec. A.4.7.1)	X			

Connections

EVALUATION ITEM	EVALUATION STATEMENT	С	NC	N/A	U	COMMENT
Stiffness of Wall Anchors	Anchors of concrete or masonry walls to wood structural elements are installed taut and are stiff enough to limit the relative movement between the wall and the diaphragm to no greater than 1/8 in. before engagement of the anchors. (Tier 2: Sec. 5.7.1.2; Commentary: Sec. A.5.1.4)				X	This evaluation item is unknown and could not be visually verified. This item requires further field investigation to make a final determination on its compliance and to develop a mitigation recommendation, if necessary.
Beam, Girder, and Truss Supports	Beams, girders, and trusses supported by unreinforced masonry walls or pilasters have independent secondary columns for support of vertical loads. (Tier 2: Sec. 5.7.4.4; Commentary: Sec. A.5.4.5)		X			Beams, girders, and trusses supported by URM walls or pilasters do not have independent secondary columns for support of vertical loads. The addition of secondary supports is required.

White Salmon Valley, Hulan L. Whitson Elementary School, Main Building 17-38 Nonstructural Checklist

Notes:

C = Compliant, NC = Noncompliant, N/A = Not Applicable, and U = Unknown.

Performance Level: HR = Hazards Reduced, LS = Life Safety, and PR = Position Retention.

Level of Seismicity: L = Low, M = Moderate, and H = High

Life Safety Systems

EVALUATION ITEM	EVALUATION STATEMENT	С	NC	N/A	U	COMMENT
LSS-1 Fire Suppression Piping. HR-not required; LS-LMH; PR-LMH.	Fire suppression piping is anchored and braced in accordance with NFPA-13. (Tier 2: Sec. 13.7.4; Commentary: Sec. A.7.13.1)			X		No fire sprinklers
LSS-2 Flexible Couplings. HR-not required; LS-LMH; PR- LMH.	Fire suppression piping has flexible couplings in accordance with NFPA-13. (Tier 2: Sec. 13.7.4; Commentary: Sec. A.7.13.2)			X		
LSS-3 Emergency Power. HR-not required; LS-LMH; PR-LMH.	Equipment used to power or control Life Safety systems is anchored or braced. (Tier 2: Sec. 13.7.7; Commentary: Sec. A.7.12.1)			X		No emergency generator
LSS-4 Stair and Smoke Ducts. HR-not required; LS-LMH; PR-LMH.	Stair pressurization and smoke control ducts are braced and have flexible connections at seismic joints. (Tier 2: Sec. 13.7.6; Commentary: Sec. A.7.14.1)			X		
LSS-5 Sprinkler Ceiling Clearance. HR-not required; LS-MH; PR- MH.	Penetrations through panelized ceilings for fire suppression devices provide clearances in accordance with NFPA-13. (Tier 2: Sec. 13.7.4; Commentary: Sec. A.7.13.3)			X		
LSS-6 Emergency Lighting. HR-not required; LS-not required; PR-LMH	Emergency and egress lighting equipment is anchored or braced. (Tier 2: Sec. 13.7.9; Commentary: Sec. A.7.3.1)			X		Non-applicable due to ASCE 41 Performance Level: "Life Safety (LS)"

Hazardous Materials

EVALUATION ITEM	EVALUATION STATEMENT	С	NC	N/A	U	COMMENT
HM-1 Hazardous Material Equipment. HR- LMH; LS-LMH; PR- LMH.	Equipment mounted on vibration isolators and containing hazardous material is equipped with restraints or snubbers. (Tier 2: Sec. 13.7.1; Commentary: Sec. A.7.12.2)			X		
HM-2 Hazardous Material Storage. HR- LMH; LS-LMH; PR- LMH.	Breakable containers that hold hazardous material, including gas cylinders, are restrained by latched doors, shelf lips, wires, or other methods. (Tier 2: Sec. 13.8.3; Commentary: Sec. A.7.15.1)			X		

HM-3 Hazardous Material Distribution. HR-MH; LS-MH; PR- MH.	Piping or ductwork conveying hazardous materials is braced or otherwise protected from damage that would allow hazardous material release. (Tier 2: Sec. 13.7.3, 13.7.5; Commentary: Sec. A.7.13.4)		X		Piping/ductwork is not adequately protected from damage that could potentially allow release of hazardous material. All hazardous material piping should be braced.
HM-4 Shutoff Valves. HR-MH; LS-MH; PR- MH.	Piping containing hazardous material, including natural gas, has shutoff valves or other devices to limit spills or leaks. (Tier 2: Sec. 13.7.3, 13.7.5; Commentary: Sec. A.7.13.3)	X			
HM-5 Flexible Couplings. HR-LMH; LS-LMH; PR-LMH.	Hazardous material ductwork and piping, including natural gas piping, have flexible couplings. (Tier 2: Sec. 13.7.3, 13.7.5; Commentary: Sec. A.7.15.4)			X	Further investigation is required to locate flexible couplings on hazardous material ductwork/piping.
HM-6 Piping or Ducts Crossing Seismic Joints. HR-MH; LS-MH; PR- MH.	Piping or ductwork carrying hazardous material that either crosses seismic joints or isolation planes or is connected to independent structures has couplings or other details to accommodate the relative seismic displacements. (Tier 2: Sec. 13.7.3, 13.7.5, 13.7.6; Commentary: Sec. A.7.13.6)			X	Further investigation is required to verify detailing of hazardous material piping/ductwork at seismic joints.

Partitions

				1		T
EVALUATION ITEM	EVALUATION STATEMENT	C	NC	N/A	U	COMMENT
P-1 Unreinforced Masonry. HR-LMH; LS- LMH; PR-LMH.	Unreinforced masonry or hollow-clay tile partitions are braced at a spacing of at most 10 ft (3.0 m) in Low or Moderate Seismicity, or at most 6 ft (1.8 m) in High Seismicity. (Tier 2: Sec. 13.6.2; Commentary: Sec. A.7.1.1)		X			Inadequate bracing for URM partitions. Unreinforced masonry partition walls should be braced or demolished.
P-2 Heavy Partitions Supported by Ceilings. HR-LMH; LS-LMH; PR- LMH.	The tops of masonry or hollow-clay tile partitions are not laterally supported by an integrated ceiling system. (Tier 2: Sec. 13.6.2; Commentary: Sec. A.7.2.1)	X				
P-3 Drift. HR-not required; LS-MH; PR- MH.	Rigid cementitious partitions are detailed to accommodate the following drift ratios: in steel moment frame, concrete moment frame, and wood frame buildings, 0.02; in other buildings, 0.005. (Tier 2: Sec. 13.6.2; Commentary: Sec. A.7.1.2)				X	Further investigation is required to verify detailing of rigid cementitious partitions for drift.
P-4 Light Partitions Supported by Ceilings. HR-not required; LS-not required; PR-MH.	The tops of gypsum board partitions are not laterally supported by an integrated ceiling system. (Tier 2: Sec. 13.6.2; Commentary: Sec. A.7.2.1)			X		Non-applicable due to ASCE 41 Performance Level: "Life Safety (LS)"
P-5 Structural Separations. HR-not required; LS-not required; PR-MH.	Partitions that cross structural separations have seismic or control joints. (Tier 2: Sec. 13.6.2; Commentary: Sec. A.7.1.3)			X		Non-applicable due to ASCE 41 Performance Level: "Life Safety (LS)"

Ceilings

Cennigs						
EVALUATION ITEM	EVALUATION STATEMENT	C	NC	N/A	U	COMMENT
C-1 Suspended Lath and Plaster. HR-H; LS-MH; PR-LMH.	Suspended lath and plaster ceilings have attachments that resist seismic forces for every 12 ft2 (1.1 m2) of area. (Tier 2: Sec. 13.6.4; Commentary: Sec. A.7.2.3)			X		
C-2 Suspended Gypsum Board. HR-not required; LS-MH; PR-LMH.	Suspended gypsum board ceilings have attachments that resist seismic forces for every 12 ft2 (1.1 m2) of area. (Tier 2: Sec. 13.6.4; Commentary: Sec. A.7.2.3)			X		
C-3 Integrated Ceilings. HR-not required; LS-not required; PR-MH.	Integrated suspended ceilings with continuous areas greater than 144 ft2 (13.4 m2) and ceilings of smaller areas that are not surrounded by restraining partitions are laterally restrained at a spacing no greater than 12 ft (3.6 m) with members attached to the structure above. Each restraint location has a minimum of four diagonal wires and compression struts, or diagonal members capable of resisting compression. (Tier 2: Sec. 13.6.4; Commentary: Sec. A.7.2.2)			X		Non-applicable due to ASCE 41 Performance Level: "Life Safety (LS)"
C-4 Edge Clearance. HR- not required; LS-not required; PR-MH.	The free edges of integrated suspended ceilings with continuous areas greater than 144 ft2 (13.4 m2) have clearances from the enclosing wall or partition of at least the following: in Moderate Seismicity, 1/2 in. (13 mm); in High Seismicity, 3/4 in. (19 mm). (Tier 2: Sec. 13.6.4; Commentary: Sec. A.7.2.4)			X		Non-applicable due to ASCE 41 Performance Level: "Life Safety (LS)"
C-5 Continuity Across Structure Joints. HR-not required; LS-not required; PR-MH.	The ceiling system does not cross any seismic joint and is not attached to multiple independent structures. (Tier 2: Sec. 13.6.4; Commentary: Sec. A.7.2.5)			X		Non-applicable due to ASCE 41 Performance Level: "Life Safety (LS)"
C-6 Edge Support. HR- not required; LS-not required; PR-H.	The free edges of integrated suspended ceilings with continuous areas greater than 144 ft2 (13.4 m2) are supported by closure angles or channels not less than 2 in. (51 mm) wide. (Tier 2: Sec. 13.6.4; Commentary: Sec. A.7.2.6)			X		Non-applicable due to ASCE 41 Performance Level: "Life Safety (LS)"
C-7 Seismic Joints. HR- not required; LS-not required; PR-H.	Acoustical tile or lay-in panel ceilings have seismic separation joints such that each continuous portion of the ceiling is no more than 2,500 ft2 (232.3 m2) and has a ratio of long-to-short dimension no more than 4-to-1. (Tier 2: Sec. 13.6.4; Commentary: Sec. A.7.2.7)			X		Non-applicable due to ASCE 41 Performance Level: "Life Safety (LS)"

Light Fixtures

EVALUATION ITEM	EVALUATION STATEMENT	С	NC	N/A	U	COMMENT
LF-1 Independent Support. HR-not required; LS-MH; PR- MH.	Light fixtures that weigh more per square foot than the ceiling they penetrate are supported independent of the grid ceiling suspension system by a minimum of two wires at diagonally opposite corners of each fixture. (Tier 2: Sec. 13.6.4, 13.7.9; Commentary: Sec. A.7.3.2)			X		
LF-2 Pendant Supports. HR-not required; LS-not required; PR-H.	Light fixtures on pendant supports are attached at a spacing equal to or less than 6 ft. Unbraced suspended fixtures are free to allow a 360-degree range of motion at an angle not less than 45 degrees from horizontal without contacting adjacent components. Alternatively, if rigidly supported and/or braced, they are free to move with the structure to which they are attached without damaging adjoining components. Additionally, the connection to the structure is capable of accommodating the movement without failure. (Tier 2: Sec. 13.7.9; Commentary: Sec. A.7.3.3)			X		Non-applicable due to ASCE 41 Performance Level: "Life Safety (LS)"
LF-3 Lens Covers. HR- not required; LS-not required; PR-H.	Lens covers on light fixtures are attached with safety devices. (Tier 2: Sec. 13.7.9; Commentary: Sec. A.7.3.4)			X		Non-applicable due to ASCE 41 Performance Level: "Life Safety (LS)"

Cladding and Glazing

EVALUATION ITEM	EVALUATION STATEMENT	С	NC	N/A	U	COMMENT
CG-1 Cladding Anchors. HR-MH; LS-MH; PR- MH.	Cladding components weighing more than 10 lb/ft2 (0.48 kN/m2) are mechanically anchored to the structure at a spacing equal to or less than the following: for Life Safety in Moderate Seismicity, 6 ft (1.8 m); for Life Safety in High Seismicity and for Position Retention in any seismicity, 4 ft (1.2 m) (Tier 2: Sec. 13.6.1; Commentary: Sec. A.7.4.1)			X		
CG-2 Cladding Isolation. HR-not required; LS- MH; PR-MH.	For steel or concrete moment-frame buildings, panel connections are detailed to accommodate a story drift ratio by the use of rods attached to framing with oversize holes or slotted holes of at least the following: for Life Safety in Moderate Seismicity, 0.01; for Life Safety in High Seismicity and for Position Retention in any seismicity, 0.02, and the rods have a length-to-diameter ratio of 4.0 or less. (Tier 2: Sec. 13.6.1; Commentary: Sec. A.7.4.3)			X		

CG-3 Multi-Story Panels. HR-MH; LS-MH; PR- MH.	For multi-story panels attached at more than one floor level, panel connections are detailed to accommodate a story drift ratio by the use of rods attached to framing with oversize holes or slotted holes of at least the following: for Life Safety in Moderate Seismicity, 0.01; for Life Safety in High Seismicity and for Position Retention in any seismicity, 0.02, and the rods have a length-to-diameter ratio of 4.0 or less. (Tier 2: Sec. 13.6.1; Commentary: Sec. A.7.4.4)		X		
CG-4 Threaded Rods. HR-not required; LS- MH; PR-MH.	Threaded rods for panel connections detailed to accommodate drift by bending of the rod have a length-to-diameter ratio greater than 0.06 times the story height in inches for Life Safety in Moderate Seismicity and 0.12 times the story height in inches for Life Safety in High Seismicity and Position Retention in any seismicity. (Tier 2: Sec. 13.6.1; Commentary: Sec. A.7.4.9)		X		
CG-5 Panel Connections. HR-MH; LS-MH; PR- MH.	Cladding panels are anchored out of plane with a minimum number of connections for each wall panel, as follows: for Life Safety in Moderate Seismicity, 2 connections; for Life Safety in High Seismicity and for Position Retention in any seismicity, 4 connections. (Tier 2: Sec. 13.6.1.4; Commentary: Sec. A.7.4.5)		X		
CG-6 Bearing Connections. HR-MH; LS-MH; PR-MH.	Where bearing connections are used, there is a minimum of two bearing connections for each cladding panel. (Tier 2: Sec. 13.6.1.4; Commentary: Sec. A.7.4.6)		X		
CG-7 Inserts. HR-MH; LS-MH; PR-MH.	Where concrete cladding components use inserts, the inserts have positive anchorage or are anchored to reinforcing steel. (Tier 2: Sec. 13.6.1.4; Commentary: Sec. A.7.4.7)		X		
CG-8 Overhead Glazing. HR-not required; LS- MH; PR-MH.	Glazing panes of any size in curtain walls and individual interior or exterior panes more than 16 ft2 (1.5 m2) in area are laminated annealed or laminated heat-strengthened glass and are detailed to remain in the frame when cracked. (Tier 2: Sec. 13.6.1.5; Commentary: Sec. A.7.4.8)			X	Further investigation is required to review acoustical tile/panel ceilings for proper seismic joint layout.

Masonry Veneer

EVALUATION ITEM	EVALUATION STATEMENT	С	NC	N/A	U	COMMENT
M-1 Ties. HR-not required; LS-LMH; PR- LMH.	Masonry veneer is connected to the backup with corrosion-resistant ties. There is a minimum of one tie for every 2-2/3 ft2 (0.25 m2), and the ties have spacing no greater than the following: for Life Safety in Low or Moderate Seismicity, 36 in. (914 mm); for Life Safety in High Seismicity and for Position Retention in any seismicity, 24 in. (610 mm). (Tier 2: Sec. 13.6.1.2; Commentary: Sec. A.7.5.1)				X	Ties are present, but spacing is unknown. Further investigation is required to verify detailing of masonry veneer ties.
M-2 Shelf Angles. HR- not required; LS-LMH; PR-LMH.	Masonry veneer is supported by shelf angles or other elements at each floor above the ground floor. (Tier 2: Sec. 13.6.1.2; Commentary: Sec. A.7.5.2)				X	Further investigation is required to verify method of support of masonry veneer at each floor above grade.
M-3 Weakened Planes. HR-not required; LS- LMH; PR-LMH.	Masonry veneer is anchored to the backup adjacent to weakened planes, such as at the locations of flashing. (Tier 2: Sec. 13.6.1.2; Commentary: Sec. A.7.5.3)				X	Further investigation is required to verify anchorage of masonry veneer at weakened planes.
M-4 Unreinforced Masonry Backup. HR- LMH; LS-LMH; PR- LMH.	There is no unreinforced masonry backup. (Tier 2: Sec. 13.6.1.1, 13.6.1.2; Commentary: Sec. A.7.7.2)		X			URM backup is present. Further investigation is required to determine the state of the URM backup and to develop a mitigation recommendation, if necessary.
M-5 Stud Tracks. HR-not required; LS-MH; PR- MH.	For veneer with coldformed steel stud backup, stud tracks are fastened to the structure at a spacing equal to or less than 24 in. (610 mm) on center. (Tier 2: Sec. 13.6.1.1, 13.6.1.2; Commentary: Sec. A.7.6.)			X		
M-6 Anchorage. HR-not required; LS-MH; PR-MH.	For veneer with concrete block or masonry backup, the backup is positively anchored to the structure at a horizontal spacing equal to or less than 4 ft along the floors and roof. (Tier 2: Sec. 13.6.1.1, 13.6.1.2; Commentary: Sec. A.7.7.1)		X			Inadequate anchorage of backup to the main structure. Installation of additional backup anchorage may be necessary. Further investigation is required.
M-7 Weep Holes. HR-not required; LS-not required; PR-MH.	In veneer anchored to stud walls, the veneer has functioning weep holes and base flashing. (Tier 2: Sec. 13.6.1.2; Commentary: Sec. A.7.5.6)			X		Non-applicable due to ASCE 41 Performance Level: "Life Safety (LS)"
M-8 Openings. HR-not required; LS-not required; PR-MH.	For veneer with cold-formed-steel stud backup, steel studs frame window and door openings. (Tier 2: Sec. 13.6.1.1, 13.6.1.2; Commentary: Sec. A.7.6.2)			X		Non-applicable due to ASCE 41 Performance Level: "Life Safety (LS)"

Parapets, Cornices, Ornamentation, and Appendages

EVALUATION ITEM	EVALUATION STATEMENT	C	NC	N/A	U	COMMENT
PCOA-1 URM Parapets or Cornices. HR-LMH; LS-LMH; PR-LMH.	Laterally unsupported unreinforced masonry parapets or cornices have height-tothickness ratios no greater than the following: for Life Safety in Low or Moderate Seismicity, 2.5; for Life Safety in High Seismicity and for Position Retention in any seismicity, 1.5. (Tier 2: Sec. 13.6.5; Commentary: Sec. A.7.8.1)			X		
PCOA-2 Canopies. HR-not required; LS-LMH; PR-LMH.	Canopies at building exits are anchored to the structure at a spacing no greater than the following: for Life Safety in Low or Moderate Seismicity, 10 ft (3.0 m); for Life Safety in High Seismicity and for Position Retention in any seismicity, 6 ft (1.8 m). (Tier 2: Sec. 13.6.6; Commentary: Sec. A.7.8.2)			X		
PCOA-3 Concrete Parapets. HR-H; LS-MH; PR-LMH.	Concrete parapets with height-to-thickness ratios greater than 2.5 have vertical reinforcement. (Tier 2: Sec. 13.6.5; Commentary: Sec. A.7.8.3)			X		
PCOA-4 Appendages. HR-MH; LS-MH; PR- LMH.	Cornices, parapets, signs, and other ornamentation or appendages that extend above the highest point of anchorage to the structure or cantilever from components are reinforced and anchored to the structural system at a spacing equal to or less than 6 ft (1.8 m). This evaluation statement item does not apply to parapets or cornices covered by other evaluation statements. (Tier 2: Sec. 13.6.6; Commentary: Sec. A.7.8.4)			X		

Masonry Chimneys

EVALUATION ITEM	EVALUATION STATEMENT	С	NC	N/A	U	COMMENT
MC-1 URM Chimneys. HR-LMH; LS-LMH; PR- LMH.	Unreinforced masonry chimneys extend above the roof surface no more than the following: for Life Safety in Low or Moderate Seismicity, 3 times the least dimension of the chimney; for Life Safety in High Seismicity and for Position Retention in any seismicity, 2 times the least dimension of the chimney. (Tier 2: Sec. 13.6.7; Commentary: Sec. A.7.9.1)	X				
MC-2 Anchorage. HR- LMH; LS-LMH; PR- LMH.	Masonry chimneys are anchored at each floor level, at the topmost ceiling level, and at the roof. (Tier 2: Sec. 13.6.7; Commentary: Sec. A.7.9.2)				X	Further investigation is required to verify masonry chimney anchorage.

Stairs

EVALUATION ITEM	EVALUATION STATEMENT	С	NC	N/A	U	COMMENT
S-1 Stair Enclosures. HR-not required; LS- LMH; PR-LMH.	Hollow-clay tile or unreinforced masonry walls around stair enclosures are restrained out of plane and have height-to-thickness ratios not greater than the following: for Life Safety in Low or Moderate Seismicity, 15-to-1; for Life Safety in High Seismicity and for Position Retention in any seismicity, 12-to-1. (Tier 2: Sec. 13.6.2, 13.6.8; Commentary: Sec. A.7.10.1)			X		Concrete walls at stairs
S-2 Stair Details. HR-not required; LS-LMH; PR- LMH.	The connection between the stairs and the structure does not rely on post-installed anchors in concrete or masonry, and the stair details are capable of accommodating the drift calculated using the Quick Check procedure of Section 4.4.3.1 for moment-frame structures or 0.5 in. for all other structures without including any lateral stiffness contribution from the stairs. (Tier 2: Sec. 13.6.8; Commentary: Sec. A.7.10.2)				X	Further investigation is required to verify stair connections.

Contents and Furnishings

EVALUATION ITEM	EVALUATION STATEMENT	С	NC	N/A	U	COMMENT
CF-1 Industrial Storage Racks. HR-LMH; LS- MH; PR-MH.	Industrial storage racks or pallet racks more than 12 ft high meet the requirements of ANSI/RMI MH 16.1 as modified by ASCE 7, Chapter 15. (Tier 2: Sec. 13.8.1; Commentary: Sec. A.7.11.1)			X		
CF-2 Tall Narrow Contents. HR-not required; LS-H; PR-MH.	Contents more than 6 ft (1.8 m) high with a height-to-depth or height-to-width ratio greater than 3-to-1 are anchored to the structure or to each other. (Tier 2: Sec. 13.8.2; Commentary: Sec. A.7.11.2)		X			Anchorage is required at tall narrow contents more than six feet high to provide overturning restraint.
CF-3 Fall-Prone Contents. HR-not required; LS-H; PR-H.	Equipment, stored items, or other contents weighing more than 20 lb (9.1 kg) whose center of mass is more than 4 ft (1.2 m) above the adjacent floor level are braced or otherwise restrained. (Tier 2: Sec. 13.8.2; Commentary: Sec. A.7.11.3)			X		
CF-4 Access Floors. HR- not required; LS-not required; PR-MH.	Access floors more than 9 in. (229 mm) high are braced. (Tier 2: Sec. 13.6.10; Commentary: Sec. A.7.11.4)			X		Non-applicable due to ASCE 41 Performance Level: "Life Safety (LS)"
CF-5 Equipment on Access Floors. HR-not required; LS-not required; PR-MH.	Equipment and other contents supported by access floor systems are anchored or braced to the structure independent of the access floor. (Tier 2: Sec. 13.7.7 13.6.10; Commentary: Sec. A.7.11.5)			X		Non-applicable due to ASCE 41 Performance Level: "Life Safety (LS)"

CF-6 Suspended	Items suspended without lateral bracing are free			
Contents. HR-not	to swing from or move with the structure from			Non-applicable due to
required; LS-not	which they are suspended without damaging		X	ASCE 41 Performance
required; PR-H.	themselves or adjoining components. (Tier 2:			Level: "Life Safety (LS)"
required; PK-II.	Sec. 13.8.2; Commentary: Sec. A.7.11.6)			

Mechanical and Electrical Equipment

EVALUATION ITEM	EVALUATION STATEMENT	С	NC	N/A	U	COMMENT
ME-1 Fall-Prone Equipment. HR-not required; LS-H; PR-H.	Equipment weighing more than 20 lb (9.1 kg) whose center of mass is more than 4 ft (1.2 m) above the adjacent floor level, and which is not in-line equipment, is braced. (Tier 2: Sec. 13.7.1 13.7.7; Commentary: Sec. A.7.12.4)			X		
ME-2 In-Line Equipment. HR-not required; LS-H; PR-H.	Equipment installed in line with a duct or piping system, with an operating weight more than 75 lb (34.0 kg), is supported and laterally braced independent of the duct or piping system. (Tier 2: Sec. 13.7.1; Commentary: Sec. A.7.12.5)				X	This evaluation item could not be visually verified. Further investigation is required to review vertical support and lateral bracing of equipment.
ME-3 Tall Narrow Equipment. HR-not required; LS-H; PR-MH.	Equipment more than 6 ft (1.8 m) high with a height-to-depth or height-to-width ratio greater than 3-to-1 is anchored to the floor slab or adjacent structural walls. (Tier 2: Sec. 13.7.1 13.7.7; Commentary: Sec. A.7.12.6)		X			Anchorage is required at tall narrow equipment more than six feet high to provide overturning restraint.
ME-4 Mechanical Doors. HR-not required; LS-not required; PR-MH.	Mechanically operated doors are detailed to operate at a story drift ratio of 0.01. (Tier 2: Sec. 13.6.9; Commentary: Sec. A.7.12.7)			X		Non-applicable due to ASCE 41 Performance Level: "Life Safety (LS)"
ME-5 Suspended Equipment. HR-not required; LS-not required; PR-H.	Equipment suspended without lateral bracing is free to swing from or move with the structure from which it is suspended without damaging itself or adjoining components. (Tier 2: Sec. 13.7.1, 13.7.7; Commentary: Sec. A.7.12.8)			X		Non-applicable due to ASCE 41 Performance Level: "Life Safety (LS)"
ME-6 Vibration Isolators. HR-not required; LS-not required; PR-H.	Equipment mounted on vibration isolators is equipped with horizontal restraints or snubbers and with vertical restraints to resist overturning. (Tier 2: Sec. 13.7.1; Commentary: Sec. A.7.12.9)			X		Non-applicable due to ASCE 41 Performance Level: "Life Safety (LS)"
ME-7 Heavy Equipment. HR-not required; LS-not required; PR-H.	Floor supported or platform-supported equipment weighing more than 400 lb (181.4 kg) is anchored to the structure. (Tier 2: Sec. 13.7.1, 13.7.7; Commentary: Sec. A.7.12.10)			X		Non-applicable due to ASCE 41 Performance Level: "Life Safety (LS)"
ME-8 Electrical Equipment. HR-not required; LS-not required; PR-H.	Electrical equipment is laterally braced to the structure. (Tier 2: Sec. 13.7.7; Commentary: Sec. A.7.12.11)			X		Non-applicable due to ASCE 41 Performance Level: "Life Safety (LS)"

	Conduit greater than 2.5 in. (64 mm) trade size			
ME-9 Conduit	that is attached to panels, cabinets, or other			Non-applicable due to
Couplings. HR-not	equipment and is subject to relative seismic		X	ASCE 41 Performance
required; LS-not	displacement has flexible couplings or		Λ	Level: "Life Safety (LS)"
required; PR-H.	connections. (Tier 2: Sec. 13.7.8; Commentary:			Level: Life Safety (LS)
	Sec. A.7.12.12)			

Piping

EVALUATION ITEM	EVALUATION STATEMENT	С	NC	N/A	U	COMMENT
PP-1 Flexible Couplings. HR-not required; LS-not required; PR-H.	Fluid and gas piping has flexible couplings. (Tier 2: Sec. 13.7.3, 13.7.5; Commentary: Sec. A.7.13.2)			X		Non-applicable due to ASCE 41 Performance Level: "Life Safety (LS)"
PP-2 Fluid and Gas Piping. HR-not required; LS-not required; PR-H.	Fluid and gas piping is anchored and braced to the structure to limit spills or leaks. (Tier 2: Sec. 13.7.3, 13.7.5; Commentary: Sec. A.7.13.4)			X		Non-applicable due to ASCE 41 Performance Level: "Life Safety (LS)"
PP-3 C-Clamps. HR-not required; LS-not required; PR-H.	One-sided C-clamps that support piping larger than 2.5 in. (64 mm) in diameter are restrained. (Tier 2: Sec. 13.7.3, 13.7.5; Commentary: Sec. A.7.13.5)			X		Non-applicable due to ASCE 41 Performance Level: "Life Safety (LS)"
PP-4 Piping Crossing Seismic Joints. HR-not required; LS-not required; PR-H.	Piping that crosses seismic joints or isolation planes or is connected to independent structures has couplings or other details to accommodate the relative seismic displacements. (Tier 2: Sec. 13.7.3, 13.7.5; Commentary: Sec. A.7.13.6)			X		Non-applicable due to ASCE 41 Performance Level: "Life Safety (LS)"

Ducts

EVALUATION ITEM	EVALUATION STATEMENT	С	NC	N/A	U	COMMENT
D-1 Duct Bracing. HR- not required; LS-not required; PR-H.	Rectangular ductwork larger than 6 ft2 (0.56 m2) in cross-sectional area and round ducts larger than 28 in. (711 mm) in diameter are braced. The maximum spacing of transverse bracing does not exceed 30 ft (9.2 m). The maximum spacing of longitudinal bracing does not exceed 60 ft (18.3 m). (Tier 2: Sec. 13.7.6; Commentary: Sec. A.7.14.2)			X		Non-applicable due to ASCE 41 Performance Level: "Life Safety (LS)"
D-2 Duct Support. HR- not required; LS-not required; PR-H.	Ducts are not supported by piping or electrical conduit. (Tier 2: Sec. 13.7.6; Commentary: Sec. A.7.14.3)			X		Non-applicable due to ASCE 41 Performance Level: "Life Safety (LS)"
D-3 Ducts Crossing Seismic Joints. HR-not required; LS-not required; PR-H.	Ducts that cross seismic joints or isolation planes or are connected to independent structures have couplings or other details to accommodate the relative seismic displacements. (Tier 2: Sec. 13.7.6; Commentary: Sec. A.7.14.4)			X		Non-applicable due to ASCE 41 Performance Level: "Life Safety (LS)"

Elevators

EVALUATION ITEM	EVALUATION STATEMENT	C	NC	N/A	U	COMMENT
EL-1 Retainer Guards. HR-not required; LS-H; PR-H.	Sheaves and drums have cable retainer guards. (Tier 2: Sec. 13.7.11; Commentary: Sec. A.7.16.1)				X	Further investigation is required to verify elevator sheaves and drums have cable retainer guards.
EL-2 Retainer Plate. HR- not required; LS-H; PR- H.	A retainer plate is present at the top and bottom of both car and counterweight. (Tier 2: Sec. 13.7.11; Commentary: Sec. A.7.16.2)				X	Further investigation is required to verify proper installation of retainer plates.
EL-3 Elevator Equipment. HR-not required; LS-not required; PR-H.	Equipment, piping, and other components that are part of the elevator system are anchored. (Tier 2: Sec. 13.7.11; Commentary: Sec. A.7.16.3)			X		Non-applicable due to ASCE 41 Performance Level: "Life Safety (LS)"
EL-4 Seismic Switch. HR-not required; LS-not required; PR-H.	Elevators capable of operating at speeds of 150 ft/min or faster are equipped with seismic switches that meet the requirements of ASME A17.1 or have trigger levels set to 20% of the acceleration of gravity at the base of the structure and 50% of the acceleration of gravity in other locations. (Tier 2: Sec. 13.7.11; Commentary: Sec. A.7.16.4)			X		Non-applicable due to ASCE 41 Performance Level: "Life Safety (LS)"
EL-5 Shaft Walls. HR- not required; LS-not required; PR-H.	Elevator shaft walls are anchored and reinforced to prevent toppling into the shaft during strong shaking. (Tier 2: Sec. 13.7.11; Commentary: Sec. A.7.16.5)			X		Non-applicable due to ASCE 41 Performance Level: "Life Safety (LS)"
EL-6 Counterweight Rails. HR-not required; LS-not required; PR-H.	All counterweight rails and divider beams are sized in accordance with ASME A17.1. (Tier 2: Sec. 13.7.11; Commentary: Sec. A.7.16.6)			X		Non-applicable due to ASCE 41 Performance Level: "Life Safety (LS)"
EL-7 Brackets. HR-not required; LS-not required; PR-H.	The brackets that tie the car rails and the counterweight rail to the structure are sized in accordance with ASME A17.1. (Tier 2: Sec. 13.7.11; Commentary: Sec. A.7.16.7)			X		Non-applicable due to ASCE 41 Performance Level: "Life Safety (LS)"
EL-8 Spreader Bracket. HR-not required; LS-not required; PR-H.	Spreader brackets are not used to resist seismic forces. (Tier 2: Sec. 13.7.11; Commentary: Sec. A.7.16.8)			X		Non-applicable due to ASCE 41 Performance Level: "Life Safety (LS)"
EL-9 Go-Slow Elevators. HR-not required; LS-not required; PR-H.	The building has a go-slow elevator system. (Tier 2: Sec. 13.7.11; Commentary: Sec. A.7.16.9)			X		Non-applicable due to ASCE 41 Performance Level: "Life Safety (LS)"

1. White Salmon Valley, Wayne M. Henkle Middle School, Middle School

1.1 Building Description

Building Name: Middle School

Facility Name: Wayne M. Henkle Middle

School

1960

High

District Name: White Salmon Valley

ICOS Latitude: 45.74
ICOS Longitude: -121.494

ICOS

Year Built:

County/District ID: 20405

ICOS Building ID: 22355
ASCE 41 Bldg Type: RM1
Enrollment: 195

Gross Sq. Ft. : 36,587

Number of Stories: 1

S_{XS BSE-2E}: 0.466

S_{X1 BSE-2E:} 0.292

ASCE 41 Level of

Seismicity:

Site Class: C

V_{S30}(m/s): 380

Liquefaction

Very Low

Potential:

Tsunami Risk: None

Structural Drawings

Available:

Yes

Evaluating Firm: WRK Engineers

Google, data ©2019 Imagery ©2019, DigitalGlobe, State of Oregon, USDA Farm Service Agency



The Wayne M. Henkle Middle School building is a one-story building with a mixture of masonry and wood-framed construction. Additions and alterations to the building were constructed in 1990. The gymnasium is constructed out of reinforced CMU. The upper half of the gymnasium walls are wood stud walls. The multi-purpose room is constructed out of unreinforced masonry walls and reinforced masonry walls. The 1960 building is constructed on level ground and is located in White Salmon, Washington. The building is L-shaped in plan, 342 feet by 347 feet, with a maximum roof height of 26 feet at the gymnasium and 16 feet at the lower roof. Building construction consists of reinforced CMU walls, wood stud walls, and brick veneer. The roof system is TJI joists and plywood sheathing. The gymnasium roof system is glulam arches, dimensional lumber joists, and plywood sheathing.

1.1.1 Building Use

The Wayne M. Henkle Middle School building consists of classrooms, a multi-purpose room, a library, administrative offices, and a gymnasium. The middle school has over 190 student occupants.

1.1.2 Structural System

Table 1.1-1. Structural System Description of Wayne M. Henkle Middle School

Structural System	Description
Structural Roof	The roof system is composed of TJI joists and plywood sheathing at the addition
Structural Roof	and dimensional lumber joists at the existing roofing.
Structural Floor(s)	The ground level is a concrete floor slab.
Foundations	The load bearing walls and shear walls are supported by continuous wall
roundations	footings. Columns are supported by spread footings.
Gravity System	The gravity system is composed of wood beams and columns, steel columns,
	reinforced masonry bearing walls, URM walls, and wood stud bearing walls.
Lataral System	The lateral system is a mixture of 8-inch reinforced CMU walls, double wythe
Lateral System	URM walls, and 2x6 wood shear walls.

1.1.3 Structural System Visual Condition

Table 1.1-2. Structural System Condition Description of Wayne M. Henkle Middle School

Structural System	Description
Structural Roof	No visible signs of corrosion, damage, or deterioration.
Structural Floor(s)	No visible signs of corrosion, damage, or deterioration.
Foundations	Unknown.
Gravity System	Some cracking observed in masonry walls and exterior brick.
Lateral System	Some cracking observed in masonry walls and exterior brick.

1.2 Seismic Evaluation Findings

1.2.1 Structural Seismic Deficiencies

The structural seismic deficiencies identified during the Tier 1 evaluation are summarized below. Commentary for each deficiency is also provided based on this evaluation.

Table 1-3. Identified Structural Seismic Deficiencies for White Salmon Valley Wayne M. Henkle Middle School Middle School

Deficiency	Description
Load Path	Lack of connection between the diaphragm, the CMU shear walls, and the out-of-plane wall anchorage connections. The addition of post-installed structural connections for in-plane and out-of-plane resistance is required.
Shear Stress Check	Shear stress in RM1 walls is compliant. However, corresponding shear stress in wood shear walls and URM walls is non-compliant. The building will likely require wood and URM shear wall strengthening or the addition of new shear walls. Further investigation is required.
Wall Anchorage	CMU walls at gymnasium are only CMU partial-height. Therefore, there is no anchorage to the roof diaphragm. No wall anchorage at URM walls exists. Tension ties, blocking, strapping, and diaphragm nailing required along CMU and URM walls to connect the walls to the diaphragm for out-of-plane forces.
Cross Ties	There are no continuous cross ties between diaphragm chords. The addition of new cross ties between diaphragm chords or the addition of strap plates to connect existing framing members together may be appropriate.
Diagonally	
Sheathed and	Diaphragm is unblocked with spans greater than 40 feet in locations. Diaphragm strengthening through the
Unblocked	addition of blocking and additional diaphragm nailing may be appropriate to mitigate seismic risk.
Diaphragms	

1.2.2 Structural Checklist Items Marked as 'U'nknown

Where building structural component seismic adequacy was unknown due to lack of available information or limited observation, the structural checklist items were marked as "unknown". These items require further investigation if definitive determination of compliance or noncompliance is desired. The unknown structural checklist items identified during the Tier 1 evaluation are summarized below. Commentary for each unknown item is also provided based on the evaluation.

Table 1-4. Identified Structural Checklist Items Marked as Unknown for White Salmon Valley Wayne M. Henkle Middle School Middle School

Unknown Item	Description
	The liquefaction potential of site soils is unknown at this time given available information. Very low
Liquefaction	liquefaction potential is identified per ICOS based on state geologic mapping. Requires further investigation by
	a licensed geotechnical engineer to determine liquefaction potential.
Slope Failure	Requires further investigation by a licensed geotechnical engineer to determine susceptibility to slope failure.
Surface Fault	Requires further investigation by a licensed geotechnical engineer to determine whether site is near locations of
Rupture	expected surface fault ruptures.
Transfer to Shear	No verified connection of diaphragm to CMU at Gridlines C and K between Gridlines 3 and 4. URM wall
Walls	along Gridlines S and T does not have connection detail verified. The addition of post-installed anchors may be
waiis	appropriate.
Stiffness of Wall	This evaluation item is unknown and could not be visually verified. This item requires further investigation to
Anchors	make a final determination on its compliance and to develop a mitigation recommendation, if necessary.

1.3.1 Nonstructural Seismic Deficiencies

The nonstructural seismic deficiencies identified during the Tier 1 evaluation are summarized below. Commentary for each deficiency is also provided based on this evaluation. Some nonstructural deficiencies may be able to be mitigated by school district staff. Other nonstructural components that require more substantial mitigation may be more appropriately included in a long-term mitigation strategy. Some typical conceptual details for the seismic upgrade of nonstructural components can be found in the FEMA E-74 Excerpts appendix.

Table 1-5. Identified Nonstructural Seismic Deficiencies for White Salmon Valley Wayne M. Henkle Middle School Middle School

Deficiency	Description
P-1 Unreinforced Masonry. HR-LMH; LS-LMH; PR- LMH.	Inadequate bracing for URM partitions. Unreinforced masonry partition walls should be braced or demolished.
CF-2 Tall Narrow Contents. HR-not required; LS-H; PR-MH.	Anchorage is required at tall narrow contents more than six feet high to provide overturning restraint.
CF-3 Fall-Prone Contents. HR-not required; LS-H; PR-H.	Anchorage is required for fall-prone contents weighing more than 20 pounds.
ME-3 Tall Narrow Equipment. HR-not required; LS-H; PR-MH.	Anchorage is required for tall narrow equipment more than six feet high to provide overturning restraint.

1.3.2 Nonstructural Checklist Items Marked as 'U'nknown

Where building nonstructural component seismic adequacy was unknown due to lack of available information or limited observation, the nonstructural checklist items were marked as "unknown". These items require further investigation if definitive determination of compliance or noncompliance is desired. The unknown nonstructural checklist items identified during the Tier 1 evaluation are summarized below. Commentary for each unknown item is also provided based on the evaluation.

Some nonstructural deficiencies may be able to be mitigated by school district staff. Other nonstructural components that require more substantial mitigation may be more appropriately included in a long-term mitigation strategy. Some typical conceptual details for the seismic upgrade of nonstructural components can be found in the FEMA E-74 Excerpts appendix.

Table 1-6. Identified Nonstructural Checklist Items Marked as Unknown for White Salmon Valley Wayne M. Henkle Middle School Middle School

Unknown Item	Description							
P-3 Drift. HR-not required;	Further investigation is required to verify detailing of rigid cementitious partitions for drift.							
LS-MH; PR-MH.	a transfer in the second of th							
C-2 Suspended Gypsum								
Board. HR-not required; LS-	Further investigation is required to review suspended ceiling attachments.							
MH; PR-LMH.								
LF-1 Independent Support.	Further investigation is required to review the support system for light fixtures. All light fixtures in							
HR-not required; LS-MH; PR-	grid ceiling system should have seismic bracing.							
MH.	grid certing system should have seisinic bracing.							
CG-8 Overhead Glazing. HR-	Further investigation is required to verify detailing of glazing panes.							
not required; LS-MH; PR-MH.	runner investigation is required to verify detaining of grazing panes.							
M-1 Ties. HR-not required;	Further investigation is required to verify detailing of masonry veneer ties.							
LS-LMH; PR-LMH.	Further investigation is required to verify detaining of masonly vehicle ties.							
M-3 Weakened Planes. HR-								
not required; LS-LMH; PR-	Further investigation is required to verify anchorage of masonry veneer at weakened planes.							
LMH.								
ME-2 In-Line Equipment. HR-	This evaluation item could not be visually verified. Further investigation is required to review							
not required; LS-H; PR-H.	vertical support and lateral bracing of equipment.							

Photos:

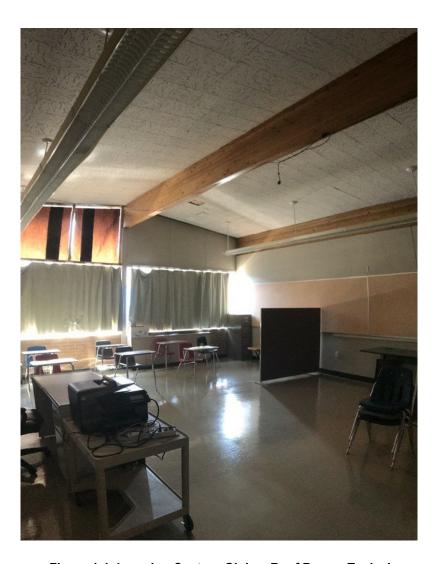


Figure 1-1. Learning Center - Glulam Roof Beams Typical



Figure 1-2. Unbraced Mechanical Equipment, Typical Throughout



Figure 1-3. Multipurpose Room with Glulam Arches

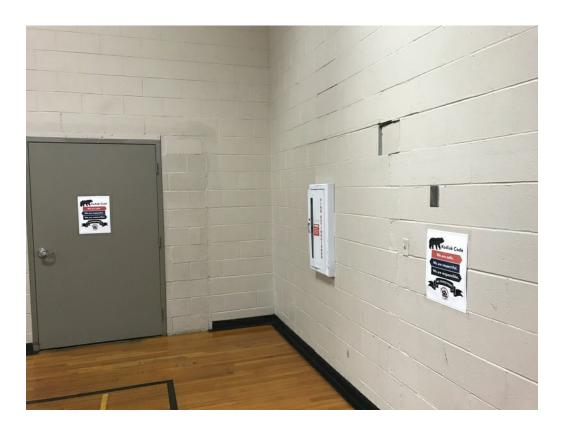


Figure 1-4. Damage to Interior CMU Walls



Figure 1-5. Typical Corridor with Unknown Light Fixture Bracing



Figure 1-6. Library



Figure 1-7. Wayne M. Henkle Middle School - South Exterior

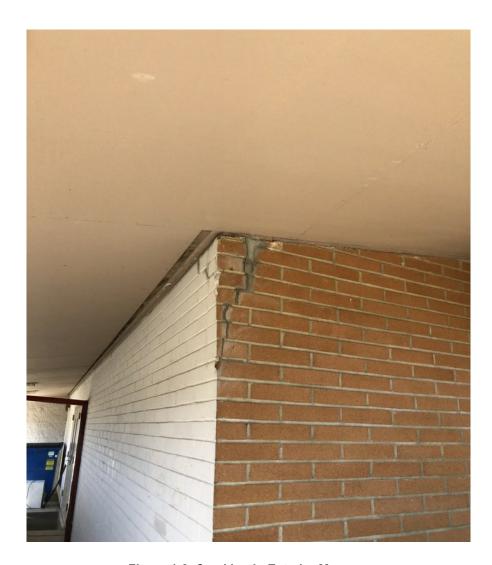


Figure 1-8. Cracking in Exterior Masonry

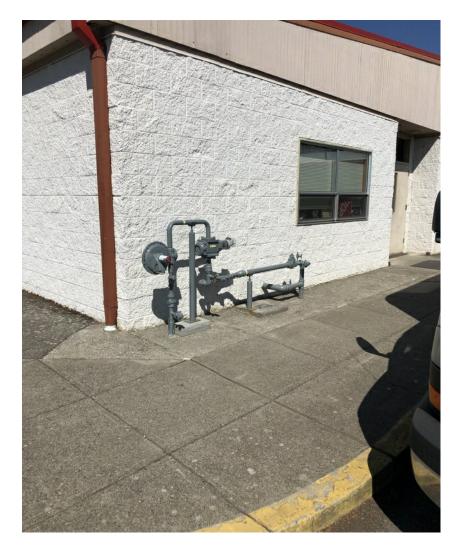


Figure 1-9. Gas Lines at South Exterior



Figure 1-10. Wayne M. Henkle Middle School - West Exterior

White Salmon Valley, Wayne M. Henkle Middle School, Middle School 17-2 Collapse Prevention Basic Configuration Checklist

Building record drawings have been reviewed, when available, and a non-destructive field investigation has been performed for the subject building. Each of the required checklist items are marked Compliant (C), Noncompliant (NC), Not Applicable (N/A), or Unknown (U). Items marked Compliant indicate conditions that satisfy the performance objective, whereas items marked Noncompliant or Unknown indicate conditions that do not. Certain statements might not apply to the building being evaluated.

Low Seismicity

Building System - General

EVALUATION ITEM	EVALUATION STATEMENT	С	NC	N/A	U	COMMENT
Load Path	The structure contains a complete, well-defined load path, including structural elements and connections, that serves to transfer the inertial forces associated with the mass of all elements of the building to the foundation. (Tier 2: Sec. 5.4.1.1; Commentary: Sec. A.2.1.10)		X			Lack of connection between the diaphragm, the CMU shear walls, and the out-of- plane wall anchorage connections. The addition of post-installed structural connections for in-plane and out-of-plane resistance is required.
Adjacent Buildings	The clear distance between the building being evaluated and any adjacent building is greater than 0.25% of the height of the shorter building in low seismicity, 0.5% in moderate seismicity, and 1.5% in high seismicity. (Tier 2: Sec. 5.4.1.2; Commentary: Sec. A.2.1.2)	X				
Mezzanines	Interior mezzanine levels are braced independently from the main structure or are anchored to the seismic-force-resisting elements of the main structure. (Tier 2: Sec. 5.4.1.3; Commentary: Sec. A.2.1.3)			X		

Building System - Building Configuration

EVALUATION ITEM	EVALUATION STATEMENT	С	NC	N/A	U	COMMENT
Weak Story	The sum of the shear strengths of the seismic- force-resisting system in any story in each direction is not less than 80% of the strength in the adjacent story above. (Tier 2: Sec. 5.4.2.1; Commentary: Sec. A.2.2.2)			X		
Soft Story	The stiffness of the seismic-force-resisting system in any story is not less than 70% of the seismic-force-resisting system stiffness in an adjacent story above or less than 80% of the average seismic-force-resisting system stiffness of the three stories above. (Tier 2: Sec. 5.4.2.2; Commentary: Sec. A.2.2.3)			X		

Vertical Irregularities	All vertical elements in the seismic-forceresisting system are continuous to the foundation. (Tier 2: Sec. 5.4.2.3; Commentary: Sec. A.2.2.4)		X	
Geometry	There are no changes in the net horizontal dimension of the seismic-force-resisting system of more than 30% in a story relative to adjacent stories, excluding one-story penthouses and mezzanines. (Tier 2: Sec. 5.4.2.4; Commentary: Sec. A.2.2.5)		X	
Mass	There is no change in effective mass of more than 50% from one story to the next. Light roofs, penthouses, and mezzanines need not be considered. (Tier 2: Sec. 5.4.2.5; Commentary: Sec. A.2.2.6)		X	
Torsion	The estimated distance between the story center of mass and the story center of rigidity is less than 20% of the building width in either plan dimension. (Tier 2: Sec. 5.4.2.6; Commentary: Sec. A.2.2.7)	X		

${\bf Moderate\ Seismicity\ (Complete\ the\ Following\ Items\ in\ Addition\ to\ the\ Items\ for\ Low\ Seismicity)}$

Geologic Site Hazards

EVALUATION ITEM	EVALUATION STATEMENT	С	NC	N/A	U	COMMENT
Liquefaction	Liquefaction-susceptible, saturated, loose granular soils that could jeopardize the building's seismic performance do not exist in the foundation soils at depths within 50 ft (15.2 m) under the building. (Tier 2: Sec. 5.4.3.1; Commentary: Sec. A.6.1.1)				X	The liquefaction potential of site soils is unknown at this time given available information. Very low liquefaction potential is identified per ICOS based on state geologic mapping. Requires further investigation by a licensed geotechnical engineer to determine liquefaction potential.
Slope Failure	The building site is located away from potential earthquake-induced slope failures or rockfalls so that it is unaffected by such failures or is capable of accommodating any predicted movements without failure. (Tier 2: Sec. 5.4.3.1; Commentary: Sec. A.6.1.2)				X	Requires further investigation by a licensed geotechnical engineer to determine susceptibility to slope failure.
Surface Fault Rupture	Surface fault rupture and surface displacement at the building site are not anticipated. (Tier 2: Sec. 5.4.3.1; Commentary: Sec. A.6.1.3)				X	Requires further investigation by a licensed geotechnical engineer to determine whether site is near locations of expected surface fault ruptures.

High Seismicity (Complete the Following Items in Addition to the Items for Low and Moderate Seismicity)

Foundation Configuration

EVALUATION ITEM	EVALUATION STATEMENT	С	NC	N/A	U	COMMENT
Overturning	The ratio of the least horizontal dimension of the seismic-force-resisting system at the foundation level to the building height (base/height) is greater than 0.6Sa. (Tier 2: Sec. 5.4.3.3; Commentary: Sec. A.6.2.1)	X				
Ties Between Foundation Elements	The foundation has ties adequate to resist seismic forces where footings, piles, and piers are not restrained by beams, slabs, or soils classified as Site Class A, B, or C. (Tier 2: Sec. 5.4.3.4; Commentary: Sec. A.6.2.2)			X		

17-34 Collapse Prevention Structural Checklist for Building Types RM1 and RM2

Building record drawings have been reviewed, when available, and a non-destructive field investigation has been performed for the subject building. Each of the required checklist items are marked Compliant (C), Noncompliant (NC), Not Applicable (N/A), or Unknown (U). Items marked Compliant indicate conditions that satisfy the performance objective, whereas items marked Noncompliant or Unknown indicate conditions that do not. Certain statements might not apply to the building being evaluated.

Low and Moderate Seismicity

Seismic-Force-Resisting System

EVALUATION ITEM	EVALUATION STATEMENT	С	NC	N/A	U	COMMENT
Redundancy	The number of lines of shear walls in each principal direction is greater than or equal to 2. (Tier 2: Sec. 5.5.1.1; Commentary: Sec. A.3.2.1.1)	X				
Shear Stress Check	The shear stress in the reinforced masonry shear walls, calculated using the Quick Check procedure of Section 4.4.3.3, is less than 70 lb/in.2 (0.48 MPa). (Tier 2: Sec. 5.5.3.1.1; Commentary: Sec. A.3.2.4.1)		X			Shear stress in RM1 walls is compliant. However, corresponding shear stress in wood shear walls and URM walls is non-compliant. The building will likely require wood and URM shear wall strengthening or the addition of new shear walls. Further investigation is required.
Reinforcing Steel	The total vertical and horizontal reinforcing steel ratio in reinforced masonry walls is greater than 0.002 of the wall with the minimum of 0.0007 in either of the two directions; the spacing of reinforcing steel is less than 48 in. (1220 mm), and all vertical bars extend to the top of the walls. (Tier 2: Sec. 5.5.3.1.3; Commentary: Sec. A.3.2.4.2)	X				

Stiff Diaphragms

EVALUATION ITEM	EVALUATION STATEMENT	С	NC	N/A	U	COMMENT
Topping Slab	Precast concrete diaphragm elements are interconnected by a continuous reinforced concrete topping slab. (Tier 2: Sec. 5.6.4; Commentary: Sec. A.4.5.1)			X		

Connections

EVALUATION ITEM	EVALUATION STATEMENT	С	NC	N/A	U	COMMENT

Wall Anchorage	Exterior concrete or masonry walls that are dependent on the diaphragm for lateral support are anchored for out-of-plane forces at each diaphragm level with steel anchors, reinforcing dowels, or straps that are developed into the diaphragm. Connections have strength to resist the connection force calculated in the Quick Check procedure of Section 4.4.3.7. (Tier 2: Sec. 5.7.1.1; Commentary: Sec. A.5.1.1)		X			CMU walls at gymnasium are only CMU partial-height. Therefore, there is no anchorage to the roof diaphragm. No wall anchorage at URM walls exists. Tension ties, blocking, strapping, and diaphragm nailing required along CMU and URM walls to connect the walls to the diaphragm for out-of-plane forces.
Wood Ledgers	The connection between the wall panels and the diaphragm does not induce cross-grain bending or tension in the wood ledgers. (Tier 2: Sec. 5.7.1.3; Commentary: Sec. A.5.1.2)			X		
Transfer to Shear Walls	Diaphragms are connected for transfer of seismic forces to the shear walls. (Tier 2: Sec. 5.7.2; Commentary: Sec. A.5.2.1)				X	No verified connection of diaphragm to CMU at Gridlines C and K between Gridlines 3 and 4. URM wall along Gridlines S and T does not have connection detail verified. The addition of post-installed anchors may be appropriate.
Topping Slab to Walls or Frames	Reinforced concrete topping slabs that interconnect the precast concrete diaphragm elements are doweled for transfer of forces into the shear wall or frame elements. (Tier 2: Sec. 5.7.2; Commentary: Sec. A.5.2.)			X		
Foundation Dowels	Wall reinforcement is doweled into the foundation. (Tier 2: Sec. 5.7.3.4; Commentary: Sec. A.5.3.5)	X				
Girder-Column Connection	There is a positive connection using plates, connection hardware, or straps between the girder and the column support. (Tier 2: Sec. 5.7.4.1; Commentary: Sec. A.5.4.1)	X				

High Seismicity (Complete the Following Items in Addition to the Items for Low and Moderate Seismicity)

Stiff Diaphragms

EVALUATION ITEM	EVALUATION STATEMENT	С	NC	N/A	U	COMMENT
Openings at Shear Walls	Diaphragm openings immediately adjacent to the shear walls are less than 25% of the wall length. (Tier 2: Sec. 5.6.1.3; Commentary: Sec. A.4.1.4)			X		
	Diaphragm openings immediately adjacent to exterior masonry shear walls are not greater than 8 ft (2.4 m) long. (Tier 2: Sec. 5.6.1.3; Commentary: Sec. A.4.1.6)			X		

Flexible Diaphragms

EVALUATION ITEM	EVALUATION STATEMENT	С	NC	N/A	U	COMMENT
Cross Ties	There are continuous cross ties between diaphragm chords. (Tier 2: Sec. 5.6.1.2; Commentary: Sec. A.4.1.2)		X			There are no continuous cross ties between diaphragm chords. The addition of new cross ties between diaphragm chords or the addition of strap plates to connect existing framing members together may be appropriate.
Openings at Shear Walls	Diaphragm openings immediately adjacent to the shear walls are less than 25% of the wall length. (Tier 2: Sec. 5.6.1.3; Commentary: Sec. A.4.1.4)			X		
Openings at Exterior Masonry Shear Walls	Diaphragm openings immediately adjacent to exterior masonry shear walls are not greater than 8 ft (2.4 m) long. (Tier 2: Sec. 5.6.1.3; Commentary: Sec. A.4.1.6)			X		
Straight Sheathing	All straight-sheathed diaphragms have aspect ratios less than 2-to-1 in the direction being considered. (Tier 2: Sec. 5.6.2; Commentary: Sec. A.4.2.1)			X		
Spans	All wood diaphragms with spans greater than 24 ft (7.3 m) consist of wood structural panels or diagonal sheathing. (Tier 2: Sec. 5.6.2; Commentary: Sec. A.4.2.2)	X				
Diagonally Sheathed and Unblocked Diaphragms	All diagonally sheathed or unblocked wood structural panel diaphragms have horizontal spans less than 40 ft (12.2 m) and aspect ratios less than or equal to 4 to-1. (Tier 2: Sec. 5.6.2; Commentary: Sec. A.4.2.3)		X			Diaphragm is unblocked with spans greater than 40 feet in locations. Diaphragm strengthening through the addition of blocking and additional diaphragm nailing may be appropriate to mitigate seismic risk.
Other Diaphragms	Diaphragms do not consist of a system other than wood, metal deck, concrete, or horizontal bracing. (Tier 2: Sec. 5.6.5; Commentary: Sec. A.4.7.1)	X				

Connections

EVALUATION ITEM	EVALUATION STATEMENT	С	NC	N/A	U	COMMENT
Stiffness of Wall Anchors	Anchors of concrete or masonry walls to wood structural elements are installed taut and are stiff enough to limit the relative movement between the wall and the diaphragm to no greater than 1/8 in. (3 mm) before engagement of the anchors. (Tier 2: Sec. 5.7.1.2; Commentary: Sec. A.5.1.4)				X	This evaluation item is unknown and could not be visually verified. This item requires further investigation to make a final determination on its compliance and to develop a mitigation recommendation, if necessary.

White Salmon Valley, Wayne M. Henkle Middle School, Middle School 17-38 Nonstructural Checklist

Notes:

C = Compliant, NC = Noncompliant, N/A = Not Applicable, and U = Unknown.

Performance Level: HR = Hazards Reduced, LS = Life Safety, and PR = Position Retention.

Level of Seismicity: L = Low, M = Moderate, and H = High

Life Safety Systems

EVALUATION ITEM	EVALUATION STATEMENT	С	NC	N/A	U	COMMENT
LSS-1 Fire Suppression Piping. HR-not required; LS-LMH; PR-LMH.	Fire suppression piping is anchored and braced in accordance with NFPA-13. (Tier 2: Sec. 13.7.4; Commentary: Sec. A.7.13.1)			X		
LSS-2 Flexible Couplings. HR-not required; LS-LMH; PR- LMH.	Fire suppression piping has flexible couplings in accordance with NFPA-13. (Tier 2: Sec. 13.7.4; Commentary: Sec. A.7.13.2)			X		
LSS-3 Emergency Power. HR-not required; LS-LMH; PR-LMH.	Equipment used to power or control Life Safety systems is anchored or braced. (Tier 2: Sec. 13.7.7; Commentary: Sec. A.7.12.1)			X		
LSS-4 Stair and Smoke Ducts. HR-not required; LS-LMH; PR-LMH.	Stair pressurization and smoke control ducts are braced and have flexible connections at seismic joints. (Tier 2: Sec. 13.7.6; Commentary: Sec. A.7.14.1)			X		
LSS-5 Sprinkler Ceiling Clearance. HR-not required; LS-MH; PR- MH.	Penetrations through panelized ceilings for fire suppression devices provide clearances in accordance with NFPA-13. (Tier 2: Sec. 13.7.4; Commentary: Sec. A.7.13.3)			X		
LSS-6 Emergency Lighting. HR-not required; LS-not required; PR-LMH	Emergency and egress lighting equipment is anchored or braced. (Tier 2: Sec. 13.7.9; Commentary: Sec. A.7.3.1)			X		Non-applicable due to ASCE 41 Performance Level: "Life Safety (LS)"

Hazardous Materials

EVALUATION ITEM	EVALUATION STATEMENT	С	NC	N/A	U	COMMENT
1 1	Equipment mounted on vibration isolators and containing hazardous material is equipped with restraints or snubbers. (Tier 2: Sec. 13.7.1; Commentary: Sec. A.7.12.2)			X		
HM-2 Hazardous Material Storage. HR- LMH; LS-LMH; PR- LMH.	Breakable containers that hold hazardous material, including gas cylinders, are restrained by latched doors, shelf lips, wires, or other methods. (Tier 2: Sec. 13.8.3; Commentary: Sec. A.7.15.1)			X		
HM-3 Hazardous Material Distribution. HR-MH; LS-MH; PR- MH.	Piping or ductwork conveying hazardous materials is braced or otherwise protected from damage that would allow hazardous material release. (Tier 2: Sec. 13.7.3, 13.7.5; Commentary: Sec. A.7.13.4)			X		

HM-4 Shutoff Valves. HR-MH; LS-MH; PR- MH.	Piping containing hazardous material, including natural gas, has shutoff valves or other devices to limit spills or leaks. (Tier 2: Sec. 13.7.3, 13.7.5; Commentary: Sec. A.7.13.3)		X		
HM-5 Flexible Couplings. HR-LMH; LS-LMH; PR-LMH.	Hazardous material ductwork and piping, including natural gas piping, have flexible couplings. (Tier 2: Sec. 13.7.3, 13.7.5; Commentary: Sec. A.7.15.4)		X		
HM-6 Piping or Ducts Crossing Seismic Joints. HR-MH; LS-MH; PR- MH.	Piping or ductwork carrying hazardous material that either crosses seismic joints or isolation planes or is connected to independent structures has couplings or other details to accommodate the relative seismic displacements. (Tier 2: Sec. 13.7.3, 13.7.5, 13.7.6; Commentary: Sec. A.7.13.6)		X		

Partitions

rartitions						
EVALUATION ITEM	EVALUATION STATEMENT	С	NC	N/A	U	COMMENT
P-1 Unreinforced Masonry. HR-LMH; LS- LMH; PR-LMH.	Unreinforced masonry or hollow-clay tile partitions are braced at a spacing of at most 10 ft (3.0 m) in Low or Moderate Seismicity, or at most 6 ft (1.8 m) in High Seismicity. (Tier 2: Sec. 13.6.2; Commentary: Sec. A.7.1.1)		X			Inadequate bracing for URM partitions. Unreinforced masonry partition walls should be braced or demolished.
P-2 Heavy Partitions Supported by Ceilings. HR-LMH; LS-LMH; PR- LMH.	The tops of masonry or hollow-clay tile partitions are not laterally supported by an integrated ceiling system. (Tier 2: Sec. 13.6.2; Commentary: Sec. A.7.2.1)	X				
P-3 Drift. HR-not required; LS-MH; PR- MH.	Rigid cementitious partitions are detailed to accommodate the following drift ratios: in steel moment frame, concrete moment frame, and wood frame buildings, 0.02; in other buildings, 0.005. (Tier 2: Sec. 13.6.2; Commentary: Sec. A.7.1.2)				X	Further investigation is required to verify detailing of rigid cementitious partitions for drift.
P-4 Light Partitions Supported by Ceilings. HR-not required; LS-not required; PR-MH.	The tops of gypsum board partitions are not laterally supported by an integrated ceiling system. (Tier 2: Sec. 13.6.2; Commentary: Sec. A.7.2.1)			X		Non-applicable due to ASCE 41 Performance Level: "Life Safety (LS)"
P-5 Structural Separations. HR-not required; LS-not required; PR-MH.	Partitions that cross structural separations have seismic or control joints. (Tier 2: Sec. 13.6.2; Commentary: Sec. A.7.1.3)			X		Non-applicable due to ASCE 41 Performance Level: "Life Safety (LS)"
P-6 Tops. HR-not required; LS-not required; PR-MH.	The tops of ceiling-high framed or panelized partitions have lateral bracing to the structure at a spacing equal to or less than 6 ft (1.8 m). (Tier 2: Sec. 13.6.2; Commentary: Sec. A.7.1.4)			X		Non-applicable due to ASCE 41 Performance Level: "Life Safety (LS)"

Ceilings

EVALUATION ITEM	EVALUATION STATEMENT	С	NC	N/A	U	COMMENT
C-1 Suspended Lath and Plaster. HR-H; LS-MH; PR-LMH.	Suspended lath and plaster ceilings have attachments that resist seismic forces for every 12 ft2 (1.1 m2) of area. (Tier 2: Sec. 13.6.4; Commentary: Sec. A.7.2.3)			X		
C-2 Suspended Gypsum Board. HR-not required; LS-MH; PR-LMH.	Suspended gypsum board ceilings have attachments that resist seismic forces for every 12 ft2 (1.1 m2) of area. (Tier 2: Sec. 13.6.4; Commentary: Sec. A.7.2.3)				X	Further investigation is required to review suspended ceiling attachments.
C-3 Integrated Ceilings. HR-not required; LS-not required; PR-MH.	Integrated suspended ceilings with continuous areas greater than 144 ft2 (13.4 m2) and ceilings of smaller areas that are not surrounded by restraining partitions are laterally restrained at a spacing no greater than 12 ft (3.6 m) with members attached to the structure above. Each restraint location has a minimum of four diagonal wires and compression struts, or diagonal members capable of resisting compression. (Tier 2: Sec. 13.6.4; Commentary: Sec. A.7.2.2)			X		Non-applicable due to ASCE 41 Performance Level: "Life Safety (LS)"
C-4 Edge Clearance. HR- not required; LS-not required; PR-MH.	The free edges of integrated suspended ceilings with continuous areas greater than 144 ft2 (13.4 m2) have clearances from the enclosing wall or partition of at least the following: in Moderate Seismicity, 1/2 in. (13 mm); in High Seismicity, 3/4 in. (19 mm). (Tier 2: Sec. 13.6.4; Commentary: Sec. A.7.2.4)			X		Non-applicable due to ASCE 41 Performance Level: "Life Safety (LS)"
C-5 Continuity Across Structure Joints. HR-not required; LS-not required; PR-MH.	The ceiling system does not cross any seismic joint and is not attached to multiple independent structures. (Tier 2: Sec. 13.6.4; Commentary: Sec. A.7.2.5)			X		Non-applicable due to ASCE 41 Performance Level: "Life Safety (LS)"
C-6 Edge Support. HR- not required; LS-not required; PR-H.	The free edges of integrated suspended ceilings with continuous areas greater than 144 ft2 (13.4 m2) are supported by closure angles or channels not less than 2 in. (51 mm) wide. (Tier 2: Sec. 13.6.4; Commentary: Sec. A.7.2.6)			X		Non-applicable due to ASCE 41 Performance Level: "Life Safety (LS)"
C-7 Seismic Joints. HR- not required; LS-not required; PR-H.	Acoustical tile or lay-in panel ceilings have seismic separation joints such that each continuous portion of the ceiling is no more than 2,500 ft2 (232.3 m2) and has a ratio of long-to-short dimension no more than 4-to-1. (Tier 2: Sec. 13.6.4; Commentary: Sec. A.7.2.7)			X		Non-applicable due to ASCE 41 Performance Level: "Life Safety (LS)"

Light Fixtures

EVALUATION ITEM	EVALUATION STATEMENT	С	NC	NI/A	II	COMMENT
LF-1 Independent Support. HR-not required; LS-MH; PR-MH.	EVALUATION STATEMENT Light fixtures that weigh more per square foot than the ceiling they penetrate are supported independent of the grid ceiling suspension system by a minimum of two wires at diagonally opposite corners of each fixture. (Tier 2: Sec. 13.6.4, 13.7.9; Commentary: Sec.	С	NC	N/A	U X	COMMENT Further investigation is required to review the support system for light fixtures. All light fixtures in grid ceiling system should have seismic
	A.7.3.2)					bracing.
LF-2 Pendant Supports. HR-not required; LS-not required; PR-H.	Light fixtures on pendant supports are attached at a spacing equal to or less than 6 ft. Unbraced suspended fixtures are free to allow a 360-degree range of motion at an angle not less than 45 degrees from horizontal without contacting adjacent components. Alternatively, if rigidly supported and/or braced, they are free to move with the structure to which they are attached without damaging adjoining components. Additionally, the connection to the structure is capable of accommodating the movement without failure. (Tier 2: Sec. 13.7.9; Commentary: Sec. A.7.3.3)			Х		Non-applicable due to ASCE 41 Performance Level: "Life Safety (LS)"
LF-3 Lens Covers. HR-	Lens covers on light fixtures are attached with					Non-applicable due to
not required; LS-not	safety devices. (Tier 2: Sec. 13.7.9;			X		ASCE 41 Performance
required; PR-H.	Commentary: Sec. A.7.3.4)					Level: "Life Safety (LS)"

Cladding and Glazing

EVALUATION ITEM	EVALUATION STATEMENT	С	NC	N/A	U	COMMENT
CG-1 Cladding Anchors. HR-MH; LS-MH; PR- MH.	Cladding components weighing more than 10 lb/ft2 (0.48 kN/m2) are mechanically anchored to the structure at a spacing equal to or less than the following: for Life Safety in Moderate Seismicity, 6 ft (1.8 m); for Life Safety in High Seismicity and for Position Retention in any seismicity, 4 ft (1.2 m) (Tier 2: Sec. 13.6.1; Commentary: Sec. A.7.4.1)			X		
CG-2 Cladding Isolation. HR-not required; LS- MH; PR-MH.	For steel or concrete moment-frame buildings, panel connections are detailed to accommodate a story drift ratio by the use of rods attached to framing with oversize holes or slotted holes of at least the following: for Life Safety in Moderate Seismicity, 0.01; for Life Safety in High Seismicity and for Position Retention in any seismicity, 0.02, and the rods have a length-to-diameter ratio of 4.0 or less. (Tier 2: Sec. 13.6.1; Commentary: Sec. A.7.4.3)			X		

CG-3 Multi-Story Panels. HR-MH; LS-MH; PR- MH.	For multi-story panels attached at more than one floor level, panel connections are detailed to accommodate a story drift ratio by the use of rods attached to framing with oversize holes or slotted holes of at least the following: for Life Safety in Moderate Seismicity, 0.01; for Life Safety in High Seismicity and for Position Retention in any seismicity, 0.02, and the rods have a length-to-diameter ratio of 4.0 or less. (Tier 2: Sec. 13.6.1; Commentary: Sec. A.7.4.4)		X		
CG-4 Threaded Rods. HR-not required; LS- MH; PR-MH.	Threaded rods for panel connections detailed to accommodate drift by bending of the rod have a length-to-diameter ratio greater than 0.06 times the story height in inches for Life Safety in Moderate Seismicity and 0.12 times the story height in inches for Life Safety in High Seismicity and Position Retention in any seismicity. (Tier 2: Sec. 13.6.1; Commentary: Sec. A.7.4.9)		X		
CG-5 Panel Connections. HR-MH; LS-MH; PR- MH.	Cladding panels are anchored out of plane with a minimum number of connections for each wall panel, as follows: for Life Safety in Moderate Seismicity, 2 connections; for Life Safety in High Seismicity and for Position Retention in any seismicity, 4 connections. (Tier 2: Sec. 13.6.1.4; Commentary: Sec. A.7.4.5)		X		
CG-6 Bearing Connections. HR-MH; LS-MH; PR-MH.	Where bearing connections are used, there is a minimum of two bearing connections for each cladding panel. (Tier 2: Sec. 13.6.1.4; Commentary: Sec. A.7.4.6)		X		
CG-7 Inserts. HR-MH; LS-MH; PR-MH.	Where concrete cladding components use inserts, the inserts have positive anchorage or are anchored to reinforcing steel. (Tier 2: Sec. 13.6.1.4; Commentary: Sec. A.7.4.7)		X		
CG-8 Overhead Glazing. HR-not required; LS- MH; PR-MH.	Glazing panes of any size in curtain walls and individual interior or exterior panes more than 16 ft2 (1.5 m2) in area are laminated annealed or laminated heat-strengthened glass and are detailed to remain in the frame when cracked. (Tier 2: Sec. 13.6.1.5; Commentary: Sec. A.7.4.8)			X	Further investigation is required to verify detailing of glazing panes.

Masonry Veneer

EVALUATION ITEM	EVALUATION STATEMENT	С	NC	N/A	U	COMMENT
M-1 Ties. HR-not required; LS-LMH; PR- LMH.	Masonry veneer is connected to the backup with corrosion-resistant ties. There is a minimum of one tie for every 2-2/3 ft2 (0.25 m2), and the ties have spacing no greater than the following: for Life Safety in Low or Moderate Seismicity, 36 in. (914 mm); for Life Safety in High Seismicity and for Position Retention in any seismicity, 24 in. (610 mm). (Tier 2: Sec. 13.6.1.2; Commentary: Sec. A.7.5.1)				X	Further investigation is required to verify detailing of masonry veneer ties.
M-2 Shelf Angles. HR- not required; LS-LMH; PR-LMH.	Masonry veneer is supported by shelf angles or other elements at each floor above the ground floor. (Tier 2: Sec. 13.6.1.2; Commentary: Sec. A.7.5.2)			X		One story
M-3 Weakened Planes. HR-not required; LS- LMH; PR-LMH.	Masonry veneer is anchored to the backup adjacent to weakened planes, such as at the locations of flashing. (Tier 2: Sec. 13.6.1.2; Commentary: Sec. A.7.5.3)				X	Further investigation is required to verify anchorage of masonry veneer at weakened planes.
M-4 Unreinforced Masonry Backup. HR- LMH; LS-LMH; PR- LMH.	There is no unreinforced masonry backup. (Tier 2: Sec. 13.6.1.1, 13.6.1.2; Commentary: Sec. A.7.7.2)	X				
M-5 Stud Tracks. HR-not required; LS-MH; PR- MH.	For veneer with coldformed steel stud backup, stud tracks are fastened to the structure at a spacing equal to or less than 24 in. (610 mm) on center. (Tier 2: Sec. 13.6.1.1, 13.6.1.2; Commentary: Sec. A.7.6.)			X		
M-6 Anchorage. HR-not required; LS-MH; PR- MH.	For veneer with concrete block or masonry backup, the backup is positively anchored to the structure at a horizontal spacing equal to or less than 4 ft along the floors and roof. (Tier 2: Sec. 13.6.1.1, 13.6.1.2; Commentary: Sec. A.7.7.1)	X				16 inches on center each way
M-7 Weep Holes. HR-not required; LS-not required; PR-MH.	In veneer anchored to stud walls, the veneer has functioning weep holes and base flashing. (Tier 2: Sec. 13.6.1.2; Commentary: Sec. A.7.5.6)			X		Non-applicable due to ASCE 41 Performance Level: "Life Safety (LS)"
M-8 Openings. HR-not required; LS-not required; PR-MH.	For veneer with cold-formed-steel stud backup, steel studs frame window and door openings. (Tier 2: Sec. 13.6.1.1, 13.6.1.2; Commentary: Sec. A.7.6.2)			X		Non-applicable due to ASCE 41 Performance Level: "Life Safety (LS)"

Parapets, Cornices, Ornamentation, and Appendages

EVALUATION ITEM	EVALUATION STATEMENT	С	NC	N/A	U	COMMENT
*	Laterally unsupported unreinforced masonry parapets or cornices have height-tothickness ratios no greater than the following: for Life Safety in Low or Moderate Seismicity, 2.5; for Life Safety in High Seismicity and for Position Retention in any seismicity, 1.5. (Tier 2: Sec. 13.6.5; Commentary: Sec. A.7.8.1)			X		

PCOA-2 Canopies. HR-not required; LS-LMH; PR-LMH.	Canopies at building exits are anchored to the structure at a spacing no greater than the following: for Life Safety in Low or Moderate Seismicity, 10 ft (3.0 m); for Life Safety in High Seismicity and for Position Retention in any seismicity, 6 ft (1.8 m). (Tier 2: Sec. 13.6.6; Commentary: Sec. A.7.8.2)		X		
PCOA-3 Concrete Parapets. HR-H; LS-MH; PR-LMH.	Concrete parapets with height-to-thickness ratios greater than 2.5 have vertical reinforcement. (Tier 2: Sec. 13.6.5; Commentary: Sec. A.7.8.3)		X		
PCOA-4 Appendages. HR-MH; LS-MH; PR- LMH.	Cornices, parapets, signs, and other ornamentation or appendages that extend above the highest point of anchorage to the structure or cantilever from components are reinforced and anchored to the structural system at a spacing equal to or less than 6 ft (1.8 m). This evaluation statement item does not apply to parapets or cornices covered by other evaluation statements. (Tier 2: Sec. 13.6.6; Commentary: Sec. A.7.8.4)		X		

Masonry Chimneys

EVALUATION ITEM	EVALUATION STATEMENT	С	NC	N/A	U	COMMENT
MC-1 URM Chimneys. HR-LMH; LS-LMH; PR- LMH.	Unreinforced masonry chimneys extend above the roof surface no more than the following: for Life Safety in Low or Moderate Seismicity, 3 times the least dimension of the chimney; for Life Safety in High Seismicity and for Position Retention in any seismicity, 2 times the least dimension of the chimney. (Tier 2: Sec. 13.6.7; Commentary: Sec. A.7.9.1)			X		
MC-2 Anchorage. HR- LMH; LS-LMH; PR- LMH.	Masonry chimneys are anchored at each floor level, at the topmost ceiling level, and at the roof. (Tier 2: Sec. 13.6.7; Commentary: Sec. A.7.9.2)			X		

Stairs

EVALUATION ITEM	EVALUATION STATEMENT	С	NC	N/A	U	COMMENT
S-1 Stair Enclosures. HR-not required; LS-LMH; PR-LMH.	Hollow-clay tile or unreinforced masonry walls around stair enclosures are restrained out of plane and have height-to-thickness ratios not greater than the following: for Life Safety in Low or Moderate Seismicity, 15-to-1; for Life Safety in High Seismicity and for Position Retention in any seismicity, 12-to-1. (Tier 2: Sec. 13.6.2, 13.6.8; Commentary: Sec.	C	NC	X	U	COMMENT
	A.7.10.1)					

	The connection between the stairs and the						
	structure does not rely on post-installed anchors						
	in concrete or masonry, and the stair details are						
	capable of accommodating the drift calculated						
S-2 Stair Details. HR-not required; LS-LMH; PR-	using the Quick Check procedure of Section		X				
LMH.	4.4.3.1 for moment-frame structures or 0.5 in.		Λ				
LIVITI.	for all other structures without including any						
	lateral stiffness contribution from the stairs.						
	(Tier 2: Sec. 13.6.8; Commentary: Sec.						
	A.7.10.2)						

Contents and Furnishings

EVALUATION ITEM	EVALUATION STATEMENT	С	NC	N/A	U	COMMENT
CF-1 Industrial Storage Racks. HR-LMH; LS- MH; PR-MH.	Industrial storage racks or pallet racks more than 12 ft high meet the requirements of ANSI/RMI MH 16.1 as modified by ASCE 7, Chapter 15. (Tier 2: Sec. 13.8.1; Commentary: Sec. A.7.11.1)			X		
CF-2 Tall Narrow Contents. HR-not required; LS-H; PR-MH.	Contents more than 6 ft (1.8 m) high with a height-to-depth or height-to-width ratio greater than 3-to-1 are anchored to the structure or to each other. (Tier 2: Sec. 13.8.2; Commentary: Sec. A.7.11.2)		X			Anchorage is required at tall narrow contents more than six feet high to provide overturning restraint.
CF-3 Fall-Prone Contents. HR-not required; LS-H; PR-H.	Equipment, stored items, or other contents weighing more than 20 lb (9.1 kg) whose center of mass is more than 4 ft (1.2 m) above the adjacent floor level are braced or otherwise restrained. (Tier 2: Sec. 13.8.2; Commentary: Sec. A.7.11.3)		X			Anchorage is required for fall-prone contents weighing more than 20 pounds.
CF-4 Access Floors. HR- not required; LS-not required; PR-MH.	Access floors more than 9 in. (229 mm) high are braced. (Tier 2: Sec. 13.6.10; Commentary: Sec. A.7.11.4)			X		Non-applicable due to ASCE 41 Performance Level: "Life Safety (LS)"
CF-5 Equipment on Access Floors. HR-not required; LS-not required; PR-MH.	Equipment and other contents supported by access floor systems are anchored or braced to the structure independent of the access floor. (Tier 2: Sec. 13.7.7 13.6.10; Commentary: Sec. A.7.11.5)			X		Non-applicable due to ASCE 41 Performance Level: "Life Safety (LS)"
CF-6 Suspended Contents. HR-not required; LS-not required; PR-H.	Items suspended without lateral bracing are free to swing from or move with the structure from which they are suspended without damaging themselves or adjoining components. (Tier 2: Sec. 13.8.2; Commentary: Sec. A.7.11.6)			X		Non-applicable due to ASCE 41 Performance Level: "Life Safety (LS)"

Mechanical and Electrical Equipment

EVALUATION ITEM	EVALUATION STATEMENT	С	NC	N/A	U	COMMENT
	Equipment weighing more than 20 lb (9.1 kg)					
ME-1 Fall-Prone	whose center of mass is more than 4 ft (1.2 m)					
Equipment. HR-not	above the adjacent floor level, and which is not			X		
required; LS-H; PR-H.	in-line equipment, is braced. (Tier 2: Sec. 13.7.1					
	13.7.7; Commentary: Sec. A.7.12.4)					

ME-2 In-Line Equipment. HR-not required; LS-H; PR-H.	Equipment installed in line with a duct or piping system, with an operating weight more than 75 lb (34.0 kg), is supported and laterally braced independent of the duct or piping system. (Tier 2: Sec. 13.7.1; Commentary: Sec. A.7.12.5)			X	This evaluation item could not be visually verified. Further investigation is required to review vertical support and lateral bracing of equipment.
ME-3 Tall Narrow Equipment. HR-not required; LS-H; PR-MH.	Equipment more than 6 ft (1.8 m) high with a height-to-depth or height-to-width ratio greater than 3-to-1 is anchored to the floor slab or adjacent structural walls. (Tier 2: Sec. 13.7.1 13.7.7; Commentary: Sec. A.7.12.6)	X			Anchorage is required for tall narrow equipment more than six feet high to provide overturning restraint.
ME-4 Mechanical Doors. HR-not required; LS-not required; PR-MH.	Mechanically operated doors are detailed to operate at a story drift ratio of 0.01. (Tier 2: Sec. 13.6.9; Commentary: Sec. A.7.12.7)		X		Non-applicable due to ASCE 41 Performance Level: "Life Safety (LS)"
ME-5 Suspended Equipment. HR-not required; LS-not required; PR-H.	Equipment suspended without lateral bracing is free to swing from or move with the structure from which it is suspended without damaging itself or adjoining components. (Tier 2: Sec. 13.7.1, 13.7.7; Commentary: Sec. A.7.12.8)		X		Non-applicable due to ASCE 41 Performance Level: "Life Safety (LS)"
ME-6 Vibration Isolators. HR-not required; LS-not required; PR-H.	Equipment mounted on vibration isolators is equipped with horizontal restraints or snubbers and with vertical restraints to resist overturning. (Tier 2: Sec. 13.7.1; Commentary: Sec. A.7.12.9)		X		Non-applicable due to ASCE 41 Performance Level: "Life Safety (LS)"
ME-7 Heavy Equipment. HR-not required; LS-not required; PR-H.	Floor supported or platform-supported equipment weighing more than 400 lb (181.4 kg) is anchored to the structure. (Tier 2: Sec. 13.7.1, 13.7.7; Commentary: Sec. A.7.12.10)		X		Non-applicable due to ASCE 41 Performance Level: "Life Safety (LS)"
ME-8 Electrical Equipment. HR-not required; LS-not required; PR-H.	Electrical equipment is laterally braced to the structure. (Tier 2: Sec. 13.7.7; Commentary: Sec. A.7.12.11)		X		Non-applicable due to ASCE 41 Performance Level: "Life Safety (LS)"
ME-9 Conduit Couplings. HR-not required; LS-not required; PR-H.	Conduit greater than 2.5 in. (64 mm) trade size that is attached to panels, cabinets, or other equipment and is subject to relative seismic displacement has flexible couplings or connections. (Tier 2: Sec. 13.7.8; Commentary: Sec. A.7.12.12)		X		Non-applicable due to ASCE 41 Performance Level: "Life Safety (LS)"

Piping

EVALUATION ITEM	EVALUATION STATEMENT	С	NC	N/A	U	COMMENT
	Fluid and gas piping has flexible couplings. (Tier 2: Sec. 13.7.3, 13.7.5; Commentary: Sec. A.7.13.2)			X		Non-applicable due to ASCE 41 Performance Level: "Life Safety (LS)"
PP-2 Fluid and Gas Piping. HR-not required; LS-not required; PR-H.	Fluid and gas piping is anchored and braced to the structure to limit spills or leaks. (Tier 2: Sec. 13.7.3, 13.7.5; Commentary: Sec. A.7.13.4)			X		Non-applicable due to ASCE 41 Performance Level: "Life Safety (LS)"

PP-3 C-Clamps. HR-not required; LS-not required; PR-H.	One-sided C-clamps that support piping larger than 2.5 in. (64 mm) in diameter are restrained. (Tier 2: Sec. 13.7.3, 13.7.5; Commentary: Sec. A.7.13.5)		X	Non-applicable due to ASCE 41 Performance Level: "Life Safety (LS)"
PP-4 Piping Crossing Seismic Joints. HR-not required; LS-not required; PR-H.	Piping that crosses seismic joints or isolation planes or is connected to independent structures has couplings or other details to accommodate the relative seismic displacements. (Tier 2: Sec. 13.7.3, 13.7.5; Commentary: Sec. A.7.13.6)		X	Non-applicable due to ASCE 41 Performance Level: "Life Safety (LS)"

Ducts

EVALUATION ITEM	EVALUATION STATEMENT	С	NC	N/A	U	COMMENT
D-1 Duct Bracing. HR- not required; LS-not required; PR-H.	Rectangular ductwork larger than 6 ft2 (0.56 m2) in cross-sectional area and round ducts larger than 28 in. (711 mm) in diameter are braced. The maximum spacing of transverse bracing does not exceed 30 ft (9.2 m). The maximum spacing of longitudinal bracing does not exceed 60 ft (18.3 m). (Tier 2: Sec. 13.7.6; Commentary: Sec. A.7.14.2)			X		Non-applicable due to ASCE 41 Performance Level: "Life Safety (LS)"
D-2 Duct Support. HR- not required; LS-not required; PR-H.	Ducts are not supported by piping or electrical conduit. (Tier 2: Sec. 13.7.6; Commentary: Sec. A.7.14.3)			X		Non-applicable due to ASCE 41 Performance Level: "Life Safety (LS)"
D-3 Ducts Crossing Seismic Joints. HR-not required; LS-not required; PR-H.	Ducts that cross seismic joints or isolation planes or are connected to independent structures have couplings or other details to accommodate the relative seismic displacements. (Tier 2: Sec. 13.7.6; Commentary: Sec. A.7.14.4)			Х		Non-applicable due to ASCE 41 Performance Level: "Life Safety (LS)"


Elevators

EVALUATION ITEM	EVALUATION STATEMENT	С	NC	N/A	U	COMMENT
EL-1 Retainer Guards. HR-not required; LS-H; PR-H.	Sheaves and drums have cable retainer guards. (Tier 2: Sec. 13.7.11; Commentary: Sec. A.7.16.1)			X		No elevator
EL-2 Retainer Plate. HR- not required; LS-H; PR- H.	A retainer plate is present at the top and bottom of both car and counterweight. (Tier 2: Sec. 13.7.11; Commentary: Sec. A.7.16.2)			X		No elevator"
EL-3 Elevator Equipment. HR-not required; LS-not required; PR-H.	Equipment, piping, and other components that are part of the elevator system are anchored. (Tier 2: Sec. 13.7.11; Commentary: Sec. A.7.16.3)			X		No elevator
EL-4 Seismic Switch. HR-not required; LS-not required; PR-H.	Elevators capable of operating at speeds of 150 ft/min or faster are equipped with seismic switches that meet the requirements of ASME A17.1 or have trigger levels set to 20% of the acceleration of gravity at the base of the structure and 50% of the acceleration of gravity in other locations. (Tier 2: Sec. 13.7.11; Commentary: Sec. A.7.16.4)			X		No elevator"

EL-5 Shaft Walls. HR- not required; LS-not required; PR-H.	Elevator shaft walls are anchored and reinforced to prevent toppling into the shaft during strong shaking. (Tier 2: Sec. 13.7.11; Commentary: Sec. A.7.16.5)	X	No elevator
EL-6 Counterweight Rails. HR-not required; LS-not required; PR-H.	All counterweight rails and divider beams are sized in accordance with ASME A17.1. (Tier 2: Sec. 13.7.11; Commentary: Sec. A.7.16.6)	X	No elevator
EL-7 Brackets. HR-not required; LS-not required; PR-H.	The brackets that tie the car rails and the counterweight rail to the structure are sized in accordance with ASME A17.1. (Tier 2: Sec. 13.7.11; Commentary: Sec. A.7.16.7)	X	No elevator
EL-8 Spreader Bracket. HR-not required; LS-not required; PR-H.	Spreader brackets are not used to resist seismic forces. (Tier 2: Sec. 13.7.11; Commentary: Sec. A.7.16.8)	X	No elevator
EL-9 Go-Slow Elevators. HR-not required; LS-not required; PR-H.	The building has a go-slow elevator system. (Tier 2: Sec. 13.7.11; Commentary: Sec. A.7.16.9)	X	No elevator



This page intentionally left blank.

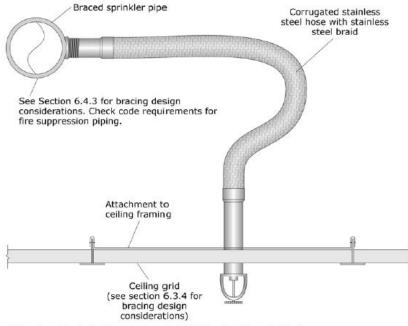

Note: for seismic design category D, E & F, the flexible sprinkler hose fitting must accommodate at least $1^{\prime\prime}$ of ceiling movement without use of an oversized opening. Alternatively, the sprinkler head must have a $2^{\prime\prime}$ oversize ring or adapter that allows $1^{\prime\prime}$ movement in all directions.

Figure G-1. Flexible Sprinkler Drop.

(FEMA E-74, 2012, Reducing the Risks of Nonstructural Earthquake Damage)

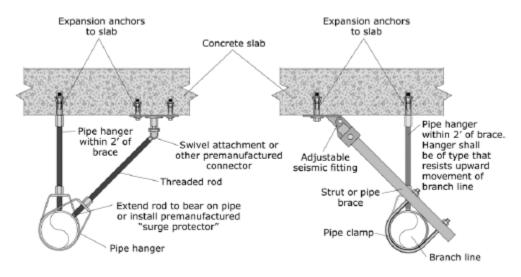


Figure G-2. End of Line Restraint.

(FEMA E-74, 2012, Reducing the Risks of Nonstructural Earthquake Damage)

Partitions

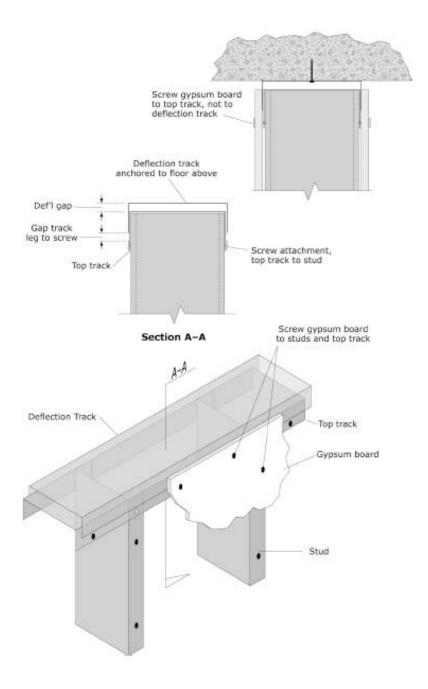


Figure G-3. Mitigation Schemes for Bracing the Tops of Metal Stud Partitions Walls. (FEMA E-74, 2012, Reducing the Risks of Nonstructural Earthquake Damage)


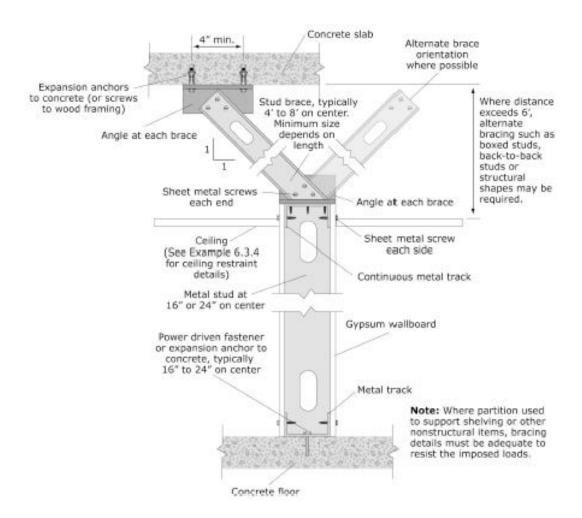


Figure G-4. Mitigation Schemes for Bracing the Tops of Metal Stud Partitions Walls. (FEMA E-74, 2012, Reducing the Risks of Nonstructural Earthquake Damage)

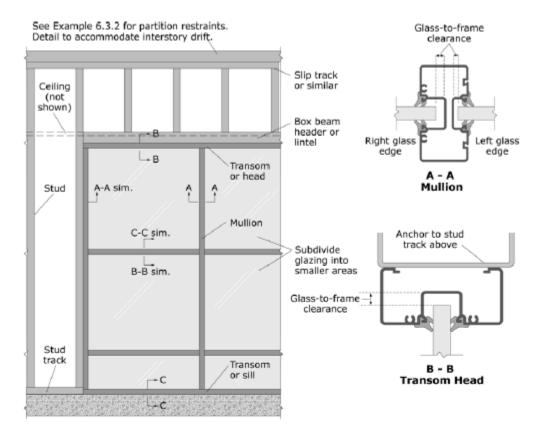

Notes: Glazed partition shown in full-height nonbearing stud wall. Nonstructural surround must be designed to provide in-plane and out-of-plane restraint for glazing assembly without delivering any loads to the glazing.

Glass-to-frame clearance requirements are dependent on anticipated structural drift. Where partition is isolated from structural drift, clearance requirements are reduced. Refer to building code for specific requirements.

Safety glass (laminated, tempered, etc.) will reduce the hazard in case of breakage during an earthquake. See Example 6.3.1.4 for related discussion.

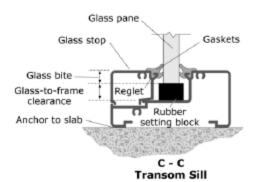


Figure G-5. Full-height Glazed Partition.

(FEMA E-74, 2012, Reducing the Risks of Nonstructural Earthquake Damage)

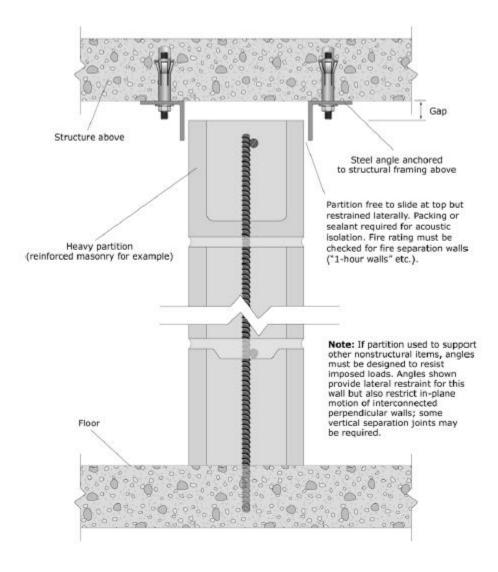


Figure G-6. Full-height Heavy Partition.
(FEMA E-74, 2012, Reducing the Risks of Nonstructural Earthquake Damage)

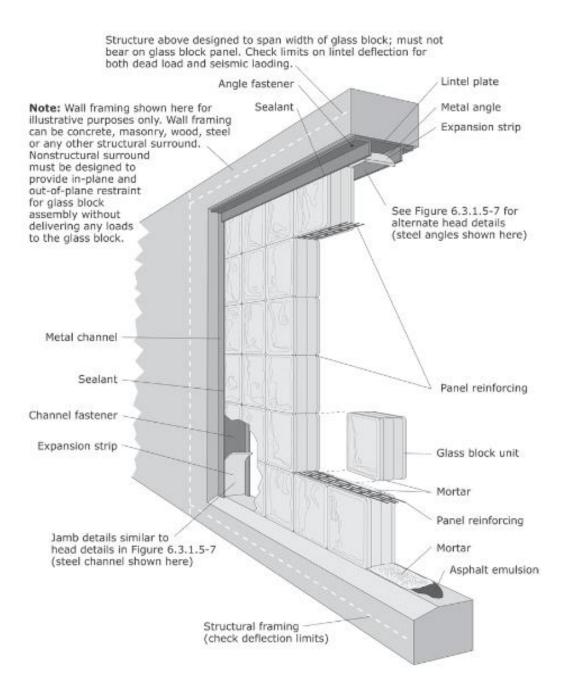


Figure G-7. Typical Glass Block Panel Details. (FEMA E-74, 2012, Reducing the Risks of Nonstructural Earthquake Damage)

Ceilings


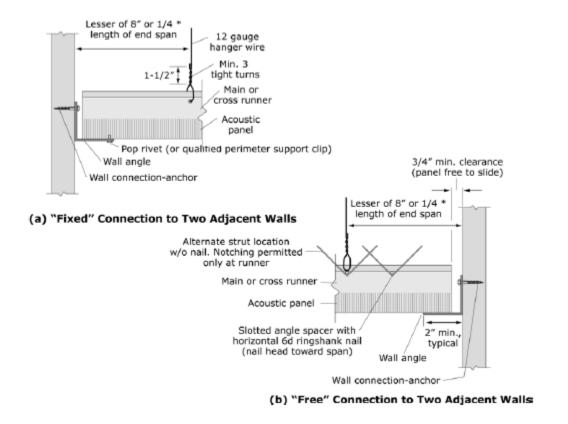



Figure G-8. Suspension System for Acoustic Lay-in Panel Ceilings – Edge Conditions. (FEMA E-74, 2012, Reducing the Risks of Nonstructural Earthquake Damage)

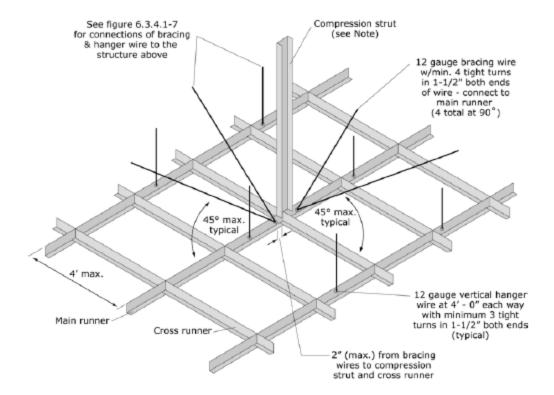

Note: Compression strut shall not replace hanger wire. Compression strut consists of a steel section attached to main runner with 2 - #12 sheet metal screws and to structure with 2 - #12 screws to wood or 1/4" min. expansion anchor to structure. Size of strut is dependent on distance between ceiling and structure (I/r ≤ 200). A 1" diameter conduit can be used for up to 6', a 1-5/8" X 1-1/4" metal stud can be used for up to 10'

Per DSA IR 25-5, ceiling areas less than 144 sq. ft, or fire rated ceilings less than 96 sq. ft., surrounded by walls braced to the structure above do not require lateral bracing assemblies when they are attached to two adjacent walls. (ASTM E580 does not require lateral bracing assemblies for ceilings less than 1000 sq. ft.; see text.)

Figure G-9. Suspension System for Acoustic Lay-in Panel Ceilings – General Bracing Assembly. (FEMA E-74, 2012, Reducing the Risks of Nonstructural Earthquake Damage)

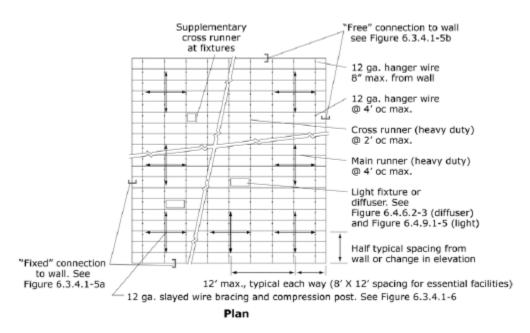


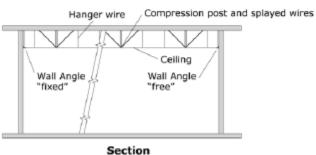



Figure G-10. Suspension System for Acoustic Lay-in Panel Ceilings – General Bracing Layout. (FEMA E-74, 2012, Reducing the Risks of Nonstructural Earthquake Damage)

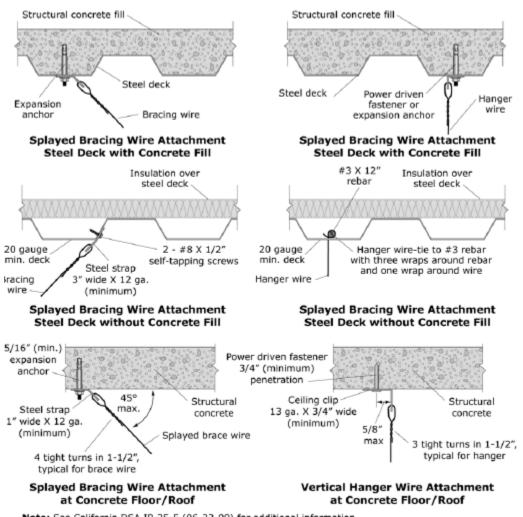


Note: See California DSA IR 25-5 (06-22-09) for additional information.

Figure G-11. Suspension System for Acoustic Lay-in Panel Ceilings – Overhead Attachment Details.

(FEMA E-74, 2012, Reducing the Risks of Nonstructural Earthquake Damage)

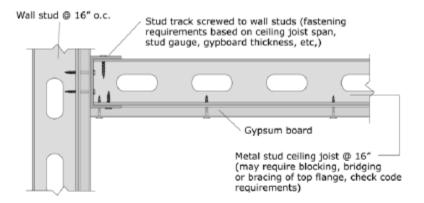

a) Gypsum board attached directly to ceiling joists

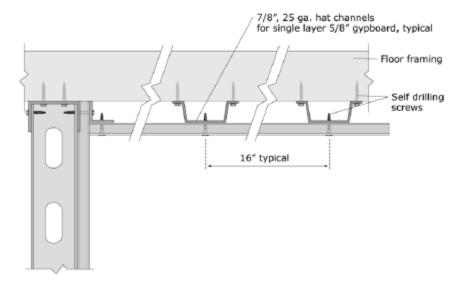

b) Gypsum board attached directly to furring strips (hat channel or similar)

Note: Commonly used details shown; no special seismic details are required as long as furring and gypboard secured. Check for certified assemblies (UL listed, FM approved, etc.) if fire or sound rating required.

Figure G-12. Gypsum Board Ceiling Applied Directly to Structure. (FEMA E-74, 2012, Reducing the Risks of Nonstructural Earthquake Damage)

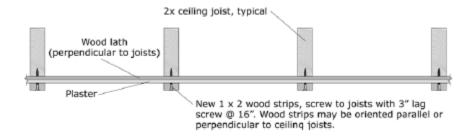


Figure G-13. Retrofit Detail for Existing Lath and Plaster. (FEMA E-74, 2012, Reducing the Risks of Nonstructural Earthquake Damage)



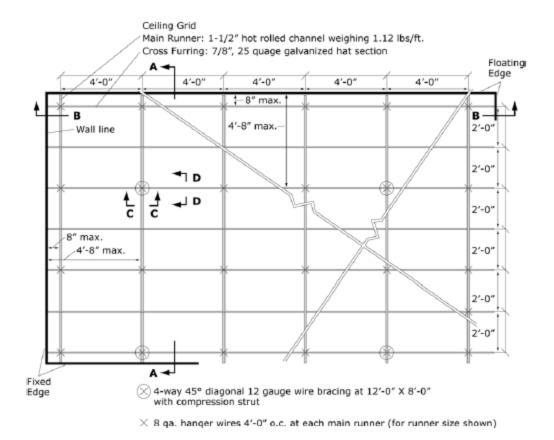


Figure G-14. Diagrammatic View of Suspended Heavy Ceiling Grid and Lateral Bracing. (FEMA E-74, 2012, Reducing the Risks of Nonstructural Earthquake Damage)

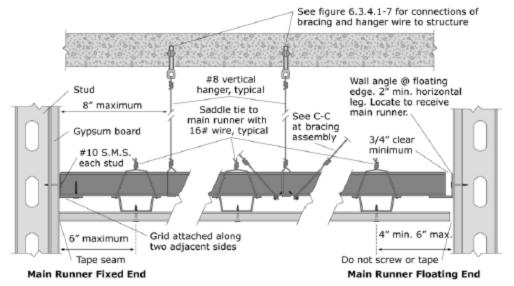


A-A Main Runner at Perimeter

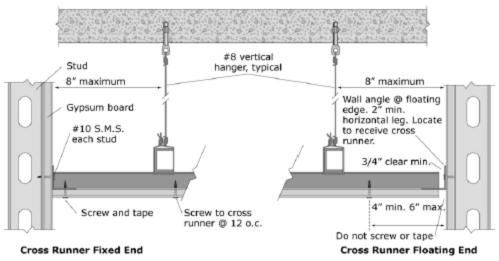

B-B Cross Runner at Perimeter

Figure G-15. Perimeter Details for Suspended Gypsum Board Ceiling. (FEMA E-74, 2012, Reducing the Risks of Nonstructural Earthquake Damage)

See figure 6.3.4.1-7 for connections of bracing and hanger wire to structure

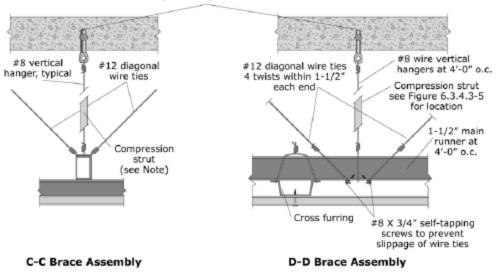

Note: Compression strut shall not replace hanger wire. Compresion strut consists of a steel section attached to main runner with 2 - #12 sheet metal screws and to structure with 2 - #12 screws to wood or $1/4^{\prime\prime}$ min. expansion anchor to concrete. Size of strut is dependent on distance between ceiling and structure ($I/r \le 200$). A 1" diameter conduit can be used for up to 6', a $1-5/8^{\prime\prime\prime}$ X $1-1/4^{\prime\prime\prime}$ metal stud can be used for up to 10'. See figure 6.3.4.1-6 for example of bracing assembly.

Figure G-16. Details for Lateral Bracing Assembly for Suspended Gypsum Board Ceiling. (FEMA E-74, 2012, Reducing the Risks of Nonstructural Earthquake Damage)

Light Fixtures

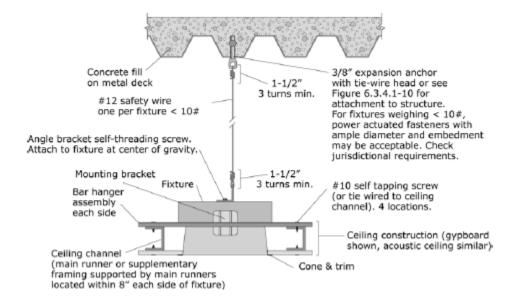


Figure G-17. Recessed Light Fixture in suspended Ceiling (Fixture Weight < 10 pounds). (FEMA E-74, 2012, Reducing the Risks of Nonstructural Earthquake Damage)

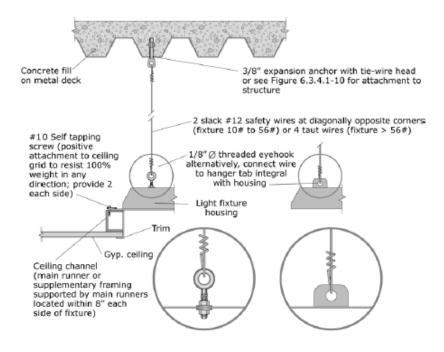


Figure G-18. Recessed Light Fixture in suspended Ceiling (Fixture Weight 10 to 56 pounds). (FEMA E-74, 2012, Reducing the Risks of Nonstructural Earthquake Damage)

Contents and Furnishings


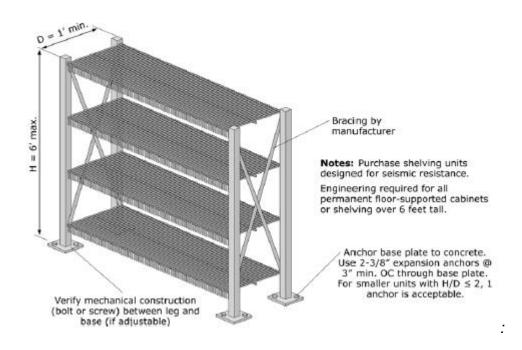


Figure G-19. Light Storage Racks. (FEMA E-74, 2012, Reducing the Risks of Nonstructural Earthquake Damage)

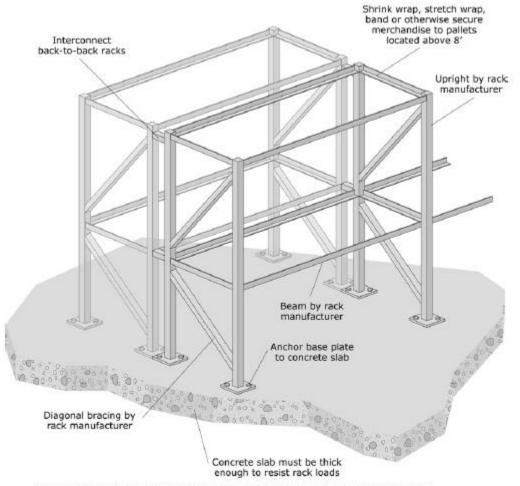

Note: Purchase storage racks designed for seismic resistance. Storage racks may be classified as either nonstructural elements or nonbuilding structures depending upon their size and support conditions. Check the applicable code to see which provisions apply.

Figure G-20. Industrial Storage Racks.
(FEMA E-74, 2012, Reducing the Risks of Nonstructural Earthquake Damage)

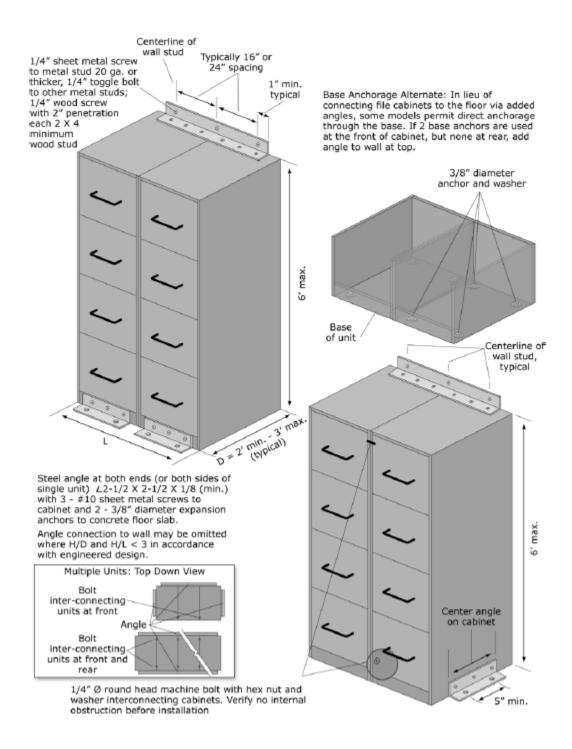


Figure G-21. Wall-mounted File Cabinets. (FEMA E-74, 2012, Reducing the Risks of Nonstructural Earthquake Damage)


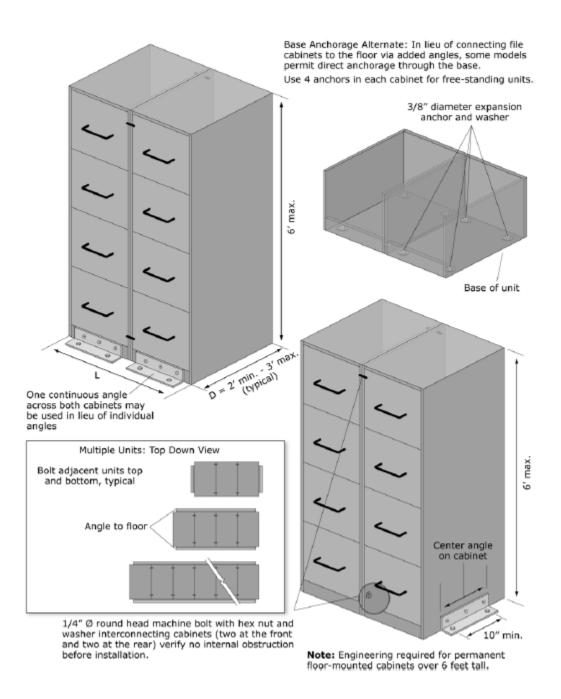


Figure G-22. Base Anchored File Cabinets. (FEMA E-74, 2012, Reducing the Risks of Nonstructural Earthquake Damage)

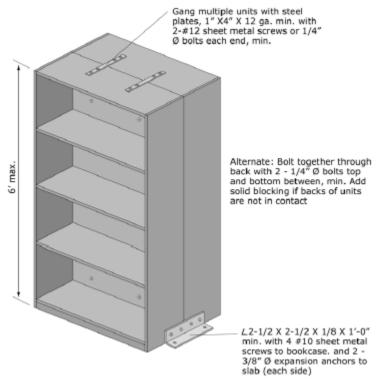

Note: Engineering required for all permanent floor-supported cabinets or shelving over 6 feet tall. Details shown are adequate for typical shelving 6 feet or less in height.

Figure G-23. Anchorage of Freestanding Book Cases Arranged Back to Back. (FEMA E-74, 2012, Reducing the Risks of Nonstructural Earthquake Damage)



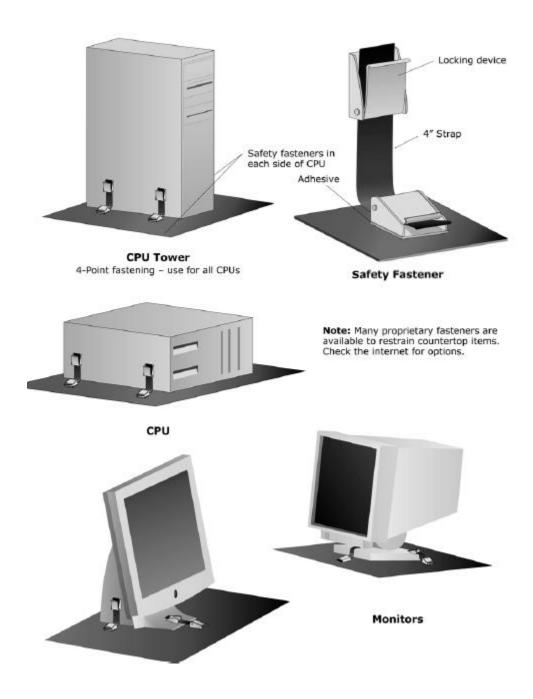


Figure G-24. Desktop Computers and Accessories. (FEMA E-74, 2012, Reducing the Risks of Nonstructural Earthquake Damage)

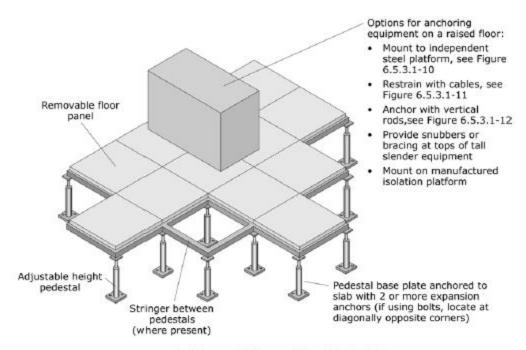

Cantilevered Access Floor Pedestal

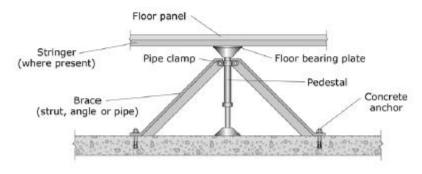


Braced Access Floor Pedestal

(use for tall floors or where pedestals are not strong enough to resist seismic forces)

Note: For new floors in areas of high seismicity, purchase and install systems that meet the applicable code provisions for "special access floors."


Figure G-25. Equipment Mounted on Access Floor.

(FEMA E-74, 2012, Reducing the Risks of Nonstructural Earthquake Damage)

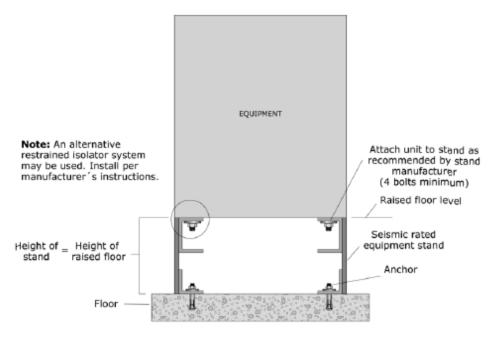


Equipment installed on an independent steel platform within a raised floor

Figure G-26. Equipment Mounted on Access Floor – Independent Base. (FEMA E-74, 2012, Reducing the Risks of Nonstructural Earthquake Damage)

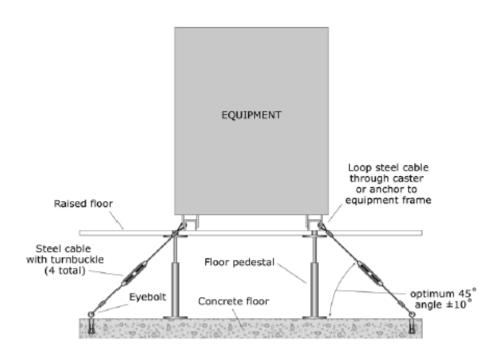

Equipment restrained with cables beneath a raised floor


Figure G-27. Equipment Mounted on Access Floor – Cable Braced. (FEMA E-74, 2012, Reducing the Risks of Nonstructural Earthquake Damage)

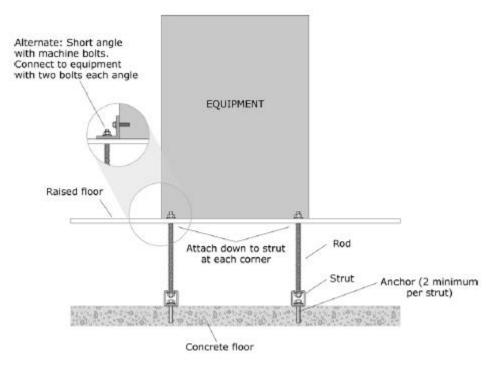

Equipment anchored with vertical rods beneath a raised floor


Figure G-28. Equipment Mounted on Access Floor – Tie-down Rods. (FEMA E-74, 2012, Reducing the Risks of Nonstructural Earthquake Damage)

Mechanical and Electrical Equipment

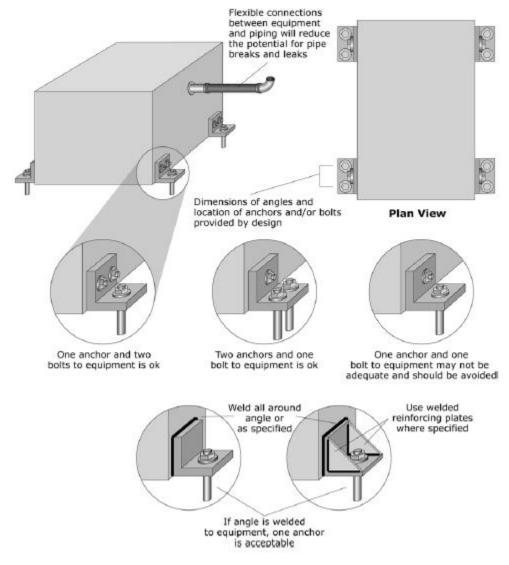


Note: Rigidly mounted equipment shall have flexible connections for the fuel lines and piping.


Figure G-29. Rigidly Floor-mounted Equipment with Added Angles. (FEMA E-74, 2012, Reducing the Risks of Nonstructural Earthquake Damage)

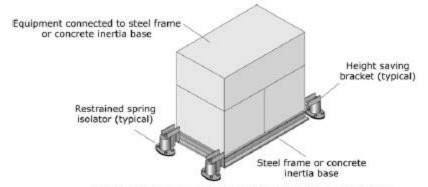

Supplemental base with restrained spring isolators

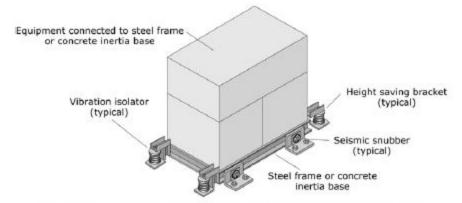

Supplemental base with open springs and all-directional snubbers

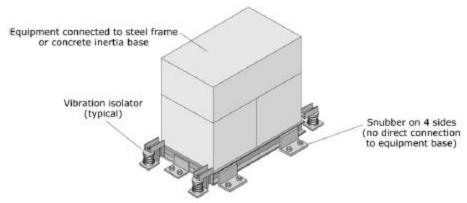

Supplemental base with open springs and one-directional snubbers

Figure G-30. HVAC Equipment with Vibration Isolation. (FEMA E-74, 2012, Reducing the Risks of Nonstructural Earthquake Damage)

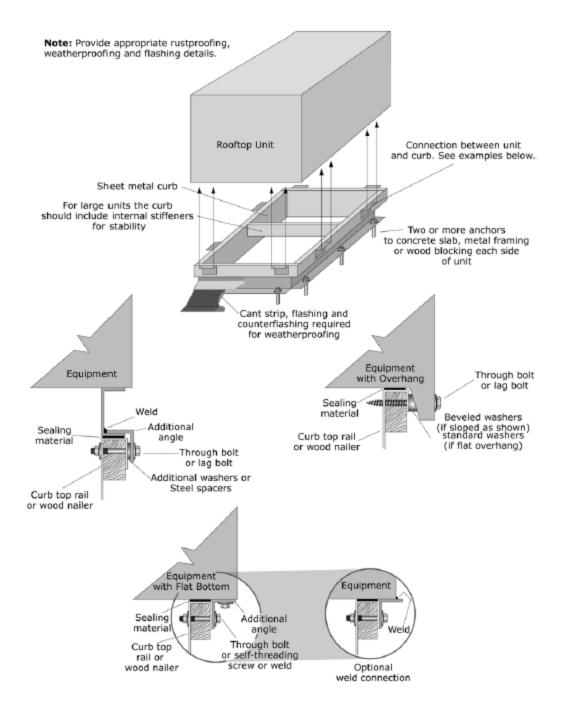


Figure G-31. Rooftop HVAC Equipment. (FEMA E-74, 2012, Reducing the Risks of Nonstructural Earthquake Damage)

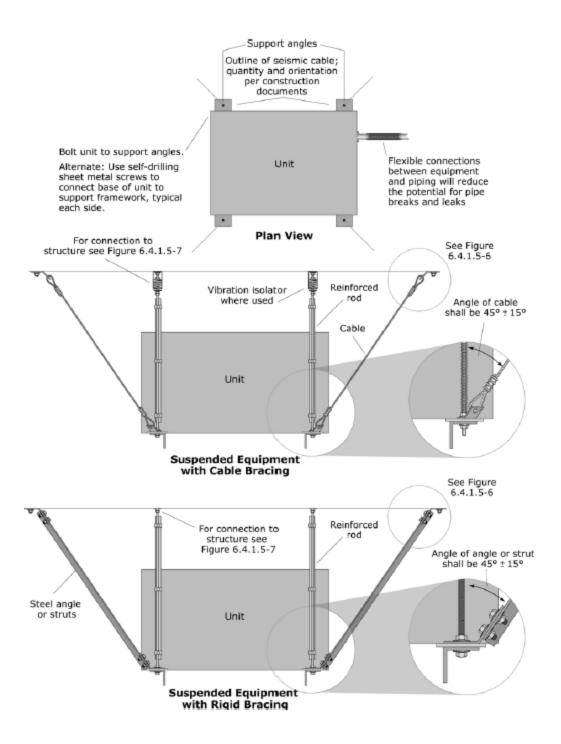


Figure G-32. Suspended Equipment. (FEMA E-74, 2012, Reducing the Risks of Nonstructural Earthquake Damage)

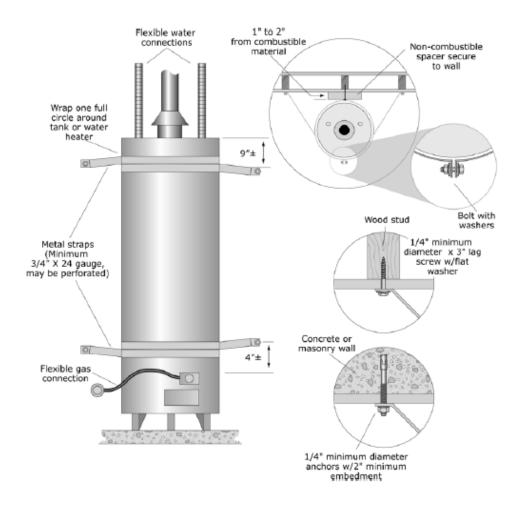


Figure G-33. Water Heater Strapping to Backing Wall. (FEMA E-74, 2012, Reducing the Risks of Nonstructural Earthquake Damage)

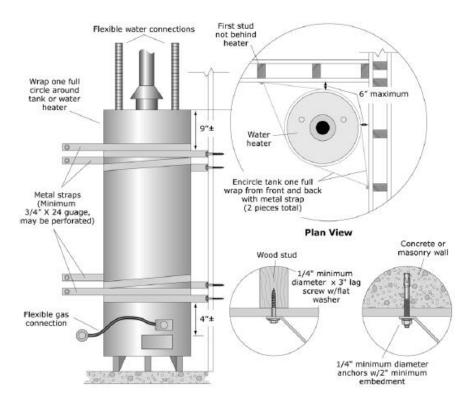


Figure G-34. Water Heater – Strapping at Corner Installation. (FEMA E-74, 2012, Reducing the Risks of Nonstructural Earthquake Damage)

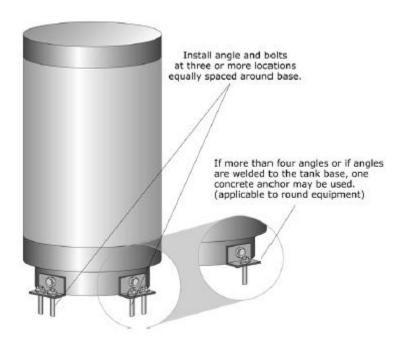


Figure G-35. Water Heater – Base Mounted. (FEMA E-74, 2012, Reducing the Risks of Nonstructural Earthquake Damage)

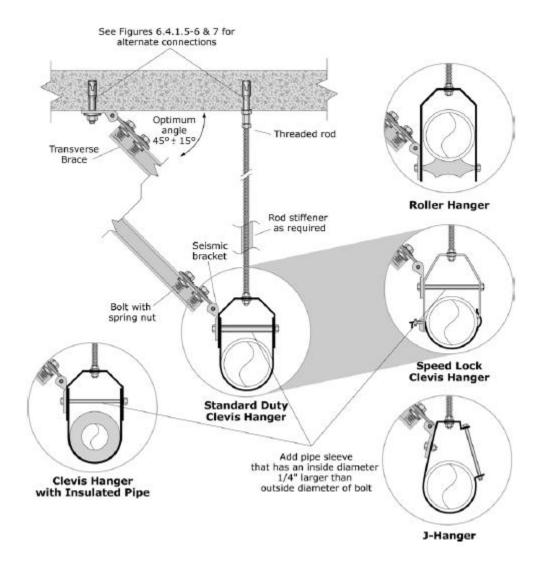


Figure G-36. Rigid Bracing – Single Pipe Transverse. (FEMA E-74, 2012, Reducing the Risks of Nonstructural Earthquake Damage)

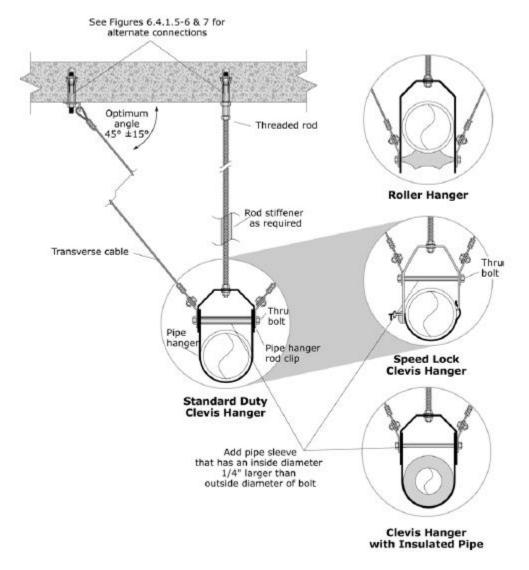


Figure G-37. Cable Bracing – Single Pipe Transverse. (FEMA E-74, 2012, Reducing the Risks of Nonstructural Earthquake Damage)

Electrical and Communications


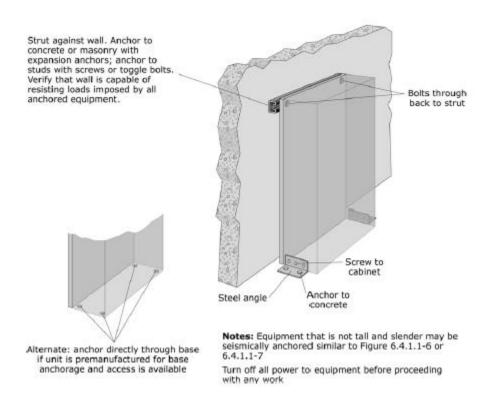


Figure G-38. Electrical Control Panels, Motor Controls Centers, or Switchgear. (FEMA E-74, 2012, Reducing the Risks of Nonstructural Earthquake Damage)

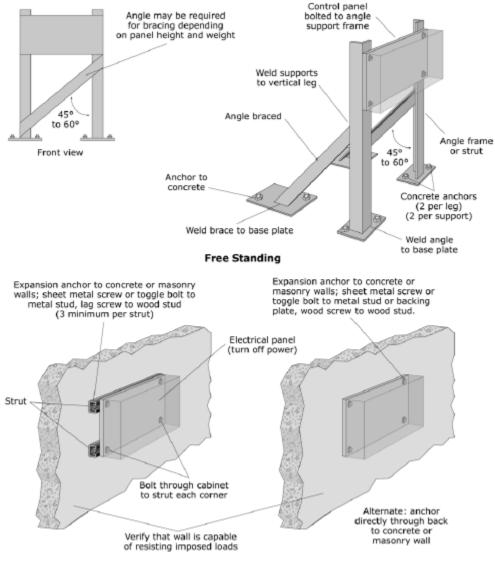

Wall-Mounted

Figure G-39. Freestanding and Wall-mounted Electrical Control Panels, Motor Controls Centers, or Switchgear.

(FEMA E-74, 2012, Reducing the Risks of Nonstructural Earthquake Damage)

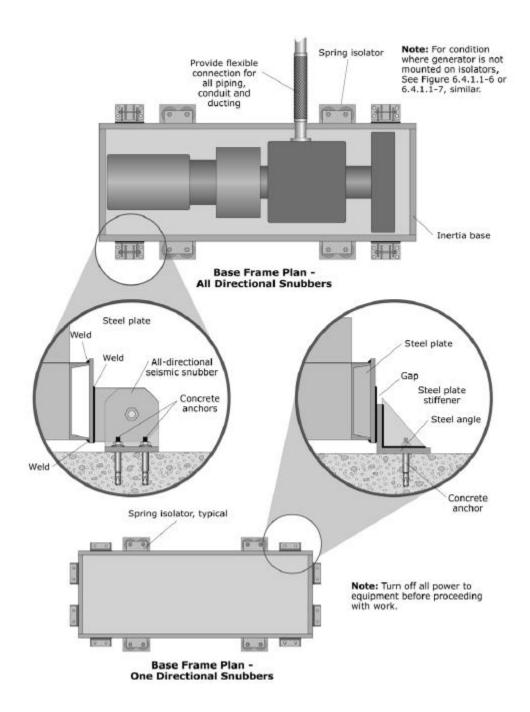


Figure G-40. Emergency Generator. (FEMA E-74, 2012, Reducing the Risks of Nonstructural Earthquake Damage)